
Borough of Oakland Wastewater Management Plan

Amending the following Areawide Water Quality Management Plans; Northeast WQMP

Date of Modified Submittal: <u>October 11, 2022</u>
Adopted by the New Jersey Department of Environmental Protection:

Prepared By:

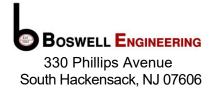

I. WASTEW	ATER MA	ANAGEMENT PLANNING AREA	1
INTRODUC	TION		2
		GEMENT PLANNING AREA	
STATUS OF	PREVIOUS	APPROVEDLOCAL WMPS	2
II. SUMMAI	RY OF SIC	GNIFICANT ACTIONS	3
SEWER SER	RVICE AREA	A DELINEATION CRITERIA	3
		ice Areas	
Environn	nentally Se	nsitive Areas	3
		e Highlands	
Septic Sy	ystem Dev	elopment within the Sewer Service Areas	4
		Areas	
PLANNING	COORDINA	ATION	4
III. EXISTIN	NG AND F	UTURE WASTEWATER TREATMENT FACILITIES	5
OVERVIEW	OF WASTI	EWATER SERVICES AND WASTEWATER RESPONSIBILITIES	5
	Existing Public Wastewater Treatment Works and Service Area		
WASTEWAT	TER FACILI	TY TABLES	6
IV. WASTE	WATER T	TREATMENT CAPACITY ANALYSIS – SEWER SERVICE AREA	38
CALCULAT	ING EXISTI	ING WASTEWATER FLOWS	38
Existing	Developme	ent	38
ASSIGNED S	SEWER SEF	RVICE AREA CAPACITY ANALYSES	38
		WASTEWATER FLOWS	
Wastewa	iter Deman	d Projections in Sewer Service Areas	39
INTERBASII	N TRANSFE	R	40
V. NITRAT	E DILUTI	ON ANALYSIS - NON-SEWERSERVICE AREA	41
WASTEWAT	TER DEMAI	ND PROJECTIONS IN NON-SEWERSERVICE AREAS	41
VI. MITIGA	TION ST	RATEGIES	44
VII. SEPTIC	MAINTE	ENANCE PROGRAM	44
VIII. MAPPI	NG		47
		THE WASTEWATER MANAGEMENTPLAN APPROVAL	
		THE WASTEWATER MANAGEMENTPLAN APPROVAL	49
LIST OF MA	APS		
	Maps	Title	
	1	WMP Area	

Maps	Title
1.	WMP Area
2.	Selected Environmentally Sensitive Features
3.	Wastewater Service Areas
4.	Municipal Zoning
5.	Vacant Land
6.	Recorded Sanitary Issues Map

I. Wastewater Management Planning Area

Introduction

The Borough is seeking the approval of a Water Quality Management Plan (WQMP) amendment to allow for a practical means to provide a central sewer system served by the Northwest Bergen County Utilities Authority (NBCUA), which will coincide with the adoption of the Septic Management Ordinance as a condition of the approval. This approach would provide a platform to extend the sanitary collection system into the proposed area while also initiating stricter water quality regulations on individual disposal systems in areas outside of the proposed sewer service area (SSA). The Borough estimates a 20 year-buildout of a sanitary collection system within the Highlands Planning Area will result in a maximum of 856,166 gallons per day (gpd) of flow being directed into a sanitary sewer system.

The purpose of this document is to provide a comprehensive Wastewater Management Plan (WMP) for the Borough of Oakland, pursuant to the WQMP rules, effective November 7, 2016. The WMP has been submitted to the New Jersey Department of Environment Protection for approval via the plan amendment procedure at N.J.A.C. 7:15-3.

Wastewater Management Planning Area

This plan outlines the anticipated wastewater management needs for the Borough. The Plan is based upon data compiled from current Borough sewer policies, existing wastewater treatment facilities and their service areas, and proposed developments pending before the Borough land use boards. Current zoning and existing land use have been utilized to determine the future of wastewater disposal needs.

The Borough is located along the northwestern boundary of Bergen County, New Jersey. Oakland is bordered on the west by the Borough of Wanaque, on the north by the Township of Mahwah, on the east by the Borough of Franklin Lakes and on the south by the Township of Pompton Lakes.

The overall land area of Oakland is approximately 8.782 square miles with a population of approximately 12,754 according to the 2010 US Census.

The Borough owns and operates three (3) small Wastewater Treatment Plants (WTPs) serving 258 residential units. These Borough-owned facilities include Skyview-Hibrook WTP, Chapel Hill WTP and Oakwood Knolls WTP. The local board of education owns an additional WTP servicing the Indian Hills Regional High School. There are also twenty-five (25) privately owned WTPs operating in the Borough at this time. Additionally, there are approximately 3,000 commercial and residential properties throughout the Borough served by individual onsite septic systems and cesspools. These systems have experienced significant problems relating to water quality. The Borough has actively sought a long-term solution to these problems and determined a central sanitary sewer system is necessary.

Many of the existing systems throughout the Borough are failing. Available records indicate that the systems are past their useful life and no permits have been issued to replace the systems. Failing septic systems and cesspools may leak excessive nutrients into groundwater and may have an impact on nearby surface waters. Below is a summary of the findings of the study (Map is in Appendix C):

TABLE 1.1: Individual Onsite System Study Findings

Neighborhood	Number of Systems Reviewed	Number of Cesspools	Percentage of Non- Compliance of All Systems Reviewed
Campgaw	66	22	91%
College Streets	81	55	86%
Crystal Lake	106	49	90%
Dogwood	79	27	85%
Downtown	42	27	93%
Heights	65	38	94%
Indian Hills	71	33	87%
Industrial Park	58	21	90%
Longhill	51	6	84%
Manito	67	37	90%
Mirror Lake	78	26	88%
Muni & Rec	46	11	87%
Potash Lake	27	1	93%
Pleasureland	145	26	98%
Industrial	24	8	86%
Ramapo Res.	sewered	-	-
Ramapo River	66	25	91%
Skyline	34	11	91%
W. Oakland Ave	83	22	95%
TOTAL:	1,189	445	90% (AVG)

Many of the systems, which were designed in the 1950's through the 1980's, fail to meet the latest NJDEP "Standards for Individual Subsurface Sewage Disposal Systems" last revised April 2, 2012 (N.J.A.C. 7:9A). In addition, the systems are located on lot sizes that do not conform to the average lot size per septic system by Land Use Capability Zone as dictated by Highlands. Further, there are at least 445 systems known to be cesspools and no repair date on file with Oakland's Health Department. Since critical requirements from both regulatory agencies are not being met and prevalent failures are occurring Borough-wide, the importance and need for a central sanitary sewer system becomes readily apparent.

The complete results of our system study are outlined in Section III.

Status of Previous Approved Local WMPs

The last WMP for the Borough that was approved by the DEP is dated 1990.

II. Summary of Significant Actions

Sewer Service Area Delineation Criteria

The criteria utilized to delineate the SSA included an evaluation of the existing WTPs and failing systems. The proposed SSA is the portion of the Borough tributary to the failing Borough owned WTPs, the surrounding areas and the Borough's downtown corridor. By installing sewers in the downtown area, it will permit the Borough to implement the goals of its Master Plan and allow for limited re- development of its downtown corridor.

The WTPs owned by the Borough require significant capital investment to effectively operate now and in the near future. This WMP proposes to decommission the WTPS owned by the Borough and divert their wastewater to NBCUA. The lack of a sanitary collection/treatment system has also adversely affected both the water quality and redevelopment patterns of the downtown and nearby residential areas. These areas are also proposed to be included in the NBCUA SSA proposed in this WMP.

The proposed SSA boundaries were developed to avoid including properties located in the Highlands Preservation Area, which are restricted by the Highlands Act. The proposed SSA was modified based on comments from the NJDEP and Highlands Council to ensure compliance with the following regulations.

According to the requirements of N.J.A.C. 7:38-3.3, any new discharge that would require an individual or general NJPDES permit and any extension of a sewer line that requires a Treatment Works Approval is prohibited within the preservation area unless the development in the preservation area satisfies any one of the following criteria:

- 1. Is exempt from the Highlands Act pursuant to N.J.A.C. 7:38-2.3 and consistent with the applicable areawide WQMP;
- 2. Qualifies for an emergency HPAA pursuant to N.J.A.C. 7:38-7; or
- 3. Qualifies for an HPAA with waiver in accordance with N.J.A.C. 7:38-6.

Eligible Sewer Service Areas

The term "Eligible for sewer service area" means areas determined to meet the criteria for designation as sewer service in accordance with N.J.A.C. 7:15-4.4, and are identified as "Assigned sewer service area," differentiating between areas that currently convey sewage to each existing facility and that which is proposed to convey sewage to each existing or proposed facility; or "Unassigned sewer service area," which are areas mapped for future sewer service with no designated treatment facility.

The current SSA is approximately 243.15 acres, comprised of 150.88 assigned to Ramapo River Reserve, 37.97 acres to Skyview, 44.11 acres to Oakwood Knolls and 10.19 acres to Chapel Hill Estates. The new SSA for NBCUA will be approximately 1059 acres.

The Bi-County Tract SSA will be approximately 50.6 acres, and pursuant to court order, will convey its flow to the Mountain View WTP in the Township of Wayne.

The proposed SSA is delineated on Map 3A in Appendix B. A summary of the permitted facilities, which are to be included in the SSA are described in Section III of this report.

Environmentally Sensitive Areas

Under the WQMP rules, large contiguous environmentally sensitive areas, or "ESAs," defined as 25 acres or larger consisting of habitat for Threatened and Endangered Species as identified on the Landscape Project Maps of Habitat for Endangered, Threatened or Other Priority Species version 3.3, Natural Heritage Priority Sites, Category One waters and their corresponding 300 foot riparian zones, and wetlands, alone or in combination are not eligible for sewer service.

Environmentally sensitive area 25 acres or larger are found in the area of the proposed Crystal Lake and Bi-County Tract SSAs. The environmentally sensitive areas around Crystal Lake not included in the proposed SSA. Only the residential zones surrounding the lake were left within the proposed SSA due to the number of failing systems. A Settlement Agreement between the Bi-County Development Corp. and the New Jersey Department of Environmental Protection (OAL Docket No. ELU06606-10N), signed in 2014, established that the property would remain in the SSA as the environmentally sensitive areas had been addressed in the Comprehensive Conservation Plan developed for the property.

Sewer Service in the Highlands

The existing SSA includes all NJPDES permitted wastewater treatment facilities within the Borough, whether discharging to surface or ground water as illustrated on Map 3A. The currently proposed SSA falls entirely within the Highlands planning area and does not extend into the Highlands preservation area, with the exception of the Bi-county tract which the New Jersey Department of Environmental Protection determined to be exempt from the Highlands Act under N.J.S.A 13:20-28(a)(17).

Septic System Development within the Sewer Service Areas

As the sanitary sewer system is built out throughout the Borough, all existing properties in the proposed SSA which currently utilize septic systems and cesspools, will have 36 months to connect to the new system. The Borough will pass an ordinance mandating the connection to the new sewer system.

Non-Sewer Service Areas

All properties in the Borough's non-sewer service area will be subject to a septic maintenance program that will ensure these facilities are functioning properly. Details of the septic maintenance program are included in Section VII.

Properties in the proposed SSA will adhere to the septic maintenance program until they connect to the proposed sanitary system, for which they'll have 36 months to do so.

Planning Coordination

N.J.A.C. 7:15-3.5 (f) requires the Borough to notify all governmental entities that have regulatory or planning jurisdiction over wastewater, water supply, or land use in any sewer service area being modified. The following agencies are:

- SUEZ Water NJ
- Passaic Valley Water Commission
- North Jersey District Water Supply Commission
- Great Falls Hydroelectric Company

- City of Paterson DPW Great Falls Raceway
- Dundee Water Power & Land Company c/o Suez Water NJ
- NBCUA
- Borough of Franklin Lakes
- Township of Wayne

The municipality has informed all the stakeholders listed above of the proposed WMP. To date, no specific issues have been brought to our attention from the agencies mentioned above.

Highlands Council

The Borough is located within the Highlands Planning Area and the Highlands Preservation Area. The Borough is no longer a conforming municipality but will comply with Highlands regulation for the parts of the Borough that fall within the Highlands Preservation Area. The Borough has been coordinating with the Highlands Council to secure a Highlands Regional Master Plan (RMP) Consistency Determination, which is necessary for the modification of the Borough's water allocation permit. The Borough revised the proposed SSA in response to the Highland's comments and submitted a copy of a prior draft of the WMP for their review. The Highlands Council requested that in accordance with Executive Order 114 (EO 114), the farm located on Block 4004, Lots 4 and 5 be removed from the proposed SSA. Therefore, Block 4004, Lots 4 and 5 have been removed. However, as noted under EO 114, the Fanale tract is also located within the Protection Zone, but due to ongoing Affordable Housing litigation, the property will remain in the proposed SSA.

The Borough adopted a Water Use and Conservation Management Plan (WUCMP) on August 12, 2021, which includes a mitigation plan to address the transfer of wastewater to the NBCUA WTP. The preparation of the WUCMP was a condition of the RMP Consistency Determination. In order to obtain the Consistency Determination from the Highlands Council, the Borough has identified mitigation strategies for a minimum of 100% of the proposed inter- basin transfer. The preparation and full implementation of the municipal wide Water User and Conservation Management Plan is to account for existing and future water deficits in the Borough.

III. Existing and Future Wastewater Treatment Facilities

This section addresses wastewater treatment facilities currently or anticipated to be utilized within the Borough, whether the treatment works itself is located within or outside of the municipality.

Overview of Wastewater Services and Wastewater Responsibilities

Only a small portion of the Borough is currently serviced by existing wastewater treatment facilities. This area includes community wastewater systems that serve 5% percent of the total Borough population. After performing an assessment of each of the three Borough owned wastewater treatment facilities, it was determined that the plants are at the end of their useful life. Two (2) alternatives have been identified to remedy the situation and avoid failure of the system:

- Complete replacement of the three (3) WTPs with new packaged plants.
- Decommissioning of the plants and installation of pumping stations to convey flow to the NBCUA.

The wastewater treatment facilities' assessment report is included in Appendix C.

A study of the existing individual onsite septic systems and cesspools throughout the Borough was completed in 2016. There are over 3,000 systems throughout the municipality. A sampling of over 1,000 system records throughout the different neighborhoods in the Borough were reviewed. Of the 1,000 systems, over 400 systems still rely on cesspools, which historically were made of concrete or cinder block with open joints. The improperly functioning systems allow untreated sewage to runoff into receiving ground and surface water. Findings indicate that many of the systems, which were designed in the 1950's through the 1980's, fail to meet the latest NJDEP "Standards for Individual Subsurface Sewage Disposal Systems" (N.J.A.C. 7:9A). Further, there are at least 445 systems which are known cesspools with no repair date on file with Oakland's Health Department. Since critical requirements from regulatory agencies are not being met and prevalent failures are occurring Borough-wide, the importance and need for a central sanitary sewer system becomes readily apparent. The findings are outlined in Appendix C, including a map illustrating the locations of each neighborhood within the Borough.

Existing Public Wastewater Treatment Works and Service Area

The table below lists the <u>major</u> domestic wastewater treatment facilities within Oakland Borough and the portion of the municipality they serve.

Wastewater Utility	Area Served
Skyview-Hibrook	68 Homes in the vicinity of Lakeside Boulevard
Oakwood Knolls	166 connections from the Oakcrest Townhouse Development and the Coppertree Mall.
Chapel Hill	24 homes in Chapel Hill Estates
Indian Hills HS	Indian Hills High School
Ramapo River	Ramapo River Reserve development; approximately 320 acres

Wastewater Facility Tables

This section addresses wastewater treatment facilities currently or anticipated to be utilized by development within the municipality, whether the treatment works itself is located within or outside of the municipality. Facility tables are provided for each existing and proposed wastewater treatment facility.

Table 3.1 Skyview-Hibrook WTP			
1. Existing or proposed facility: Existing*			
New Jersey Pollutant Discharge Elimination System Permit Number:	NJ0021342		
Discharge to ground water (DGW) or surface water (DSW):			
Receiving water or aquifer:	Pond Brook		
5. Classification of receiving water or aquifer:	FW2-NT		
6. Owner of facility:	Borough of Oakland		
7. Operator of facility:	Gerald C. Kastner		
8. Co-Permittee of facility (where applicable):			
9. Location of facility:	179 Lakeside Boulevard		
a. Municipality & County	Oakland, Bergen		
b. Street address	179 Lakeside Boulevard		
c. Block(s) and Lot(s)	5004,67		
10. Location of discharge (i.e. degrees, minutes,	a. Longitude 74.215851		
seconds):	b. Latitude 41.03141		
	c. State Plane Coordinates		
	x 570475, y 800793		
11. Present permitted flow or permit condition (DSW) or daily maximum (DGW):	0.023 MGD		
*12. Summary of population served/to be served (including major seasonal fluctuations if applicable):	Current (Year 2019) Population	Build-out	
Municipality: Oakland	196	0	
Total	196	0	
*13. Summary of wastewater flow received/to be received as a 30-day average flow for DSW or a daily maximum flow for DGW:	Current (Year 2019) Flow (in MGD)	Build-out (in MGD)	
Municipality: Oakland	0.017	0	
Facility Total	0.017 MGD	0	

^{*} Facility is not expected to expand and is anticipated to connect to NBCUA. Wastewater flows previously sent to this facility will be accounted for in the NBCUA facility table.

Table 3.2 Oakwood Knolls WTP				
1. Existing or proposed facility: Existing*				
New Jersey Pollutant Discharge Elimination System Permit Number:	NJ0027774			
3. Discharge to ground water (DGW) or surface water (DSW):				
Receiving water or aquifer:	Ramapo River Tributary			
5. Classification of receiving water or aquifer:	FW2-NT			
6. Owner of facility:	Borough of Oakland			
7. Operator of facility:	Gerald C. Kastner			
8. Co-Permittee of facility (where applicable):				
9. Location of facility:	101 East Oak Street	101 East Oak Street		
a. Municipality & County	Oakland, Bergen			
b. Street address	101 East Oak Street			
c. Block(s) and Lot(s)	3903, 89			
10. Location of discharge (i.e. degrees, minutes,	a. Longitude 74.240001			
seconds):	b. Latitude 41.023542			
	c. State Plane Coordinates			
	x 563876.30, y 797869.53			
11. Present permitted flow or permit condition (DSW) or daily maximum (DGW):	0.035 MGD			
*12. Summary of population served/to be served (including major seasonal fluctuations if applicable):	Current (Year 2019) Population	Build-out		
Municipality: Oakland	465	0		
Total	465	0		
*13. Summary of wastewater flow received/to be	Current (Year 2019) Flow	Build-out		
received as a 30-day average flow for DSW or a daily maximum flow for DGW:	(in MGD)	(in MGD)		
Municipality: Oakland	0.030	0		
Facility Total	0.030 MGD	0		

^{*} Facility is not expected to expand and is anticipated to connect to NBCUA. Wastewater flows previously sent to this facility will be accounted for in the NBCUA facility table.

Table 3.3 Oakland Care Center			
Existing or proposed facility: Existing			
New Jersey Pollutant Discharge Elimination System Permit Number:	NJ0029858		
3. Discharge to ground water (DGW) or surface water (DSW):	DSW		
Receiving water or aquifer:	Hoppers Lake		
5. Classification of receiving water or aquifer:	FW2-NT		
6. Owner of facility:	Oakland Operator LLC DBA	1	
7. Operator of facility:	Sam Goldberger		
8. Co-Permittee of facility (where applicable):			
9. Location of facility:	20 Breakneck Road	20 Breakneck Road	
a. Municipality & County	Oakland, Bergen		
b. Street address	20 Breakneck Road		
c. Block(s) and Lot(s)	3101, 5		
10. Location of discharge (i.e. degrees, minutes,	a. Longitude 74.246981		
seconds):	b. Latitude 41.001305		
	c. State Plane Coordinates		
	x 561824 y 789408		
11. Present permitted flow or permit condition (DSW) or daily maximum (DGW):	0.030 MGD		
*12. Summary of population served/to be served (including major seasonal fluctuations if applicable):	Current (Year 2019) Population	Build-out	
Municipality: Oakland	215 beds	215 beds	
Total	215 beds	215 beds	
13. Summary of wastewater flow received/to be received as a 30-day average flow for DSW or a daily maximum flow for DGW:	Current (Year 2019) Flow (in MGD)	Build-out (in MGD)	
Municipality: Oakland	0.03	0.03 MGD	
Facility Total	0.03 MGD	0.03 MGD	

Table 3.4 Chapel Hill Estates STP			
Existing or proposed facility:	Existing*		
New Jersey Pollutant Discharge Elimination System Permit Number:	NJ0053112		
3. Discharge to ground water (DGW) or surface water (DSW):	DSW		
Receiving water or aquifer:	Pond Brook Tributary		
5. Classification of receiving water or aquifer:	FW2-NT		
6. Owner of facility:	Borough of Oakland		
7. Operator of facility:	Gerald C. Kastner		
8. Co-Permittee of facility (where applicable):			
9. Location of facility:	145 Hiawatha Boulevard		
a. Municipality & County	Oakland, Bergen		
b. Street address	145 Hiawatha Boulevard		
c. Block(s) and Lot(s)	5204, 25		
10. Location of discharge (i.e. degrees, minutes,	a. Longitude 74.226775		
seconds):	b. Latitude 41.036746		
c. State Plane Coordinates			
	x 567497.53, y 802670.17		
11. Present permitted flow or permit condition (DSW) or daily maximum (DGW):	0.01 MGD		
*12. Summary of population served/to be served (including major seasonal fluctuations if applicable):	Current (Year 2019) Population	Build-out	
Municipality: Oakland	58	0	
Total	58	0	
*13. Summary of wastewater flow received/to be received as a 30-day average flow for DSW or a daily maximum flow for DGW:	Current (Year 2019) Flow (in MGD)	Build-out (in MGD)	
Municipality: Oakland	0.007	0	
Facility Total	0.007 MGD	0	

^{*} Facility is not expected to expand and is anticipated to connect to NBCUA. Wastewater flows previously sent to this facility will be accounted for in the NBCUA facility table.

Table 3.5				
Ramapo River Reserve WTP				
Existing or proposed facility:	Existing			
New Jersey Pollutant Discharge Elimination System Permit Number:	NJ0080811			
3. Discharge to ground water (DGW) or surface water (DSW):	DSW			
4. Receiving water or aquifer:	Ramapo River Tributary			
5. Classification of receiving water or aquifer:	FW2-NT			
6. Owner of facility:	Ramapo River Reserve			
7. Operator of facility:	Karl Weber			
8. Co-Permittee of facility (where applicable):				
9. Location of facility:	27 Waters Edge			
a. Municipality & County	Oakland, Bergen			
b. Street address	27 Waters Edge			
c. Block(s) and Lot(s)	1103, 10			
10. Location of discharge (i.e. degrees, minutes,	a. Longitude 74.231524			
seconds):	b. Latitude 41.047243			
	c. State Plane Coordinates			
	x 566226, y 806545			
11. Present permitted flow or permit condition (DSW) or daily maximum (DGW):	0.1137 MGD			
12. Summary of population served/to be served (including major seasonal fluctuations if applicable):	Current (Year 2019) Population	Build-out		
Municipality: Oakland	810	810		
Total	810	810		
13. Summary of wastewater flow received/to be received as a 30-day average flow for DSW or a daily maximum flow for DGW:	Current (Year 2019) Flow (in MGD)	Build-out (in MGD)		
Municipality: Oakland	0.092	0.092		
Facility Total 0.092 MGD 0.092 MGD				

Table 3.6 Indian Hills High School				
1. Existing or proposed facility: Existing				
New Jersey Pollutant Discharge Elimination System Permit Number:	NJG0021253			
3. Discharge to ground water (DGW) or surface water (DSW):	DSW	DSW		
Receiving water or aquifer:	Pond Brook Tributary			
5. Classification of receiving water or aquifer:	FW2-NT			
6. Owner of facility:	Oakland Board of Ed			
7. Operator of facility:	Michael Lyons			
8. Co-Permittee of facility (where applicable):	8. Co-Permittee of facility (where applicable):			
9. Location of facility:	97 Yawpo Avenue			
a. Municipality & County	Oakland, Bergen			
b. Street address	97 Yawpo Avenue			
c. Block(s) and Lot(s)	4101, 1			
10. Location of discharge (i.e. degrees, minutes,	ites, a. Longitude 74.231325			
seconds):	b. Latitude 41.02243			
	c. State Plane Coordinates			
	x 566012, y 797854			
11. Present permitted flow or permit condition (DSW) or daily maximum (DGW):	0.0336 MGD			
12. Summary of population served/to be served (including major seasonal fluctuations if applicable):	Current (Year 2019) Population	Build-out		
Municipality: Oakland	1226 Students	0		
Total	1226 Students	0		
13. Summary of wastewater flow received/to be received as a 30-day average flow for DSW or a daily maximum flow for DGW:	Current (Year 2019) Flow (in MGD)	Build-out (in MGD)		
Municipality: Oakland	0.005	0		
Facility Total	0.005 MGD	0		
* Easility is not expected to expend and is entisinated to connect to NDCIIA. Westerwater flows				

^{*} Facility is not expected to expand and is anticipated to connect to NBCUA. Wastewater flows previously sent to this facility will be accounted for in the NBCUA facility table.

Table 3.7 Engineering Laboratories Inc SANITARY SUBSURFACESEWAGE DISPOSAL SYSTEM GENERAL PERMIT (T-1 PERMIT) TREATMENT FACILITY TABLE

New Jersey Pollutant Discharge Elimination System Permit Number:	NJG0051471		
Discharge to ground water (DGW) or surface water (DSW):	DGW		
3. Receiving water or aquifer:	Igneous and Metamorphic Rocks		
4. Classification of receiving water or aquifer:	II-A		
5. Owner of facility:	Peter R. Spinney, Inc		
6. Operator of facility:	Peter R. Spinney		
7. Location of facility:	360 West Oakland Avenue		
a. Municipality & County	Oakland, Bergen		
b. Street address	360 West Oakland Avenue		
c. Block(s) and Lot(s)	103, 3		
8. Location of discharge (i.e. degrees, minutes,	a. Longitude 74.265386		
seconds):	b. Latitude 41.017079		
	c. State Plane Coordinates		
	x 556994, y 796188		
10. Summary of population served/to be served (including major seasonal fluctuations if applicable):	Current (Year 2019) Population	Build-out	
Municipality: Oakland	31 Employees	31 Employees	
Total	31 Employees	31 Employees	
Other: Refer to N.J.A.C. 7:9A-7.4	Estimated Flow: 0.002275 MGD		

^{*} Facility is not expected to expand. The existing flow is unmetered. The above identified flow is calculated based on existing uses in accordance with N.J.A.C. 7:9A design criteria.

Table 3.8 Topcon Medical Systems, Inc.			
Existing or proposed facility:	Existing		
New Jersey Pollutant Discharge Elimination System Permit Number:	NJ0078565		
3. Discharge to ground water (DGW) or surface water (DSW):	DGW		
Receiving water or aquifer:	Brunswick Shale		
5. Classification of receiving water or aquifer:	II-A		
6. Owner of facility:	111 Bauer Drive LLC		
7. Operator of facility:			
8. Co-Permittee of facility (where applicable):			
9. Location of facility:	111 Bauer Drive		
a. Municipality & County	Oakland, Bergen		
b. Street address	111 Bauer Drive		
c. Block(s) and Lot(s)	3203, 4		
10. Location of discharge (i.e. degrees, minutes, a. Longitude 74.241041			
seconds):	b. Latitude 41.006735		
	c. State Plane Coordinates		
	x 563790, y 791736		
11. Present permitted flow or permit condition (DSW) or daily maximum (DGW):	0.0085 MGD		
12. Summary of population served/to be served (including major seasonal fluctuations if applicable):	Current (Year 2019) Population	Build-out	
Municipality: Oakland	340 Employees	340 Employees	
Total	340 Employees	340 Employees	
13. Summary of wastewater flow received/to be received as a 30-day average flow for DSW or a daily maximum flow for DGW:	Current Year 2019 Flow (in MGD)	Build-out (in MGD)	
Municipality: Oakland	0.0008	0.0085	
Facility Total 0.0008 MGD 0.0085 MGD			

Table 3.9 Cablevision of Oakland		
Existing or proposed facility:	Existing	
New Jersey Pollutant Discharge Elimination System Permit Number:	NJ0083038	
3. Discharge to ground water (DGW) or surface water (DSW):	DGW	
4. Receiving water or aquifer:	Crystalline Rocks	
5. Classification of receiving water or aquifer:	II-A	
6. Owner of facility:	Cablevision of Oakland	
7. Operator of facility:	Karl Weber	
8. Co-Permittee of facility (where applicable):		
9. Location of facility:	40 Potash Road	
a. Municipality & County	Oakland, Bergen	
b. Street address	40 Potash Road	
c. Block(s) and Lot(s)	3601, 4	
10. Location of discharge (i.e. degrees, minutes,	a. Longitude 74.240183	
seconds):	b. Latitude 41.011097	
	c. State Plane Coordinates	
	x 563880, y 793292	
11. Present permitted flow or permit condition (DSW) or daily maximum (DGW):	0.002	2 MGD
12. Summary of population served/to be served (including major seasonal fluctuations if applicable):	Current (Year 2019) Population	Build-out
Municipality: Oakland	40 Employees	32 Employees
Total	40 Employees	32 Employees
13. Summary of wastewater flow received/to be received as a 30-day average flow for DSW or a daily maximum flow for DGW:	Current Year 2019 Flow (in MGD)	Build-out (in MGD)
Municipality: Oakland	0.0007	0.00048
Facility Total	0.0007 MGD	0.00048 MGD

Table 3.10 Platinum Press Inc.		
Existing or proposed facility:	Existing	
New Jersey Pollutant Discharge Elimination System Permit Number:	NJ0086797	
3. Discharge to ground water (DGW) or surface water (DSW):	DGW	
4. Receiving water or aquifer:	Undifferentiated glacial drif	t
5. Classification of receiving water or aquifer:	II-A	
6. Owner of facility:	CK Bergen Associates, LLC)
7. Operator of facility:	Karl Weber, NJ American C	Co.
8. Co-Permittee of facility (where applicable):		
9. Location of facility:	5 Thornton Road	
a. Municipality & County	Oakland, Bergen	
b. Street address	5 Thornton Road	
c. Block(s) and Lot(s)	2303, 1	
10. Location of discharge (i.e. degrees, minutes,	a. Longitude 74.240183	
seconds):	b. Latitude 41.007123	
	c. State Plane Coordinates	
	x 563939, y 791565	
11. Present permitted flow or permit condition (DSW) or daily maximum (DGW):	0.001	9 MGD
12. Summary of population served/to be served (including major seasonal fluctuations if applicable):	Current (Year 2019) Population	Build-out
Municipality: Oakland	25 Employees	25 Employees
Total	25 Employees	25 Employees
13. Summary of wastewater flow received/to be received as a 30-day average flow for DSW or a daily maximum flow for DGW:	Current Year 2019 Flow (in MGD)	Build-out (in MGD)
Municipality: Oakland	0.000749	0.000749
Facility Total	0.000749 MGD	0.000749 MGD

Table 3.11 Robert Michael Shopping Center		
Existing or proposed facility:	Existing	
New Jersey Pollutant Discharge Elimination System Permit Number:	NJ0167126	
3. Discharge to ground water (DGW) or surface water (DSW):	DGW	
4. Receiving water or aquifer:	Glacial Till	
5. Classification of receiving water or aquifer:	II-A	
6. Owner of facility:	Robert Michael Shopping C	enter
7. Operator of facility:	R. Michael Kennedy	
8. Co-Permittee of facility (where applicable):		
9. Location of facility:	340 Ramapo Valley Road	
a. Municipality & County	Oakland, Bergen	
b. Street address	340 Ramapo Valley Road	
c. Block(s) and Lot(s)	3906, 2	
10. Location of discharge (i.e. degrees, minutes,	a. Longitude 74.241984	
seconds):	b. Latitude 41.023341	
	c. State Plane Coordinates	
	x 563208, y 797837	
11. Present permitted flow or permit condition (DSW) or daily maximum (DGW):	0.0063	6 MGD
12. Summary of population served/to be served (including major seasonal fluctuations if applicable):	Current (Year 2019) Population	Build-out
Municipality: Oakland	33,880 square feet	0
Total	33,880 square feet	0
13. Summary of wastewater flow received/to be received as a 30-day average flow for DSW or a daily maximum flow for DGW:	Current Year 2019 Flow (in MGD)	Build-out (in MGD)
Municipality: Oakland	0.00312	0
Facility Total	0.00312 MGD	0

^{*} Facility is not expected to expand and is anticipated to connect to NBCUA. Wastewater flows previously sent to this facility will be accounted for in the NBCUA facility table.

Table 3.12 Oakland Cross Roads		
Existing or proposed facility:	Existing	
New Jersey Pollutant Discharge Elimination System Permit Number:	NJ0167631	
3. Discharge to ground water (DGW) or surface water (DSW):	DGW	
4. Receiving water or aquifer:	Feltville Formation	
5. Classification of receiving water or aquifer:	II-A	
6. Owner of facility:	Oakland Cross Roads	
7. Operator of facility:	Elias Joseph	
8. Co-Permittee of facility (where applicable):		
9. Location of facility:	409 Ramapo Valley Road	
a. Municipality & County	Oakland, Bergen	
b. Street address	409 Ramapo Valley Road	
c. Block(s) and Lot(s)	1706, 3.01	
10. Location of discharge (i.e. degrees, minutes,	a. Longitude 74.24077	
seconds):	b. Latitude 41.027005	
	c. State Plane Coordinates	
	x 561005, y 799328	
11. Present permitted flow or permit condition (DSW) or daily maximum (DGW):	0.0078	7 MGD
12. Summary of population served/to be served (including major seasonal fluctuations if applicable):	Current (Year 2019) Population	Build-out
Municipality: Oakland	30,200 square feet	0
Total	30,200 square feet	0
13. Summary of wastewater flow received/to be received as a 30-day average flow for DSW or a daily maximum flow for DGW:	Current Year 2019 Flow (in MGD)	Build-out (in MGD)
Municipality: Oakland	0.001471	0
Facility Total	0.001471	0

^{*} Facility is not expected to expand and is anticipated to connect to NBCUA. Wastewater flows previously sent to this facility will be accounted for in the NBCUA facility table.

Table 3.13 Amerlux LLC* SANITARY SUBSURFACE SEWAGE DISPOSAL SYSTEM GENERAL PERMIT (T-1 PERMIT) TREATMENT FACILITY TABLE

NJG0080276
DGW
Basalt
II-A
Amerlux LLC
Paul Shaskan
178 Bauer Drive
Oakland, Bergen
178 Bauer Drive
3603, 3
a. Longitude 74.235280
b. Latitude 41.010609
c. State Plane Coordinates
x 564883, y 793563
M 6075
Max of 375 employees
110,000 SF
Estimated Flow: 0.01375

^{*} Facility is not expected to expand. The existing flow is unmetered. The above identified flow is calculated based on existing uses in accordance with N.J.A.C. 7:9A design criteria.

Table 3.14 Copper Tree Shopping Plaza* SANITARY SUBSURFACE SEWAGE DISPOSAL SYSTEM GENERAL PERMIT (T-1 PERMIT) TREATMENT FACILITY TABLE

New Jersey Pollutant Discharge Elimination System Permit Number:	NJG0133809
2. Discharge to ground water (DGW):	DGW
Receiving aquifer:	Byram Gneiss Formation
Classification of receiving aquifer:	II-A
5. Owner of facility:	Copper Tree Shopping Plaza
6. Operator of facility:	Enrico Laurino
7. Location of facility:	350 Ramapo Valley Road
a. Municipality & County	Oakland, Bergen
b. Street address	350 Ramapo Valley Road
c. Block(s) and Lot(s)	3906, 1
8. Location of discharge (i.e. degrees, minutes,	a. Longitude 74.241125
seconds):	b. Latitude 41.023924
9. Location of discharge (i.e. degrees, minutes,	c. State Plane Coordinates
seconds):	x 563550, Y 798018
10. Summary of current population served	
identifying all wastewater generating uses:	Shopping Mall
Commercial: amount of square footage	18,496 SF
Other: Refer to N.J.A.C. 7:9A-7.4	Estimated Flow: 0.002312

^{*} Facility is not expected to expand and is anticipated to connect to NBCUA. Wastewater flows previously sent to this facility will be accounted for in the NBCUA facility table. The existing flow is unmetered. The above identified flow is calculated based on existing uses in accordance with N.J.A.C. 7:9A design criteria.

Table 3.15 Di Iorio Investors SANITARY SUBSURFACE SEWAGE DISPOSAL SYSTEM GENERAL PERMIT (T-1 PERMIT) TREATMENT FACILITY TABLE

New Jersey Pollutant Discharge Elimination System Permit Number:	NJG0262714
2. Discharge to ground water (DGW):	DGW
Receiving aquifer:	Brunswick Aquifer
4. Classification of receiving aquifer:	II-A
5. Owner of facility:	Di Iorio Investors
6. Operator of facility:	Steven M. Segalas
7. Location of facility:	20 Elm Street
a. Municipality & County	Oakland, Bergen
b. Street address	20 Elm Street
c. Block(s) and Lot(s)	1802, 7
8. Location of discharge (i.e. degrees, minutes,	a. Longitude 74.24279
seconds):	b. Latitude 41.025147
9. Location of discharge (i.e. degrees, minutes,	c. State Plane Coordinates
seconds):	x 563089 y 798462
10. Summary of current population served identifying all wastewater generating uses:	4,074 sq. foot retail building and a 144-seat restaurant
dentifying all wastewater generating uses.	7,077 34. Toot Totali bulluling and a 1747-30at restaurant
Commercial: amount of square footage	7,150 SF
Other: Refer to N.J.A.C. 7:9A-7.4	Estimated Flow: 0.00089 MGD

^{*} Facility is not expected to expand and is anticipated to connect to NBCUA. Wastewater flows previously sent to this facility will be accounted for in the NBCUA facility table. The existing flow is unmetered. The above identified flow is calculated based on existing uses in accordance with N.J.A.C. 7:9A design criteria.

Table 3.16 Haband Company* SANITARY SUBSURFACE SEWAGE DISPOSAL SYSTEM GENERAL PERMIT (T-1 PERMIT) TREATMENT FACILITY TABLE

New Jersey Pollutant Discharge Elimination System Permit Number:	NJG0133469	
2. Discharge to ground water (DGW):	DGW	
3. Receiving aquifer:	Basalt	
4. Classification of receiving aquifer:	II-A	
5. Owner of facility:	Haband Company	
6. Operator of facility:		
7. Location of facility:	112 Bauer Drive	
a. Municipality & County	Oakland, Bergen	
b. Street address	112 Bauer Drive	
c. Block(s) and Lot(s)	3204, 4	
8. Location of discharge (i.e. degrees, minutes,	a. Longitude 74.239792	
seconds):	b. Latitude 41.005872	
9. Location of discharge (i.e. degrees, minutes,	c. State Plane Coordinates	
seconds):	x 563710, y 791469	
10. Summary of current population served	·	
identifying all wastewater generating uses:		
Commercial: amount of square footage	30,000 SF	
Other: Refer to N.J.A.C. 7:9A-7.4	Estimated Flow: 0.003 MGD	
# For the decrease and the second The selection flow is second The selection of the selecti		

^{*} Facility is not expected to expand. The existing flow is unmetered. The above identified flow is calculated based on existing uses in accordance with N.J.A.C. 7:9A design criteria.

Table 3.17 Jayare Associates* SANITARY SUBSURFACE SEWAGE DISPOSAL SYSTEM GENERAL PERMIT (T-1 PERMIT) TREATMENT FACILITY TABLE

NJG0100757
DGW
Brunswick Aquifer
II-A
Jayare Associates LLC
Elliot S. Leiowitz
14 Post Road
Oakland, Bergen
14 Post Road
2701, 1
a. Longitude 74.256295
b. Latitude 41.01452
c. State Plane Coordinates
x 559770, y 794529
Shopping Mall
88,000 SF
Estimated Flow: 0.010935 MGD

^{*} Facility is not expected to expand. The existing flow is unmetered. The above identified flow is calculated based on existing uses in accordance with N.J.A.C. 7:9A design criteria.

Table 3.18 Long Hill Medical Plaza* SANITARY SUBSURFACE SEWAGE DISPOSAL SYSTEM GENERAL PERMIT (T-1 PERMIT) TREATMENT FACILITY TABLE

New Jersey Pollutant Discharge Elimination System Permit Number:	NJG0140082
Discharge to ground water (DGW):	DGW
3. Receiving aquifer:	Brunswick Aquifer Conglomerate
4. Classification of receiving aquifer:	II-A
5. Owner of facility:	Long Hill Medical Plaza
6. Operator of facility:	David A. Hals
7. Location of facility:	9 Post Road
a. Municipality & County	Oakland, Bergen
b. Street address	9 Post Road
c. Block(s) and Lot(s)	2703, 1
8. Location of discharge (i.e. degrees, minutes,	a. Longitude 74.255263
seconds):	b. Latitude 41.013665
9. Location of discharge (i.e. degrees, minutes,	c. State Plane Coordinates
seconds):	x 559578, y 794249
10. Summary of current population served identifying all wastewater generating uses:	Professional/medical office building
Commercial: amount of square footage	22,000 SF
Other: Refer to N.J.A.C. 7:9A-7.4	Estimated Flow: 0.002788 MGD
* Facility is not asymptotical to asymptotic flowing flow in supportant. The above identified flow in	

^{*} Facility is not expected to expand. The existing flow is unmetered. The above identified flow is calculated based on existing uses in accordance with N.J.A.C. 7:9A design criteria.

Table 3.19 Oakland Bus Center #1* SANITARY SUBSURFACE SEWAGE DISPOSAL SYSTEM GENERAL PERMIT (T-1 PERMIT) TREATMENT FACILITY TABLE

New Jersey Pollutant Discharge Elimination System Permit Number:	NJG0168793
2. Discharge to ground water (DGW):	DGW
3. Receiving aquifer:	Basalt
4. Classification of receiving aquifer:	II-A
5. Owner of facility:	Oakland Bus Center #1
6. Operator of facility:	Linda Correlli
7. Location of facility:	16 Thornton Road
a. Municipality & County	Oakland, Bergen
b. Street address	16 Thornton Road
c. Block(s) and Lot(s)	3201, 2
8. Location of discharge (i.e. degrees, minutes,	a. Longitude 74.245931
seconds):	b. Latitude 41.006585
9. Location of discharge (i.e. degrees, minutes,	c. State Plane Coordinates
seconds):	x 563215, y 791265
10. Summary of current population served	
identifying all wastewater generating uses:	60 staff members
Commercial: amount of square footage	43,000 SF
Other: Refer to N.J.A.C. 7:9A-7.4	Estimated Flow: 0.005383 MGD
# E = -1114 - 1 = 4 4 1 4	Almos Classed a common Armond. The college of the contribution of Classed and

^{*} Facility is not expected to expand. The existing flow is unmetered. The above identified flow is calculated based on existing uses in accordance with N.J.A.C. 7:9A design criteria.

Table 3.20 Oakland Diner* SANITARY SUBSURFACE SEWAGE DISPOSAL SYSTEM GENERAL PERMIT (T-1 PERMIT) TREATMENT FACILITY TABLE

New Jersey Pollutant Discharge Elimination System Permit Number:	NJG0168629
2. Discharge to ground water (DGW):	DGW
3. Receiving aquifer:	Brunswick Aquifer
4. Classification of receiving aquifer:	II-A
5. Owner of facility:	Oakland Diner
6. Operator of facility:	Harry Mihas
7. Location of facility:	72 Ramapo Valley Road
a. Municipality & County	Oakland, Bergen
b. Street address	72 Ramapo Valley Road
c. Block(s) and Lot(s)	2601, 7
8. Location of discharge (i.e. degrees, minutes,	a. Longitude 74.260879
seconds):	b. Latitude 41.015153
9. Location of discharge (i.e. degrees, minutes,	c. State Plane Coordinates
seconds):	x 558119, y 794686
10. Summary of current population served	
identifying all wastewater generating uses:	112 seats
Restaurant: <u>number of seats</u>	112 seats
Other: Refer to N.J.A.C. 7:9A-7.4	Estimated Flow: 0.00392 MGD
Other: Refer to N.J.A.C. 7:9A-7.4	Estimated Flow: 0.00392 MGD

^{*} Facility is not expected to expand. The existing flow is unmetered. The above identified flow is calculated based on existing uses in accordance with N.J.A.C. 7:9A design criteria.

Table 3.21 Our Lady of Perpetual Help SANITARY SUBSURFACE SEWAGE DISPOSAL SYSTEM GENERAL PERMIT (T-1 PERMIT) TREATMENT FACILITY TABLE

New Jersey Pollutant Discharge Elimination System Permit Number:	NJG0186091		
2. Discharge to ground water (DGW):	DGW		
Receiving aquifer:	Brunswick Aquifer		
4. Classification of receiving aquifer:	II-A		
5. Owner of facility:	Our Lady of Perpetual Help		
6. Operator of facility:	Thomas Paul Lipnicki		
7. Location of facility:	117 Franklin Avenue		
a. Municipality & County	Oakland, Bergen		
b. Street address	117 Franklin Avenue		
c. Block(s) and Lot(s)	4901, 1		
8. Location of discharge (i.e. degrees, minutes,	a. Longitude 74.226919		
seconds):	b. Latitude 41.028519		
9. Location of discharge (i.e. degrees, minutes,	c. State Plane Coordinates		
seconds):	x 567359, y 799841		
10. Summary of current population served identifying all wastewater generating uses:	300 students/staff		
School: number of students and	000 1 1 1 1 1 1 1		
staff (specify cafeteria, labs, showers)	300 students/staff		
<u>allowers)</u>	Catholic school (non-boarding school)		
Other: Refer to N.J.A.C. 7:9A-7.4	Estimated Flow: 0.0105 MGD		

^{*} Facility is not expected to expand and is anticipated to connect to NBCUA. Wastewater flows previously sent to this facility will be accounted for in the NBCUA facility table. The existing flow is unmetered. The above identified flow is calculated based on existing uses in accordance with N.J.A.C. 7:9A design criteria.

Table 3.22 Portabello Banquet SANITARY SUBSURFACE SEWAGE DISPOSAL SYSTEM GENERAL PERMIT (T-1 PERMIT) TREATMENT FACILITY TABLE

New Jersey Pollutant Discharge Elimination System Permit Number:	NJG0142701	
2. Discharge to ground water (DGW):	DGW	
3. Receiving aquifer:	Brunswick Aquifer	
Classification of receiving aquifer:	II-A	
5. Owner of facility:	Portabello Banquet	
6. Operator of facility:	David Hall	
7. Location of facility:	155 Ramapo Valley Road	
a. Municipality & County	Oakland, Bergen	
b. Street address	155 Ramapo Valley Road	
c. Block(s) and Lot(s)	2401, 7	
8. Location of discharge (i.e. degrees, minutes, seconds):	a. Longitude 74.254115 b. Latitude 41015023	
9. Location of discharge (i.e. degrees, minutes, seconds):	c. State Plane Coordinates x 559896, y 794813	
10. Summary of current population served identifying all wastewater generating uses:	307 seats	
Restaurant: <u>number of seats</u>	307 seats	
Other: Refer to N.J.A.C. 7:9A-7.4	Estimated Flow: 0.010745 MGD	

^{*} Facility is not expected to expand and is anticipated to connect to NBCUA. Wastewater flows previously sent to this facility will be accounted for in the NBCUA facility table. The existing flow is unmetered. The above identified flow is calculated based on existing uses in accordance with N.J.A.C. 7:9A design criteria.

Table 3.23 Portobello Feasts SANITARY SUBSURFACE SEWAGE DISPOSAL SYSTEM GENERAL PERMIT (T-1 PERMIT) TREATMENT FACILITY TABLE

New Jersey Pollutant Discharge Elimination System Permit Number:	NJG0137219	
2. Discharge to ground water (DGW):	DGW	
3. Receiving aquifer:	Brunswick Aquifer	
Classification of receiving aquifer:	II-A	
5. Owner of facility:	Portobello Feasts	
6. Operator of facility:	David Hall	
7. Location of facility:	175 Ramapo Valley Road	
a. Municipality & County	Oakland, Bergen	
b. Street address	175 Ramapo Valley Road	
c. Block(s) and Lot(s)	2601, 5	
8. Location of discharge (i.e. degrees, minutes, seconds):	a. Longitude 74.253004 b. Latitude 41.015760	
9. Location of discharge (i.e. degrees, minutes, seconds):	c. State Plane Coordinates x 560260, y 795004	
10. Summary of current population served identifying all wastewater generating uses:	196 seats	
Restaurant: <u>number of seats</u>	196 seats	
Other: Refer to N.J.A.C. 7:9A-7.4	Estimated Flow: 0.00686 MGD	

^{*} Facility is not expected to expand and is anticipated to connect to NBCUA. Wastewater flows previously sent to this facility will be accounted for in the NBCUA facility table. The existing flow is unmetered. The above identified flow is calculated based on existing uses in accordance with N.J.A.C. 7:9A design criteria.

Table 3.24 Ramapo Shopping Center Inc SANITARY SUBSURFACE SEWAGE DISPOSAL SYSTEM GENERAL PERMIT (T-1 PERMIT) TREATMENT FACILITY TABLE

New Jersey Pollutant Discharge Elimination System Permit Number:	NJG0083470		
2. Discharge to ground water (DGW):	DGW		
Receiving aquifer:	Brunswick Aquifer		
Classification of receiving aquifer:	II-A		
5. Owner of facility:	Ramapo Shopping Center Inc		
6. Operator of facility:	John Ringer		
7. Location of facility:	400 Ramapo Valley Road		
a. Municipality & County	Oakland, Bergen		
b. Street address	400 Ramapo Valley Road		
c. Block(s) and Lot(s)	3901, 1		
8. Location of discharge (i.e. degrees, minutes,	a. Longitude 74.239632		
seconds):	b. Latitude 41.025903		
9. Location of discharge (i.e. degrees, minutes,	c. State Plane Coordinates		
seconds):	x 563907, y 798751		
10. Summary of current population served	Olympia a Osata		
identifying all wastewater generating uses:	Shopping Center		
Commercial: amount of square footage	13,000 SF		
Other: Refer to N.J.A.C. 7:9A-7.4	Estimated Flow: 0.001665 MGD		

^{*} Facility is not expected to expand and is anticipated to connect to NBCUA. Wastewater flows previously sent to this facility will be accounted for in the NBCUA facility table. The existing flow is unmetered. The above identified flow is calculated based on existing uses in accordance with N.J.A.C. 7:9A design criteria.

Table 3.25 Ramapo Valley Resources LTD SANITARY SUBSURFACE SEWAGE DISPOSAL SYSTEM GENERAL PERMIT (T-1 PERMIT) TREATMENT FACILITY TABLE

New Jersey Pollutant Discharge Elimination System Permit Number:	NJG0145521		
2. Discharge to ground water (DGW):	DGW		
3. Receiving aquifer:	Brunswick Aquifer		
4. Classification of receiving aquifer:	II-A		
5. Owner of facility:	Ramapo Valley Resources LTD		
6. Operator of facility:	John Olsen		
7. Location of facility:	345 349 Ramapo Valley Road		
a. Municipality & County	Oakland, Bergen		
b. Street address	345 349 Ramapo Valley Road		
c. Block(s) and Lot(s)	1802, 8		
8. Location of discharge (i.e. degrees, minutes,	a. Longitude 74.242779		
seconds):	b. Latitude 41.024367		
9. Location of discharge (i.e. degrees, minutes,	c. State Plane Coordinates		
seconds):	x 563093 y 798178		
10. Summary of current population served identifying all wastewater generating uses:	Strip mall with retail stores & food service		
Commercial: Identify amount of square footage	32,280 SF		
Other: Refer to N.J.A.C. 7:9A-7.4	Estimated Flow: 0.005 MGD		

^{*} Facility is not expected to expand and is anticipated to connect to NBCUA. Wastewater flows previously sent to this facility will be accounted for in the NBCUA facility table. The existing flow is unmetered. The above identified flow is calculated based on existing uses in accordance with N.J.A.C. 7:9A design criteria.

Table 3.26 Trovatos Due SANITARY SUBSURFACE SEWAGE DISPOSAL SYSTEM GENERAL PERMIT (T-1 PERMIT) TREATMENT FACILITY TABLE

New Jersey Pollutant Discharge Elimination System Permit Number:	NJG0140023	
2. Discharge to ground water (DGW):	DGW	
3. Receiving aquifer:	Brunswick Aquifer	
4. Classification of receiving aquifer:	II-A	
5. Owner of facility:	Trovatos Due	
6. Operator of facility:	Antonio Trovato	
7. Location of facility:	4 Barbara Lane	
a. Municipality & County	Oakland, Bergen	
b. Street address	4 Barbara Lane	
c. Block(s) and Lot(s)	1705, 4	
8. Location of discharge (i.e. degrees, minutes, seconds):	a. Longitude 74.243004 b. Latitude 41.027416	
9. Location of discharge (i.e. degrees, minutes, seconds):	c. State Plane Coordinates x 563028 y 799289	
10. Summary of current population served identifying all wastewater generating uses:	115 seats	
Restaurant: <u>number of seats</u>	115 seats	
Other: Refer to N.J.A.C. 7:9A-7.4	Estimated Flow: 0.004035 MGD	

^{*} Facility is not expected to expand and is anticipated to connect to NBCUA. Wastewater flows previously sent to this facility will be accounted for in the NBCUA facility table. The existing flow is unmetered. The above identified flow is calculated based on existing uses in accordance with N.J.A.C. 7:9A design criteria.

Table 3.27 Barnstable Academy* SANITARY SUBSURFACE SEWAGE DISPOSAL SYSTEM GENERAL PERMIT (T-1 PERMIT) TREATMENT FACILITY TABLE

New Jersey Pollutant Discharge Elimination System Permit Number:	NJG0142441	
2. Discharge to ground water (DGW):	DGW	
3. Receiving aquifer:	Brunswick Aquifer	
4. Classification of receiving aquifer:	II-A	
5. Owner of facility:	Barnstable Academy	
6. Operator of facility:	Matthew Frasco	
7. Location of facility:	8 Wright Way	
a. Municipality & County	Oakland, Bergen	
b. Street address	8 Wright Way	
c. Block(s) and Lot(s)	3301, 8	
8. Location of discharge (i.e. degrees, minutes,	a. Longitude 74.248217	
seconds):	b. Latitude 41.005765	
9. Location of discharge (i.e. degrees, minutes,	c. State Plane Coordinates	
seconds):	x 561559, y 791426	
10. Summary of current population served		
identifying all wastewater generating uses:	260 students/staff	
School: number of students and		
staff (specify cafeteria, labs, showers)	260 students/staff (non-boarding)	
<u>siloweisj</u>		
Other: Refer to N.J.A.C. 7:9A-7.4	Fating start Flour 0 0000 MOD	
	Estimated Flow: 0.0026 MGD	

^{*} Facility is not expected to expand. The existing flow is unmetered. The above identified flow is calculated based on existing uses in accordance with N.J.A.C. 7:9A design criteria.

Table 3.28 CTC Academy			
Existing or proposed facility:	Existing		
New Jersey Pollutant Discharge Elimination System Permit Number:	NJ0251801		
3. Discharge to ground water (DGW) or surface water (DSW):	DGW		
Receiving water or aquifer:	Glacial Till		
5. Classification of receiving water or aquifer:	II-A	II-A	
6. Owner of facility:	CTC Academy	CTC Academy	
7. Operator of facility:	Ken Berger		
8. Co-Permittee of facility (where applicable):			
9. Location of facility:			
a. Municipality & County	Oakland, Bergen		
b. Street address	125 Bauer Drive		
c. Block(s) and Lot(s)	3601, 40		
10. Location of discharge (i.e. degrees, minutes,	c. Longitude 74.239426 d. Latitude 41.008143		
seconds):			
	c. State Plane Coordinates		
	x 564086, y 792271		
11. Present permitted flow or permit condition (DSW) or daily maximum (DGW):	0.00782 MGD		
12. Summary of population served/to be served (including major seasonal fluctuations if applicable):	Current (Year 2019) Population	Build-out	
Municipality: Oakland	330 Students	330 Students	
Total	330 Students	330 Students	
13. Summary of wastewater flow received/to be received as a 30-day average flow for DSW or a daily maximum flow for DGW:	Current Year 2019 Flow (in MGD)	Build-out (in MGD)	
Municipality: Oakland	0.000502	0.00502	
Facility Total	0.000502 MGD	0.00502 MGD	

Table 3.29 Northwest Bergen County Utilities Authority WTP					
1. Existing or proposed facility:	Existing	VIP			
New Jersey Pollutant Discharge Elimination System Permit Number:	NJ0024813				
3. Discharge to ground water (DGW) or surface water (DSW):	DSW				
Receiving water or aquifer:	Hohokus Brook				
5. Classification of receiving water or aquifer:	FW2-NT				
6. Owner of facility:	Northwest Bergen County U	Itilities Authority			
7. Operator of facility:	Robert Genetelli				
8. Co-Permittee of facility (where applicable):					
9. Location of facility:	30 Wyckoff Avenue				
a. Municipality & County	Waldwick, Bergen				
b. Street address	30 Wyckoff Avenue				
c. Block(s) and Lot(s)	118, 1.02				
10. Location of discharge (i.e. degrees, minutes,	s, minutes, a. Longitude 74.123039				
seconds):	b. Latitude 41.006854				
	c. State Plane Coordinates				
	x 596157, y 791918				
11. Present permitted flow or permit condition (DSW) or daily maximum (DGW):	16.8 I	MGD			
12. Summary of population served/to be served (including major seasonal fluctuations if applicable):	Current (Year 2019) Population	Build-out			
Municipality: Oakland	0	3970			
Total*	0	3970			
13. Summary of wastewater flow received/to be received as a 30-day average flow for DSW or a daily maximum flow for DGW:	Current (Year 2019) Flow (in MGD)	Build-out (in MGD)			
Municipality: Oakland	0	0.856			
Facility Total*	0	0.856			
*Totals only represent values from Oakland Borough. NBCUA currently serves 14 municipalities. Existing flow is 12.283 mgd.					

Table 3.30 Mountain View WTP								
Existing or proposed facility: Existing*								
New Jersey Pollutant Discharge Elimination System Permit Number:	NJ0028002							
3. Discharge to ground water (DGW) or surface water (DSW):	DSW							
4. Receiving water or aquifer:	Preakness Brook							
5. Classification of receiving water or aquifer:	FW2-NT							
6. Owner of facility:	Township of Wayne							
7. Operator of facility:								
8. Co-Permittee of facility (where applicable):								
9. Location of facility:	205 Dey Road Wayne							
a. Municipality & County	Wayne, Passaic							
b. Street address	205 Dey Road Wayne							
c. Block(s) and Lot(s)								
10. Location of discharge (i.e. degrees, minutes,	a. Longitude 74.250589							
seconds):	b. Latitude 40.91031							
	c. State Plane Coordinates							
	x 561057 y 756620							
11. Present permitted flow or permit condition (DSW) or daily maximum (DGW):	13.5	MGD						
12. Summary of population served/to be served (including major seasonal fluctuations if applicable):	Current (Year 2019) Population	Build-out						
Municipality: Oakland	0	285						
Total*	0	285						
13. Summary of wastewater flow received/to be received as a 30-day average flow for DSW or a daily maximum flow for DGW:	Current (Year 2019) Flow (in MGD)	Build-out (in MGD)						
Municipality: Oakland	0	0.0612						
Facility Total*	0	0.0612						
*Totals only represent values from Oakland Borough. Mountain View WTP also serves areas of Wayne								

*Totals only represent values from Oakland Borough. Mountain View WTP also serves areas of Wayne Township. Existing flow is 8.909 mgd.

Table 3.31 Existing Burger King Restaurant* SANITARY SUBSURFACE SEWAGE DISPOSAL SYSTEM GENERAL PERMIT (T-1 PERMIT) TREATMENT FACILITY TABLE

New Jersey Pollutant Discharge Elimination System Permit Number:	NJG0173967		
2. Discharge to ground water (DGW):	DGW		
3. Receiving aquifer:	Feltville Formation		
4. Classification of receiving aquifer:	II-A		
5. Owner of facility:	A&E Ventures of Oakland LLC		
6. Operator of facility:			
7. Location of facility:	101 Plaza Road		
a. Municipality & County	Oakland, Bergen		
b. Street address	125 Bauer Drive		
c. Block(s) and Lot(s)	2702, 1		
8. Location of discharge (i.e. degrees, minutes,	a. Longitude 74.15316		
seconds):	b. Latitude 41.0889		
9. Location of discharge (i.e. degrees, minutes,	c. State Plane Coordinates		
seconds):	x 559659 y 794681		
10. Summary of current population served	D		
identifying all wastewater generating uses:	Restaurant with 120 seats		
Other: Refer to N.J.A.C. 7:9A-7.4	Estimated Flow: 0.0048 MGD		
	1		

^{*} Facility is not expected to expand. The existing flow is unmetered. The above identified flow is calculated based on existing uses in accordance with N.J.A.C. 7:9A design criteria.

IV. Wastewater Treatment Capacity Analysis - Sewer Service Area

The existing and future wastewater management needs of each SSA was identified and evaluated in a wastewater treatment capacity analysis. This section describes the build out methodology used to calculate existing wastewater flows for assigned SSA (SSAs served by an identified permitted treatment facility), as well as project future wastewater treatment demand for the Borough.

Calculating Existing Wastewater Flows

Existing Development

For each assigned SSA, the Borough has identified the existing wastewater flow using the highest consecutive 12 months rolling average over the most recent five-year period preceding development of the WMP (January 2015-December 2019), as reported in the Discharge Monitoring Reports required pursuant to N.J.A.C. 7:14A-6.8 for each facility.

Assigned Sewer Service Area Capacity Analyses

The average daily flow from existing NJPDES permitted facilities in the Borough are outlined in the table below.

The ones with an asterisk are Borough owned wastewater treatment plants that will be decommissioned in the near future and whose flow will be conveyed to NBCUA:

Facility	Existing Flow (Peak 12-month Avg during 2015-2019)
SKYVIEW/HIBROOK WTP – NJ0021342*	
12 Month Rolling Average (MGD)	0.017
October 2016-September 2017	
Chapel Hill Estate STP – NJ0053112*	
12 Month Rolling Average (MGD)	0.007
August 2017-July 2018	
Oakwood Knolls WWTP – NJ0027774*	
12 Month Rolling Average (MGD)	0.030
November 2018-October 2019	
Indian Hills High School – NJG0021253	
12 Month Rolling Average (MGD)	0.005
April 2017-March 2018	
Topcon Medical Systems, Inc. – NJ0078565	
12 Month Rolling Average (MGD)	0.0008
December 2017-November 2018	
Oakland Cross Roads – NJ0167631	
12 Month Rolling Average (MGD)	0.001471
February 2017-January 2018)	0.001471
Robert Michael Shopping Center – NJ0167126	
12 Month Rolling Average (MGD)	0.00312
October 2018-September 2019	
Oakland Care Center – NJ0029858	
12 Month Rolling Average (MGD)	0.03
January 2019-December 2019	
Ramapo River Reserve – NJ0080811	
12 Month Rolling Average (MGD)	0.092
July 2018-June 2019	
Cablevision of Oakland – NJ0083038	0.0007
12 Month Rolling Average (MGD) March 2018-February 2019	0.0007
Platinum Press Inc. – NJ0086797	
12 Month Rolling Average (MGD)	0.000749
May 2018-April 2019	0.000743
CTC Academy – NJ0251801	

12 Month Rolling Average (MGD)	0.000502
January 2019-December 2019	

The NBCUA plant is a regional Sewage Treatment Plant effectively collecting and treating wastewater flows from 14 municipalities. The Borough of Oakland is not currently served by or within the SSA of NBCUA.

The highest 12-month rolling average over the past 5 years (January 2015 through December 2019) for NBCUA's flow is 12.283 MGD for August 2018-July 2019. NBCUA is permitted for 16.8 MGD and has the capacity to accept the proposed 856,166 gpd flow from the proposed SSA of the downtown corridor of Oakland Borough in addition to its currently adopted SSA with no upgrades necessary to the existing plant.

In accordance with the litigation for Bi-County (Appendix D), the flow for the development will be conveyed to the Township of Wayne.

The highest 12-month rolling average over the past 5 years for Mountain View STP is 8.909 MGD for August 2018-July 2019. The Plant is permitted for 13.5 MGD and there is no potential capacity deficit as a result of the proposed increase in flow.

All other NJPDES regulated facilities within the Borough serve a limited onsite development and are not expected or proposed to serve additional areas or development or expand beyond their current permitted flows. As such, no potential capacity deficits have been identified for those facilities.

Projecting Future Wastewater Flows

Wastewater Demand Projections in Sewer Service Areas

Wastewater flow was projected for existing developments within the proposed SSA. In accordance with N.J.A.C. 7:14A- 23.3, the projected flow for the existing development, and development of underdeveloped parcels in accordance with existing zoning, within the proposed NBCUA SSA is 0.770 MGD. The tabulated flow, broken down by zoning information is outlined in Appendix E.

In an effort to evaluate capacity and future sanitary flow volumes, a build out analysis was completed utilizing GIS and zoning information as outlined in N.J.A.C. 7:15. The following is a chart of undeveloped land that is found within the proposed SSA. Locations for these undeveloped tracts are outlined on Map 5 in Appendix B.

Name of	Area	Zone	Proposed	Future
Development				Sanitary Flow
1. Fanale	38.8 acres	Corporate Office	150 units – 3bd; 50 units – 2bd	56,250 gpd *
2. Raritan Rd Site	2.9 acres	I-3 Industrial	Approved for 40 Affordable Housing 1bd	6,000 gpd
3. Vacant Land	2.1 acres	Local Business	Approved for 10,000 sf of office	1,000 gpd
4. Vacant Land	4.4 acres	Professional Office	Max 47,916 sf per Borough ordinance	4,792 gpd
5. Vacant Land	2.4 acres	Local Business	Residential; Prop 80 - 2 bd apts;	18,000 gpd
			TOTAL	86,042 gpd

The amount of wastewater estimated to be generated by the developments were calculated in accordance with the Borough Code and N.J.A.C. 7:14A-23.3. The max building area for the Raritan Road Site is 0.725 acres (31,581 sf) per the Borough code (25% building coverage). Utilizing Table E-3 of the NJ Demographic Multipliers: The Profile of the Occupants for Residential and Non-residential Development, the max number of employees for industrial sites is between 1-2 per 1,000 sf. Utilizing 2 employees per 1,000 sf, there will be a max of 63 employees on site. As per N.J.A.C. 7:14A, the flow is 25 gpd/employee, which equates to 1,579 gpd. The higher affordable housing proposed flow was utilized.

Interbasin Transfer

The Borough is proposing to convey the wastewater generated within the proposed downtown SSA, which is located within the Ramapo River Basin, to the NBCUA, which is located in the Saddle River Basin. As outlined above, the transfer from the Ramapo River Basin to the Saddle River Basin is approximately 799,916 gpd, which is the flow calculated utilizing NJDEP standards. The Borough will partner with NBCUA to install the pumping station, force main and gravity interceptor along Route 202. The agreement will include a provision that all properties with frontage along the interceptor must tie in within 36 months. Once the pumping station is built and the three (3) failing WTPs are taken offline, those properties will automatically be tied in.

It is estimated that the build-out of the remaining sanitary sewer system will have an approximate construction cost of \$30 M. This expenditure will take approximately 20 years, since it will have to be completed in stages. It will be mandatory for all residential and commercial properties to connect within 36 months of the sanitary sewer system being built. This will be enforced by Borough ordinance.

Any future properties, not outlined in this report, that want to connect to the sanitary sewer system will have to either get water from outside the basin or address the additional interbasin transfer amount. The Applicant will be required to get a site-specific WQMP amendment through the New Jersey Department of Environmental

^{*} The Fanale tract will not be part of the interbasin transfer, because they are exporting water from the Saddle River Basin, the same as where it will be discharged. The total interbasin transfer is 799,916 gpd (770,124 gpd + 29,792 gpd).

V. Nitrate Dilution Analysis - Non-Sewer Service Area

Wastewater Demand Projections in Non-Sewer Service Areas

In areas outside of the proposed SSA, the wastewater management alternative is on-site discharge to groundwater of 2,000 gallons per day or less, commonly referred to as septic systems. Approximately 95% of the Borough is presently serviced by private septic systems and cesspools while the remaining 5% discharge to sanitary sewers. The sanitary sewage is treated by a number of small privately/municipality owned package treatment plants.

Highlands Preservation Area Analysis

N.J.A.C. 7:15 requires that for areas proposed to be served by individual subsurface sewage disposal systems discharging 2,000 gallons per day or less to ground water, the development density that can be accommodated and result in attainment of the target nitrate concentration for those areas be determined. In August 2009, The Highlands Council prepared a Municipal Build-Out Report of Oakland Borough which is composed of a detailed build-out analysis for the planning and preservation areas in accordance with standards set forth by N.J.A.C. 7:38 and has concluded the following:

"The Highlands Regional Master Plan Septic System Yield analysis determined a yield of 0 units for the Preservation Area."

Due to the fact this analysis has been developed by the Highlands Council and suggests no additional development is warranted within the **Highlands Preservation Area** (2,621 acres), these values will be utilized for this portion of the analysis. A copy of the Municipal Build-Out Report for the Borough of Oakland has been included within Appendix A.

Highlands Planning Area Analysis

Since the Borough is a non-conforming municipality, the Highlands **Planning Area** was evaluated for the capacity of groundwater to sustain a nitrate target of 2 mg/l over the Hydrologic Unit Code 11 (HUC11) watershed, as outlined at N.J.A.C. 7:15-4.5(c)1. The Borough utilized the New Jersey Geological Survey provided model that assigns a density in acres of undeveloped land per future dwelling unit. That density is intended to sustain the nitrate target over the area of the HUC11 watershed when considering future, additional development. Application of this density to the available, undeveloped and underdeveloped acreage in the HUC11 watershed results in a total number of possible additional dwelling units that could be developed in that watershed without impairing groundwater quality and causing the nitrate concentration to exceed 2 mg/l. All of Oakland Borough is located within the 02030103100 HUC 11.

The following methodology was used to estimate available recharge acreage in the non-sewer service area (Highlands planning area only) utilizing the NJDEP Recharge-Based Nitrate-Dilution Model for New Jersey V7.0 for Excel 2010. First, HUC11 boundaries and areas provided by NJDEP as a Geographic Information Systems (GIS) file were intersected with municipal boundaries to generate HUC 11 acreage within Oakland Borough. Then soils information from the Soil Survey Geographic Database (SSURGO) Bergen County Soil Survey was analyzed based on their septic density rating excluding polygons classified as "Urban Land," "Water" and "hydric soil." The

area utilized excluded the SSA, the hydric soils and the Urban Land/Water/Hydric Soil from the land use data. The resulting final acreage was considered recharge acreage.

The total number of allowable units has been summarized in the Nitrate Dilution Calculations in Appendix A. These values were calculated only in areas assigned a septic density value, as outlined in the NJDEP and NJGS guidance documents, while excluding the above-mentioned information.

The total number of allowable Equivalent Dwelling Units (EDUs) within the Planning Area was calculated at 82 based on septic density values as shown on the Nitrate Dilution Model table (Appendix A). This number represents the maximum number of dwelling units that could be permitted within the Planning Area and remain below the 2 mg/l nitrate threshold.

A build-out analysis of the remaining undeveloped and underdeveloped land in the non-sewer service area of the Planning Area determined that 44 EDUs would be allowed based on the current municipal zoning as shown on the non-sewer service area Build-Out table (Appendix A). Based on this analysis, there would not be a deficit in the nitrate dilution capacity for the Borough.

Comparison

It should be noted that the method to calculate the allowable number of additional dwellings within the Highlands Preservation Area is not the same method that was utilized to calculate maximum dwelling units within the Highlands Planning Area. As mentioned above, the estimated build-out for the Highlands Preservation Area was based off septic density standards set forth by N.J.A.C. 7:38. The results of this analysis indicate the following:

Highlands Preservation Area: No additional septic systems are allowed within this portion of the Borough. The Septic System Yield analysis determined a yield of 0 units for this area (a copy of the complete Highlands Municipal Build-Out Report can be found in Appendix A). Any individual septic system that was added after completion of the August 2009 Highlands Build-out report automatically counts as a deficiency in the Highlands Preservation Area.

Planning Area: The maximum allowable dwelling units allowed within the existing non-sewer service area to maintain the target nitrate concentration of 2 mg/L has been calculated at 82 units (see Nitrate Dilution Model Calculations found in Appendix A). The maximum number of units allowed under current zoning has been calculated at 44 units, which would not exceed the 82 units allowed by the Nitrate Dilution Model.

Existing Dwelling Units

While the Nitrate Dilution Analysis does not identify a deficit in the nitrate dilution capacity for the Borough, the vast majority of the non-SSA in Oakland has already been developed. Looking only at the undeveloped and underdeveloped portions of the non-SSA would not fully identify other factors impacting the nitrate concentrations in the groundwater. The possible number of allowable units based on the NDA was also compared to the existing number of dwelling units in the non-SSA of the Borough. The number of dwelling units and EDUs was quantified by performing a rooftop count of each residence/commercial building utilizing aerial imagery published in April 2017. This was done to provide a more accurate representation of existing conditions of developed land in the Borough.

The Borough of Oakland currently has approximately 3,417 existing residential dwelling units (Preservation and

Planning Area) within the non-sewer service area. Additionally, the Borough has approximately 195 non- residential buildings with a total floor area of 5,599,366 s.f. (129 acres) within the non-sewer service area. The individual floor areas were multiplied by a wastewater flow factor of 0.125 gpd then divided by 500 gpd (average flow for residential dwellings) to determine the total number of Equivalent Dwelling Units or EDU's. The total number of EDU's for non-residential buildings within the Borough limits is 1,400. (See Appendix A: Non- Residential Development Table).

Due to the fact the number of existing septic systems in the part of the Borough that lies within the Highlands Planning Area exceed the maximum allowable dwelling unit calculations by 4,197 units (4,279 Total Units in Planning Area – 82 Maximum Allowable Units), the installation of a public sewer system in the most heavily affected portions of the town, as proposed in this WMP, is the most practical strategy to reduce nitrate concentrations within the sub-watershed area. The proposed SSA will remove approximately 2,432 EDUs from the current non- sewer service area, reducing the number of EDUs in the Borough that lies within the Highlands Planning Area relying on septic systems, to 1,847.

VI. Mitigation Strategies

Mitigation Strategies in the Sewer Service Area

While no strategies are required to address potential capacity deficits in the wastewater treatment capacity, certain measures will be taken by the Borough to mitigate the conveyance of flow from the proposed SSA to NBCUA, which results in an interbasin transfer.

The following are the proposed mitigation strategies to reduce the interbasin transfer as a result of the actions proposed in this WMP:

- Requirement for Fanale Development to purchase water directly from SUEZ. The property will
 receive water and discharge sewer to the Saddle River Basin, thereby eliminating the full 56,250
 gpd interbasin transfer.
- The Bi-County Development, per court order, will convey sanitary sewer to the Township of Wayne.

Due to the interbasin transfer of the water from the Ramapo River Basin to the Saddle River Basin due to the proposed conveyance of wastewater to the NBCUA sewage treatment facility, a Major Modification of the Borough's Water Allocation Permit is required. A condition of the Major Modification is obtaining a Consistency Determination from the Highlands Council. In order to satisfy this condition, the Borough has coordinated with the Highlands Council in the preparation of the Water Use and Conservation Management Plan.

The Oakwood Knoll, Oakland Care Center, and Ramapo River Reserve facilities are over 80% capacity based on existing flow. The Oakwood Knoll facility is anticipated to be decommissioned and transfer all wastewater flows to the NBCUA facility. Therefore, capacity for the Oakwood Knoll facility going forward will not be an issue. Growth is not anticipated at the Oakland Care Center and Ramapo River Reserve facilities, and therefore does not represent an urgent issue. The Borough will require the permittee to perform an assessment of the treatment works; an evaluation of alternative measures that would maximize conveyance and treatment of existing flows, reduce or maintain existing flows below permitted flow at the facility and ensure adequate conveyance capacity.

VII. Septic Maintenance Program

Current ISSDS (septic system) Inventory:

The Borough Department of Health keeps records of all septic systems. Boswell has compiled the information (Appendix C), which includes the following:

- Neighborhood
- Street address/location of ISSDS
- Recorded Sanitary Issues Map
- Block and Lot
- Date ISSDS installed or approximate age of system;
- Date/description of last known permitted activity via Health Department (installation, alteration, repair);
- Condition of system

General comments

Current Septic Management Practices:

The Borough code states:

No person shall locate, construct, reconstruct, renovate, alter, repair or extend an individual sewage disposal system within the Borough until a permit has been issued by the Board of Health of the Borough. (Ord. #79-51, 1967 Code §54-2A)"

Such permit for an individual sewage disposal system shall be issued by the Board of Health of the Borough, or its duly authorized agent, in accordance with the following:

- a. A permit may be issued upon the applicant's completing the necessary application form together with the appropriate fee and submitting the necessary surveys with sufficient detail and other engineering data, which engineering data shall be furnished by a licensed, professional engineer and certified by the engineer and shall be required to show the proposed construction is in compliance with the standards determined by the New Jersey Department of Health and this Chapter.
- b. Any amendments to any application shall conform to such requirements of the Oakland Board of Health or its designated representatives.
- c. In determining whether an applicant is entitled to a permit to construct an individual sewage disposal system, the Board of Health or its designated agent shall consider the applicant's percolation test and soil logs, which shall be furnished to the Board of Health and become a part of its records.
- d. Upon certification to the Oakland Board of Health or its designated representative that the application and the accompanying engineering data are in compliance with applicable standards, and payment of the appropriate fees, the Board of Health or its designated representative may issue a permit for the construction of an individual sewage disposal system upon payment of the proper fee, as set forth in this Chapter. (Ord. #79-51, 1967 Code §54-2B; Ord. #99-Code-64, §§1, 2)

There are no specific time requirements for maintenance/management or pump-outs. The ordinance only outlines the license requirements of the contractors performing the work.

All septic records are maintained in paper files. They are only updated once a permit for replacement is issued.

Proposed Improvements to Current Septic Management Practices and Plan to Complete Inventory:

Below are activities that will be evaluated and/or implemented over the next 10-year wastewater management planning period, that will improve the current municipal practices listed above associated with septic management. Examples of the types of activities being sought include:

In accordance with N.J.A.C. 7:9A-3.14 and Highland requirements for the Preservation Area, the Borough ordinance will be revised to include the following:

Notification of proper operation and maintenance practices.

- a) The administrative authority shall notify each property owner issued approval for the design, construction, installation, alteration or repair of an individual subsurface sewage disposal system after January 1, 1990 of the proper operation and maintenance practices.
- b) Written notification of the proper operation and maintenance practices shall initially be issued to the applicant with the approval for the location, design, construction, installation, alteration or repair of the individual subsurface sewage disposal system and reissued on every three (3) years to the present property owner.
- c) The written notification shall inform the present property owner how to properly operate and maintain an individual subsurface sewage disposal system. A mass mailing to all property owners who have individual subsurface sewage disposal systems is an acceptable method of notice. The notice shall include, at a minimum:
 - 1. A general outline of how an individual subsurface sewage disposal system works and the potential impact of improper operation and maintenance on system performance, ground and surface water quality, and public health;
 - The recommended frequency of septic tank and grease trap pumping to prevent overaccumulation of solids, and methodology for inspection to determine whether pumping is necessary;
 - 3. A list of materials containing toxic substances which are prohibited from being disposed of into an individual subsurface sewage disposal system;
 - 4. A list of inert or non-biodegradable substances which should not be disposed of within an individual subsurface sewage disposal system;
 - 5. Proper practices for maintaining the area reserved for sewage disposal;
 - 6. Impacts upon system performance resulting from excessive water use; and
 - 7. Warning signs of poor system performance or malfunction and recommended or required corrective measures.
- d) The written notification may be developed by the municipality. Copies of relevant guidance material and/or technical manuals for onsite wastewater treatment systems may distributed subject to this chapter.

An ordinance will be passed requiring home owners to provide maintenance to the septic systems prior to receiving Certificate of Occupancy during the sale of a property.

The Board of Health will also implement Tracking and Notification process to further encourage regular pump- outs, system augmentation, and regular maintenance practices.

The Board of Health will share information with system owners on septic maintenance (e.g., classroom presentations or to civic groups such as Lions Club, Women's Clubs, or partnering with Environmental Commissions/ Advisory Councils/Watershed Ambassadors, etc.).

As part of the Borough's ongoing septic maintenance program, the Board of Health will keep an electronic inventory of all septic systems, updating as maintenance is performed.

VIII. Mapping

Map 1 - WMP Area Map

The following political and jurisdictional, boundaries, and features are identified on this map:

- The WMP area boundary
- Areawide WQM planning area boundaries
- Municipal boundaries
- The Highlands preservation area and the Highlands planning area

Map 2 - Selected Environmentally Sensitive Features Map

This is a map depicting each of the following environmental features below based on the most current GIS layers available from the New Jersey Department of Environmental Protection at the time of WMP submission.

- Suitable habitat for endangered and threatened species as identified on the Department's Landscape Project Maps version 3.3 of Habitat for Endangered, Threatened and Other Priority Wildlife as Rank 3, 4and 5
- Natural Heritage Priority Sites (Not applicable to Oakland)
- Surface waters, as mapped on the Department's Geographic Information Systems (GIS) hydrography coverage
- Category One waters designated in the Department's Surface Water Quality Standards,
 N.J.A.C. 7:9B, based on the Department's maps of such waters, and their corresponding 300-foot riparian zone based on the Flood Hazard Area Control Act Rules, N.J.A.C. 7:13
- Coastal wetlands that have been mapped by the Department under the Wetlands Act of 1970, N.J.S.A. 13:9A-1 et seq. (Not applicable to Oakland)
- Other freshwater and estuarine wetlands, based on maps prepared by the Department under the Freshwater Wetlands Protection Act, N.J.S.A.13:9B-25c
- Coastal Fringe Planning Areas, Coastal Rural Planning Areas, and Coastal Environmentally

Sensitive Planning Area (Not applicable to Oakland)

• Environmentally sensitive areas in which 201 Facilities Plan grant limitations prohibit the extension of sewer service, if available (wetlands and flood prone areas as mapped by NJDEP based on a combination of FEMA, NJDEP and aerial photography data.)

Map 3 - Wastewater Service Area Map

The following planning area boundaries, wastewater-related jurisdictions, facilities, and wastewater service areas are identified on this map

- The land use capability zones established within the Highlands Regional Master Plan adopted by the Highlands Council pursuant to N.J.S.A. 13:20-8
- District boundaries of sewerage authority districts, as defined in N.J.S.A. 40:14A-3(6)
- The location of each domestic and industrial wastewater treatment facility that is anticipated to exist in the future, including existing facilities that will remain in service, and the discharge outfall for each. The name and NJPDES permit number(s), if assigned, of each wastewater treatment facility shall be identified
- A delineation of sewer service areas, as determined in accordance with N.J.A.C. 7:15-4.4, differentiating that area that is:
 - Assigned SSA, differentiating between area that currently conveys sewage to each existing or proposed wastewater treatment facility and that which is proposed to convey sewage to each existing or proposed wastewater treatment facility; or
 - Unassigned SSA; and
 - A delineation of non-sewer service area

Map 4 - Zoning map(s)

Map depicting municipal parcel mapping, current municipal zoning as used as the basis for the build-out analysis required pursuant to N.J.A.C. 7:15-4.5

Map 5 – Vacant Land Map

<u>Vacant land</u>, as depicted in this map, is the undeveloped land within the proposed SSA in the Highlands Planning Area which could be developed in the future, and of which the wastewater capacity analysis in the SSA is based.

Map 6 - Recorded Sanitary Issues Map

This map illustrates known cesspools, previously reported septic system failures and known cesspools, that were replaced with Septic Systems.

IX. Conditions of the Wastewater Management Plan Approval

The following will be conditions of the WMP approval:

- Future requests to amend the SSA, either through a regional/areawide amendment or a site-specific amendment will require the import of water from outside the Ramapo River Basin to serve the project.
- The Borough will continue to explore Water Use and Conservation measures as set forth by the Highlands Council to ensure the efficient use of water in the Borough.
- The local permitting of the development of the Fanale tract must include the import of water from outside the Ramapo Basin and the conveyance of wastewater in a manner that does not add to the 0.8 MGD interbasin transfer.
- The force main and pumps will be sized to limit the sewage exports from the basin to 0.8 MGD.
- The Borough will obtain the Water Allocation major modification permit prior to the submission of the Treatment Works Approval application for the construction of the wastewater interceptor. If the major modification to the Water Allocation permit cannot be issued in accordance with N.J.A.C. 7:19, then the proposed interbasin transfer cannot proceed.

APPENDIX A – Nitrate Dilution Model Calculations

FID	Shape *		SPATIALVER MUSYM	MUNAME	Acres	Sum Acres	Septic Density by Soil Type	Units Allowed
	Polygon ZM	NJ003	2 BohB	Boonton moderately well drained gravelly loam, 3 to 8 percent slopes	8.350814			
	Polygon ZM	NJ003	2 BohBb	Boonton moderately well drained gravelly loam, 0 to 8 percent slopes, ver	13.983568			
60	Polygon ZM	NJ003	2 BohC	Boonton moderately well drained gravelly loam, 8 to 15 percent slopes	9.166943			
14	Polygon ZM	NJ003	2 BohCb	Boonton moderately well drained gravelly loam, 8 to 15 percent slopes, ve	47.743833			
33	Polygon ZM	NJ003	2 BohCb	Boonton moderately well drained gravelly loam, 8 to 15 percent slopes, ve	13.556093			
109	Polygon ZM	NJ003	2 BohCb	Boonton moderately well drained gravelly loam, 8 to 15 percent slopes, ve	0.393306			
1	Polygon ZM	NJ003	2 BohDb	Boonton moderately well drained gravelly loam, 15 to 25 percent slopes, v	9.550633			
13	Polygon ZM	NJ003	2 BohDb	Boonton moderately well drained gravelly loam, 15 to 25 percent slopes, v	11.478808			
17	Polygon ZM	NJ003	2 BohDb	Boonton moderately well drained gravelly loam, 15 to 25 percent slopes, v	0.512472			
23	Polygon ZM	NJ003	2 BohDb	Boonton moderately well drained gravelly loam, 15 to 25 percent slopes, v	8.205697			
106	Polygon ZM	NJ003	2 BohDb	Boonton moderately well drained gravelly loam, 15 to 25 percent slopes, v	2.892514	125.834681	4.6	27.35537
11	Polygon ZM	NJ003	2 BorB	Boonton moderately well drained-Rock outcrop complex, 3 to 8 percent slop	0.329427			
		NJ003	2 BorB	Boonton moderately well drained-Rock outcrop complex, 3 to 8 percent slop	2.012656			
	Polygon ZM	NJ003	2 BorC	Boonton moderately well drained-Rock outcrop complex, 8 to 15 percent slo	9.032588			
	Polygon ZM	NJ003	2 BorC	Boonton moderately well drained-Rock outcrop complex, 8 to 15 percent slo	1.661839			
	Polygon ZM	NJ003	2 BorD	Boonton moderately well drained-Rock outcrop complex, 15 to 25 percent sl	0.555006			
		NJ003	2 BorD	Boonton moderately well drained-Rock outcrop complex, 15 to 25 percent sl	8.674156			
	, 0	NJ003	2 BorE	Boonton moderately well drained-Rock outcrop complex, 15 to 25 percent sl	10.867774	33.133446	4.9	6.761928
	Polygon ZM	NJ003	2 BouB	Boonton-Urban land complex, 0 to 8 percent slopes	2.166616	33.133440	4.5	0.701328
	Polygon ZM	NJ003	2 BouB	Boonton-Urban land complex, 0 to 8 percent slopes	0.121729			
	, 0			. ,				
	Polygon ZM	NJ003	2 BouB	Boonton-Urban land complex, 0 to 8 percent slopes	0.159208			
	, 0	NJ003	2 BouB	Boonton-Urban land complex, 0 to 8 percent slopes	0.357673			
		NJ003	2 BouB	Boonton-Urban land complex, 0 to 8 percent slopes	0.106608			
	Polygon ZM	NJ003	2 BouC	Boonton-Urban land complex, 8 to 15 percent slopes	3.54392			
		NJ003	2 BouC	Boonton-Urban land complex, 8 to 15 percent slopes	0.748931			
		NJ003	2 BouC	Boonton-Urban land complex, 8 to 15 percent slopes	21.854031			
19	Polygon ZM	NJ003	2 BouC	Boonton-Urban land complex, 8 to 15 percent slopes	1.399175			
	Polygon ZM	NJ003	2 BouC	Boonton-Urban land complex, 8 to 15 percent slopes	2.536865			
35	Polygon ZM	NJ003	2 BouC	Boonton-Urban land complex, 8 to 15 percent slopes	4.96048			
98	Polygon ZM	NJ003	2 BouC	Boonton-Urban land complex, 8 to 15 percent slopes	0.28736			
107	Polygon ZM	NJ003	2 BouC	Boonton-Urban land complex, 8 to 15 percent slopes	1.406464			
113	Polygon ZM	NJ003	2 BouC	Boonton-Urban land complex, 8 to 15 percent slopes	0.447218			
115	Polygon ZM	NJ003	2 BouC	Boonton-Urban land complex, 8 to 15 percent slopes	1.154566			
0	Polygon ZM	NJ003	2 BouD	Boonton-Urban land complex, 15 to 25 percent slopes	1.572743			
		NJ003	2 BouD	Boonton-Urban land complex, 15 to 25 percent slopes	6.385383			
		NJ003	2 BouD	Boonton-Urban land complex, 15 to 25 percent slopes	1.421911			
	Polygon ZM	NJ003	2 BouD	Boonton-Urban land complex, 15 to 25 percent slopes	1.485473			
		NJ003	2 BouD	Boonton-Urban land complex, 15 to 25 percent slopes	0.001787			
	Polygon ZM	NJ003	2 BouD	Boonton-Urban land complex, 15 to 25 percent slopes	0.712694			
	, 0	NJ003	2 BouD	Boonton-Urban land complex, 15 to 25 percent slopes	7.05727			
	Polygon ZM	NJ003	2 BouD	Boonton-Urban land complex, 15 to 25 percent slopes	0.764685			
	Polygon ZM	NJ003	2 BouD	Boonton-Urban land complex, 15 to 25 percent slopes	0.079438			
						69 470261	16	14.8868
	Polygon ZM	NJ003	2 BouD	Boonton-Urban land complex, 15 to 25 percent slopes	7.747033 0.381869	68.479261	4.6	14.8868
		NJ003	2 DuoB	Dunellen loam, 3 to 8 percent slopes				
		NJ003	2 DuoB	Dunellen loam, 3 to 8 percent slopes	0.069522			
	Polygon ZM	NJ003	2 DuoB	Dunellen loam, 3 to 8 percent slopes	6.505465			
	Polygon ZM	NJ003	2 DuoB	Dunellen loam, 3 to 8 percent slopes	2.903877			
	Polygon ZM	NJ003	2 DuoC	Dunellen loam, 8 to 15 percent slopes	3.781242			
		NJ003	2 DuoC	Dunellen loam, 8 to 15 percent slopes	3.463524			
	, 0	NJ003	2 DuoC	Dunellen loam, 8 to 15 percent slopes	0.214575			
38	Polygon ZM	NJ003	2 DuoD	Dunellen loam, 15 to 25 percent slopes	0.022468			
68	Polygon ZM	NJ003	2 DuoD	Dunellen loam, 15 to 25 percent slopes	4.996834	22.339376	3.9	5.728045
4	Polygon ZM	NJ003	2 DuuB	Dunellen-Urban land complex, 3 to 8 percent slopes	0.009494			
27	Polygon ZM	NJ003	2 DuuB	Dunellen-Urban land complex, 3 to 8 percent slopes	0.675011			
49	Polygon ZM	NJ003	2 DuuB	Dunellen-Urban land complex, 3 to 8 percent slopes	1.827919			
	Polygon ZM	NJ003	2 DuuB	Dunellen-Urban land complex, 3 to 8 percent slopes	0.011821			
	, 0	NJ003	2 DuuB	Dunellen-Urban land complex, 3 to 8 percent slopes	0.006161			
	Polygon ZM		2 DuuB	Dunellen-Urban land complex, 3 to 8 percent slopes	2.848294			

Recharge Area # ISSDS 381.062486

82

2 Polygon ZM	NJ003	2 DuuC	Dunellen-Urban land complex, 8 to 15 percent slopes	0.227618			
42 Polygon ZM	NJ003	2 DuuC	Dunellen-Urban land complex, 8 to 15 percent slopes	2.040966			
77 Polygon ZM	NJ003	2 DuuC	Dunellen-Urban land complex, 8 to 15 percent slopes	7.817445			
93 Polygon ZM	NJ003	2 DuuC	Dunellen-Urban land complex, 8 to 15 percent slopes	0.024098			
100 Polygon ZM	NJ003	2 DuuC	Dunellen-Urban land complex, 8 to 15 percent slopes	0.002883	15.49171	3.9	3.972233
10 Polygon ZM	NJ003	2 HamBb	Haledon gravelly loam, 0 to 8 percent slopes, very stony	5.405966			
21 Polygon ZM	NJ003	2 HamBb	Haledon gravelly loam, 0 to 8 percent slopes, very stony	6.273229			
28 Polygon ZM	NJ003	2 HamBb	Haledon gravelly loam, 0 to 8 percent slopes, very stony	9.531805	21.211	4.7	4.512979
18 Polygon ZM	NJ003	2 HasB	Haledon-Urban land complex, 3 to 8 percent slopes	11.40762			
84 Polygon ZM	NJ003	2 HasB	Haledon-Urban land complex, 3 to 8 percent slopes	0.493913			
86 Polygon ZM	NJ003	2 HasB	Haledon-Urban land complex, 3 to 8 percent slopes	4.332906			
94 Polygon ZM	NJ003	2 HasB	Haledon-Urban land complex, 3 to 8 percent slopes	0.31079	16.545229	4.7	3.520261
82 Polygon ZM	NJ003	2 HhmBb	Hibernia loam, 0 to 8 percent slopes, very stony	1.195827	1.195827	4.6	0.259962
7 Polygon ZM	NJ003	2 OtsD	Otisville gravelly loamy sand, 15 to 25 percent slopes	0.233547			
20 Polygon ZM	NJ003	2 OtsD	Otisville gravelly loamy sand, 15 to 25 percent slopes	2.049041			
36 Polygon ZM	NJ003	2 OtsD	Otisville gravelly loamy sand, 15 to 25 percent slopes	4.993894	7.276482	3.5	2.078995
47 Polygon ZM	NJ003	2 PbuA	Pascack silt loam, 0 to 3 percent slopes	0.012037			
64 Polygon ZM	NJ003	2 PbuA	Pascack silt loam, 0 to 3 percent slopes	8.601033	8.61307	4.7	1.832568
70 Polygon ZM	NJ003	2 PHG	Pits, sand and gravel	34.881873	34.881873	3.4	10.25937
24 Polygon ZM	NJ003	2 RkrB	Riverhead sandy loam, 3 to 8 percent slopes	4.671645			
26 Polygon ZM	NJ003	2 RkrB	Riverhead sandy loam, 3 to 8 percent slopes	0.000925			
29 Polygon ZM	NJ003	2 RkrB	Riverhead sandy loam, 3 to 8 percent slopes	0.280329			
39 Polygon ZM	NJ003	2 RkrB	Riverhead sandy loam, 3 to 8 percent slopes	1.376766			
59 Polygon ZM	NJ003	2 RkrB	Riverhead sandy loam, 3 to 8 percent slopes	0.82251			
69 Polygon ZM	NJ003	2 RkrB	Riverhead sandy loam, 3 to 8 percent slopes	3.857545			
101 Polygon ZM	NJ003	2 RkrB	Riverhead sandy loam, 3 to 8 percent slopes	3.228846			
32 Polygon ZM	NJ003	2 RkrC	Riverhead sandy loam, 8 to 15 percent slopes	1.374542			
67 Polygon ZM	NJ003	2 RkrC	Riverhead sandy loam, 8 to 15 percent slopes	1.291449			
80 Polygon ZM	NJ003	2 RkrC	Riverhead sandy loam, 8 to 15 percent slopes	0.360771			
85 Polygon ZM	NJ003	2 RkrC	Riverhead sandy loam, 8 to 15 percent slopes	2.240674			
104 Polygon ZM	NJ003	2 RkrC	Riverhead sandy loam, 8 to 15 percent slopes	6.554529	26.060531	3.9	6.682187

Total acres 381.062486

Total units 82.12265

COMMERCIAL BUILDING CALCULATIONS (ENTIRE BOROUGH)

		LICIAL DOIL			,	· · · · · · · · · · · · · · · · · · ·
FID No.	No. of	Building	Total Floor Area	Total Floor	Non-Residential	Equivalent Dwelling
FID NO.	Stories	Footprint (SF)	<u>(SF)</u>	Area (Acres)	<u>Flow</u>	Units (EDU)
0	1	20,514	20,514	0.5	2,564	5.1
1	1	32,119	32,119	0.7	4,015	8.0
2	1	41,844	41,844	1.0	5,231	10.5
3	2	40,546	81,092	1.9	10,137	20.3
4	1	60,239	60,239	1.4	7,530	15.1
5	2	99,035	198,070	4.5	24,759	49.5
6	1	49,453	49,453	1.1	6,182	12.4
7	1	39,305	39,305	0.9	4,913	9.8
8	1	42,583	42,583	1.0	5,323	10.6
9	1	19,790	19,790	0.5	2,474	4.9
10	1	31,227	31,227	0.7	3,903	7.8
11	2	187,598	375,196	8.6	46,899	93.8
12	2	72,628	145,256	3.3	18,157	36.3
13	2	94,501	189,002	4.3	23,625	47.3
14	1	152,921	152,921	3.5	19,115	38.2
15	1	28,150	28,150	0.6	3,519	7.0
16	1	20,397	20,397	0.5	2,550	5.1
17	1	4,068	4,068	0.1	509	1.0
18	1	40,564	40,564	0.9	5,071	10.1
19	2	31,532	63,065	1.4	7,883	15.8
20	1	44,519	44,519	1.0	5,565	11.1
21	1	36,517	36,517	0.8	4,565	9.1
22	1	23,885	23,885	0.5	2,986	6.0
23	1	40,880	40,880	0.9	5,110	10.2
24	2	25,996	51,993	1.2	6,499	13.0
25	2	30,573	61,145	1.4	7,643	15.3
26	2	23,532	47,064	1.1	5,883	11.8
27	2	3,792	7,584	0.2	948	1.9
28	2	41,429	82,858	1.9	10,357	20.7
29	3	44,135	132,406	3.0	16,551	33.1
30	3	44,346	133,038	3.1	16,630	33.3
31	1	45,315	45,315	1.0	5,664	11.3
32	2	46,787	93,574	2.1	11,697	23.4
33	3	12,928	38,784	0.9	4,848	9.7
34	1	3,914	3,914	0.1	489	1.0
35	1	2,412	2,412	0.1	301	0.6
36	2	2,334	4,668	0.1	583	1.2
37	1	859	859	0.0	107	0.2
38	1	96,781	96,781	2.2	12,098	24.2
39	2	21,264	42,528	1.0	5,316	10.6
40	3	4,634	13,903	0.3	1,738	3.5
41	1	3,773	3,773	0.1	472	0.9
42	2	5,735	11,469	0.3	1,434	2.9
74	۷.	رد ۱٫۱	11,403	0.5	1,734	۷.3

43	1	4 248	4 248	0.1	531	1 1
73	_	7,270	7,270	0.1	JJ 1	

FID No.	No. of Stories	Building Footprint (SF)	Total Floor Area (SF)	Total Floor Area (Acres)	Non-Residential Flow	Equivalent Dwelling Units (EDU)
44	1	5,454	5,454	0.1	682	1.4
45	1	2,427	2,427	0.1	303	0.6
46	1	5,805	5,805	0.1	726	1.5
47	1	3,597	3,597	0.1	450	0.9
48	2	6,090	12,180	0.3	1,522	3.0
49	2	4,136	8,272	0.2	1,034	2.1
50	2	8,061	16,122	0.4	2,015	4.0
51	2	15,296	30,592	0.7	3,824	7.6
52	1	8,059	8,059	0.2	1,007	2.0
53	2	2,749	5,497	0.1	687	1.4
54	2	1,580	3,159	0.1	395	0.8
55	2	13,493	26,986	0.6	3,373	6.7
56	2	4,661	9,321	0.2	1,165	2.3
57	1	1,022	1,022	0.0	128	0.3
58	1	1,084	1,084	0.0	135	0.3
59	2	14,100	28,200	0.6	3,525	7.0
60	2	35,929	71,858	1.6	8,982	18.0
61	2	32,623	65,247	1.5	8,156	16.3
62	1	20,869	20,869	0.5	2,609	5.2
63	2	35,293	70,585	1.6	8,823	17.6
64	2	35,476	70,952	1.6	8,869	17.7
65	2	35,076	70,152	1.6	8,769	17.5
66	1	24,170	24,170	0.6	3,021	6.0
67	2	15,738	31,475	0.7	3,934	7.9
68	2	12,964	25,928	0.6	3,241	6.5
69	1	13,276	13,276	0.3	1,660	3.3
70		2,793	2,793	0.1	349	0.7
71 72	1 1	6,467 2,508	6,467 2,508	0.1	808 314	1.6 0.6
73	2	2,508	42,145	1.0	•	10.5
74	1	6,238	6,238	0.1	5,268 780	1.6
75	1	33,628	33,628	0.8	4,204	8.4
76	1	46,110	46,110	1.1	5,764	11.5
77	1	21,032	21,032	0.5	2,629	5.3
78	2	10,660	21,320	0.5	2,665	5.3
79	2	4,859	9,719	0.2	1,215	2.4
80	1	5,299	5,299	0.1	662	1.3
81	1	9,282	9,282	0.2	1,160	2.3
82	1	6,006	6,006	0.1	751	1.5
83	1	2,966	2,966	0.1	371	0.7
84	1	4,478	4,478	0.1	560	1.1
85	2	15,299	30,598	0.7	3,825	7.6
86	1	1,054	1,054	0.0	132	0.3
87	1	3,215	3,215	0.1	402	0.8
	_	-,===	-/			

FID No.	No. of Stories	Building Footprint (SF)	Total Floor Area (SF)	Total Floor Area (Acres)	Non-Residential Flow	Equivalent Dwelling Units (EDU)
88	1	8,718	8,718	0.2	1,090	2.2
89	1	30,138	30,138	0.7	3,767	7.5
90	1	48,951	48,951	1.1	6,119	12.2
91	1	40,760	40,760	0.9	5,095	10.2
92	2	14,707	29,413	0.7	3,677	7.4
93	1	5,673	5,673	0.1	709	1.4
94	1	3,596	3,596	0.1	449	0.9
95	1	3,221	3,221	0.1	403	0.8
96	1	3,535	3,535	0.1	442	0.9
97	1	2,213	2,213	0.1	277	0.6
98	1	7,072	7,072	0.2	884	1.8
99	1	3,663	3,663	0.1	458	0.9
100	1	1,224	1,224	0.0	153	0.3
101	2	25,304	50,607	1.2	6,326	12.7
102	1	3,874	3,874	0.1	484	1.0
103	1	6,861	6,861	0.2	858	1.7
104	2	11,643	23,287	0.5	2,911	5.8
105	1	77,180	77,180	1.8	9,648	19.3
106	2	3,200	6,400	0.1	800	1.6
107	2	11,019	22,037	0.5	2,755	5.5
108	1	15,482	15,482	0.4	1,935	3.9
109	1	2,950	2,950	0.1	369	0.7
110	2	4,942	9,883	0.2	1,235	2.5
111	2	3,770	7,539	0.2	942	1.9
112	1	2,019	2,019	0.0	252	0.5
113	1	38,796	38,796	0.9	4,849	9.7
114	2	10,032	20,064	0.5	2,508	5.0
115	1	29,547	29,547	0.7	3,693	7.4
116	1	4,768	4,768	0.1	596	1.2
117	1	7,630	7,630	0.2	954	1.9
118	1	2,426	2,426	0.1	303	0.6
119	2	1,492	2,985	0.1	373	0.7
120	1	1,562	1,562	0.0	195	0.4
121	1	7,504	7,504	0.2	938	1.9
122	1	2,469	2,469	0.1	309	0.6
123	2	2,017	4,034	0.1	504	1.0
124	1	3,027	3,027	0.1	378	0.8
125	1	2,701	2,701	0.1	338	0.7
126	2	3,104	6,208	0.1	776	1.6
127	1	2,002	2,002	0.0	250	0.5
128	2	1,836	3,673	0.1	459	0.9
129	1	4,698	4,698	0.1	587	1.2
130	2	1,899	3,799	0.1	475	0.9
131	2	766	1,533	0.0	192	0.4

FID No.	No. of Stories	Building Footprint (SF)	Total Floor Area (SF)	Total Floor Area (Acres)	Non-Residential Flow	Equivalent Dwelling Units (EDU)
132	1	2,039	2,039	0.0	255	0.5
133	1	903	903	0.0	113	0.2
134	1	1,359	1,359	0.0	170	0.3
135	1	1,737	1,737	0.0	217	0.4
136	1	833	833	0.0	104	0.2
137	2	969	1,938	0.0	242	0.5
138	1	136,702	136,702	3.1	17,088	34.2
139	1.5	193,779	290,668	6.7	36,334	72.7
140	1	22,808	22,808	0.5	2,851	5.7
141	2	14,824	29,647	0.7	3,706	7.4
142	2	23,514	47,027	1.1	5,878	11.8
143	1	5,782	5,782	0.1	723	1.4
144	2	48,476	96,953	2.2	12,119	24.2
145	1	24,882	24,882	0.6	3,110	6.2
146	1	2,301	2,301	0.1	288	0.6
147	2	1,041	2,081	0.0	260	0.5
148	2	2,794	5,588	0.1	698	1.4
149	2	35,303	70,606	1.6	8,826	17.7
150	1	3,009	3,009	0.1	376	0.8
151	2	96,544	193,089	4.4	24,136	48.3
152	2	12,446	24,892	0.6	3,111	6.2
153	1	6,918	6,918	0.2	865	1.7
154	1	7,490	7,490	0.2	936	1.9
155	1	4,514	4,514	0.1	564	1.1
156	1	13,755	13,755	0.3	1,719	3.4
157	2	2,146	4,292	0.1	537	1.1
158	2	3,522	7,044	0.2	880	1.8
159	1	2,437	2,437	0.1	305	0.6
160	2	3,186	6,371	0.1	796	1.6
161	2	1,453	2,906	0.1	363	0.7
162	1	3,752	3,752	0.1	469	0.9
163	1	870	870	0.0	109	0.2
164	1	2,294	2,294	0.1	287	0.6
165	1	13,504	13,504	0.3	1,688	3.4
166	1	1,715	1,715	0.0	214	0.4
167	1	3,316	3,316	0.1	414	0.8
168	2	2,733	5,465	0.1	683	1.4
169	2	4,646	9,292	0.2	1,162	2.3
170	2	1,630	3,260	0.1	407	0.8
171	1	1,718	1,718	0.0	215	0.4
172	1	988	988	0.0	123	0.2
173	1	5,598	5,598	0.1	700	1.4
174	1	3,497	3,497	0.1	437	0.9
175	2	1,333	2,666	0.1	333	0.7

FID No.	No. of Stories	Building Footprint (SF)	Total Floor Area (SF)	Total Floor Area (Acres)	Non-Residential Flow	Equivalent Dwelling Units (EDU)
176	2	6,017	12,033	0.3	1,504	3.0
177	2	984	1,968	0.0	246	0.5
178	2	3,198	6,396	0.1	799	1.6
179	1	779	779	0.0	97	0.2
180	1	7,350	7,350	0.2	919	1.8
181	1	734	734	0.0	92	0.2
182	2	38,313	76,625	1.8	9,578	19.2
183	2	3,271	6,542	0.2	818	1.6
184	1	4,478	4,478	0.1	560	1.1
185	1	63,597	63,597	1.5	7,950	15.9
186	2	2,403	4,806	0.1	601	1.2
187	1	2,228	2,228	0.1	278	0.6
188	2	4,415	8,830	0.2	1,104	2.2
189	2	1,650	3,300	0.1	413	0.8
190	2	3,200	6,400	0.1	800	1.6
191	1	1,993	1,993	0.0	249	0.5
192	2	30,570	61,139	1.4	7,642	15.3
193	3	44,798	134,393	3.1	16,799	33.6
194	2	2,711	5,423	0.1	678	1.4

 Total Floor Area (SF)
 5,599,366

 Total Floor Area (Acres)
 129

 Total EDU's
 1,400

^{*} Equivalent Dwelling Units (EDU's) were calculated by converting the total SF of commercial properties within the Borough of Oakland and multiplying it by the Wastewater Flow Factor of 0.125 gallons per day (gpd) as per N.J.A.C.7-9A-7.4. The total flow of non-residential development was then divided by 500gpd to generate the resulting number of Equivalent Dwelling Units.

COMMERCIAL BUILDING CALCULATIONS (PLANNING AREA ONLY)

	COMMERCIAL BOILDING CALCOLATIONS (I LANGING AREA ONLY)							
FID No.	No. of	Building	Total Floor Area	<u>Total Floor</u>	Non-Residential	Equivalent Dwelling		
<u>110 NO.</u>	<u>Stories</u>	Footprint (SF)	<u>(SF)</u>	Area (Acres)	<u>Flow</u>	<u>Units (EDU)</u>		
0	1	20,514	20,514	0.5	2,564	5.1		
1	1	32,119	32,119	0.7	4,015	8.0		
2	1	41,844	41,844	1.0	5,231	10.5		
3	2	40,546	81,092	1.9	10,137	20.3		
4	1	60,239	60,239	1.4	7,530	15.1		
5	2	99,035	198,070	4.5	24,759	49.5		
6	1	49,453	49,453	1.1	6,182	12.4		
7	1	39,305	39,305	0.9	4,913	9.8		
8	1	42,583	42,583	1.0	5,323	10.6		
9	1	19,790	19,790	0.5	2,474	4.9		
10	1	31,227	31,227	0.7	3,903	7.8		
11	2	187,598	375,196	8.6	46,900	93.8		
12	2	72,628	145,256	3.3	18,157	36.3		
13	2	94,501	189,002	4.3	23,625	47.3		
14	1	152,921	152,921	3.5	19,115	38.2		
15	1	28,150	28,150	0.6	3,519	7.0		
16	1	20,397	20,397	0.5	2,550	5.1		
17	1	4,068	4,068	0.1	509	1.0		
18	1	40,564	40,564	0.9	5,071	10.1		
19	2	31,532	63,064	1.4	7,883	15.8		
20	1	44,519	44,519	1.0	5,565	11.1		
21	1	36,517	36,517	0.8	4,565	9.1		
22	1	23,885	23,885	0.5	2,986	6.0		
23	1	40,880	40,880	0.9	5,110	10.2		
24	2	25,996	51,992	1.2	6,499	13.0		
25	2	30,573	61,146	1.4	7,643	15.3		
26	2	23,532	47,064	1.1	5,883	11.8		
27	2	3,792	7,584	0.2	948	1.9		
28	2	41,429	82,858	1.9	10,357	20.7		
29	3	44,135	132,405	3.0	16,551	33.1		
30	3	44,346	133,038	3.1	16,630	33.3		
31	1	45,315	45,315	1.0	5,664	11.3		
32	2	46,787	93,574	2.1	11,697	23.4		
33	3	12,928	38,784	0.9	4,848	9.7		
34	2	5,735	11,470	0.3	1,434	2.9		
35	1	4,248	4,248	0.1	531	1.1		
36	1	5,454	5,454	0.1	682	1.4		
37	1	2,427	2,427	0.1	303	0.6		
38	1	5,805	5,805	0.1	726	1.5		
39	1	3,597	3,597	0.1	450	0.9		
40	2	6,090	12,180	0.3	1,523	3.0		
41	2	4,136	8,272	0.2	1,034	2.1		
42	2	8,061	16,122	0.4	2,015	4.0		

43	2	15,296	30,592	0.7	3,824	7.6

FID No.	No. of Stories	Building Footprint (SF)	Total Floor Area (SF)	Total Floor Area (Acres)	Non-Residential Flow	Equivalent Dwelling Units (EDU)
44	1	1,022	1,022	0.0	128	0.3
45	1	1,084	1,084	0.0	136	0.3
46	2	14,100	28,200	0.6	3,525	7.1
47	2	35,929	71,858	1.6	8,982	18.0
48	2	32,623	65,246	1.5	8,156	16.3
49	1	20,869	20,869	0.5	2,609	5.2
50	2	35,293	70,586	1.6	8,823	17.6
51	2	35,476	70,952	1.6	8,869	17.7
52	2	35,076	70,152	1.6	8,769	17.5
53	1	24,170	24,170	0.6	3,021	6.0
54	2	15,738	31,476	0.7	3,935	7.9
55	2	12,964	25,928	0.6	3,241	6.5
56	1	13,276	13,276	0.3	1,660	3.3
57	1	2,793	2,793	0.1	349	0.7
58	1	3,596	3,596	0.1	450	0.9
59	1	3,535	3,535	0.1	442	0.9
60	1	2,213	2,213	0.1	277	0.6
61	1	7,072	7,072	0.2	884	1.8
62	1	3,663	3,663	0.1	458	0.9
63	1	1,224	1,224	0.0	153	0.3
64	2	25,304	50,608	1.2	6,326	12.7
65	1	3,874	3,874	0.1	484	1.0
66	1	6,861	6,861	0.2	858	1.7
67	2	11,643	23,286	0.5	2,911	5.8
68	1	77,180	77,180	1.8	9,648	19.3
69	2	3,200	6,400	0.1	800	1.6
70	2	11,019	22,038	0.5	2,755	5.5
71	1	15,482	15,482	0.4	1,935	3.9
72	1	2,950	2,950	0.1	369	0.7
73	2	4,942	9,884	0.2	1,236	2.5
74	2	3,770	7,540	0.2	943	1.9
75	1	2,019	2,019	0.0	252	0.5
76	1	38,796	38,796	0.9	4,850	9.7
77	2	10,032	20,064	0.5	2,508	5.0
78	1	29,547	29,547	0.7	3,693	7.4
79	1	4,768	4,768	0.1	596	1.2
80	1	7,630	7,630	0.2	954	1.9
81	1	2,426	2,426	0.1	303	0.6
82	2	1,492	2,984	0.1	373	0.7
83	1	1,562	1,562	0.0	195	0.4
84	1	7,504	7,504	0.2	938	1.9
85	1	2,469	2,469	0.1	309	0.6
86	2	2,017	4,034	0.1	504	1.0
87	1	3,027	3,027	0.1	378	0.8

FID No.	No. of Stories	Building Footprint (SF)	Total Floor Area (SF)	Area (Acres)	Non-Residential Flow	Equivalent Dwelling Units (EDU)
88	1	2,701	2,701	0.1	338	0.7
89	2	3,104	6,208	0.1	776	1.6
90	1	2,002	2,002	0.0	250	0.5
91	2	1,836	3,672	0.1	459	0.9
92	1	4,698	4,698	0.1	587	1.2
93	2	1,899	3,798	0.1	475	0.9
94	2	766	1,532	0.0	192	0.4
95	1	2,039	2,039	0.0	255	0.5
96	1	903	903	0.0	113	0.2
97	1	1,359	1,359	0.0	170	0.3
98	1	1,737	1,737	0.0	217	0.4
99	1	833	833	0.0	104	0.2
100	2	969	1,938	0.0	242	0.5
101	1	136,702	136,702	3.1	17,088	34.2
102	1.5	193,779	290,669	6.7	36,334	72.7
103	1	22,808	22,808	0.5	2,851	5.7
104	2	14,824	29,648	0.7	3,706	7.4
105	2	23,514	47,028	1.1	5,879	11.8
106	1	5,782	5,782	0.1	723	1.4
107	2	48,476	96,952	2.2	12,119	24.2
108	1	24,882	24,882	0.6	3,110	6.2
109	1	2,301	2,301	0.1	288	0.6
110	2	1,041	2,082	0.0	260	0.5
111	2	2,794	5,588	0.1	699	1.4
112	2	35,303	70,606	1.6	8,826	17.7
113	1	3,009	3,009	0.1	376	0.8
114	2	96,544	193,088	4.4	24,136	48.3
115	2	12,446	24,892	0.6	3,112	6.2
116	1	6,918	6,918	0.2	865	1.7
117	1	7,490	7,490	0.2	936	1.9
118	1	4,514	4,514	0.1	564	1.1
119	1	13,755	13,755	0.3	1,719	3.4
120	2	2,146	4,292	0.1	537	1.1
121	2	3,522	7,044	0.2	881	1.8
122	1	2,437	2,437	0.1	305	0.6
123	2	3,186	6,372	0.1	797	1.6
124	2	1,453	2,906	0.1	363	0.7
125	1	3,752	3,752	0.1	469	0.9
126	1	870	870	0.0	109	0.2
127	1	2,294	2,294	0.1	287	0.6
128	1	13,504	13,504	0.3	1,688	3.4
129	1	1,715	1,715	0.0	214	0.4
130	1	3,316	3,316	0.1	415	0.8
131	2	2,733	5,466	0.1	683	1.4

FID No.	No. of Stories	Building Footprint (SF)	Total Floor Area (SF)	Total Floor Area (Acres)	Non-Residential Flow	Equivalent Dwelling Units (EDU)
132	2	4,646	9,292	0.2	1,162	2.3
133	2	1,630	3,260	0.1	408	0.8
134	1	1,718	1,718	0.0	215	0.4
135	1	988	988	0.0	124	0.2
136	1	5,598	5,598	0.1	700	1.4
137	1	3,497	3,497	0.1	437	0.9
138	2	1,333	2,666	0.1	333	0.7
139	2	6,017	12,034	0.3	1,504	3.0
140	2	984	1,968	0.0	246	0.5
141	2	3,198	6,396	0.1	800	1.6
142	1	779	779	0.0	97	0.2
143	1	7,350	7,350	0.2	919	1.8
144	1	734	734	0.0	92	0.2
145	2	38,313	76,626	1.8	9,578	19.2
146	2	3,271	6,542	0.2	818	1.6
147	1	4,478	4,478	0.1	560	1.1
148	1	63,597	63,597	1.5	7,950	15.9
149	2	2,403	4,806	0.1	601	1.2
150	1	2,228	2,228	0.1	279	0.6
151	2	4,415	8,830	0.2	1,104	2.2
152	2	1,650	3,300	0.1	413	0.8
153	2	3,200	6,400	0.1	800	1.6
154	1	1,993	1,993	0.0	249	0.5
155	2	30,570	61,140	1.4	7,643	15.3
156	2	2,711	5,422	0.1	678	1.4

 Total Floor Area (SF)
 4,824,174

 Total Floor Area (Acres)
 111

 Total EDU's
 1,206

^{*} Equivalent Dwelling Units (EDU's) were calculated by converting the total SF of commercial properties within the Borough of Oakland and multiplying it by the Wastewater Flow Factor of 0.125 gallons per day (gpd) as per N.J.A.C.7-9A-7.4. The total flow of non-residential development was then divided by 500gpd to generate the resulting number of Equivalent Dwelling Units.



Oakland Borough Municipal Build-Out Report

Prepared by the State of New Jersey Highlands Water Protection and Planning Council in Support of the Highlands Regional Master Plan: Report on the Results of Modules 1 and 2 of the 2009 Plan Conformance Process

August 2009

OAKLAND BOROUGH MUNICIPAL BUILD-OUT REPORT

HIGHLANDS REGIONAL MASTER PLAN CONFORMANCE

Purpose and Scope

The Highlands Regional Master Plan (RMP) requires that conforming municipalities develop a local build-out analysis that incorporates the policies and objectives of the RMP. Specifically, conforming municipalities are required to "use the Highlands Build-Out Model to develop a local build-out analysis that incorporates RMP policies and objectives to evaluate land use capability and capacity planning" (Objective 6G4c). The RMP build-out process requires a Limiting Factor Analysis to examine three categories of constraints:

- 1. Land Based Capacity (potential developable lands);
- 2. Resource Based Capacity (Septic System Yield and Net Water Availability); and
- 3. Utility Based Capacity (public water and wastewater).

This Municipal Build-Out Report provides the results of the local build-out analysis based on potential developable lands and existing municipal conditions, including sewer and water supply capacity and Net Water Availability where relevant. It incorporates the results of the first two modules of the 2009 Plan Conformance Grants Program: Module 1 "Current Municipal Conditions and Build-Out Analysis," and Module 2 "Land Use and Resource Capacity Analysis." Both modules were completed through a detailed process involving a cooperative effort of the municipality and the Highlands Council. This process was designed to ensure use of the most current municipal information available and proper application of RMP requirements in the conduct of all analyses. The results for Oakland Borough are presented in the section "Full Build-Out and Constraints Summary" and tabulated in Table 4 below.

The results of the local build-out analysis are for use by conforming municipalities for other planning activities required for Plan Conformance, such as development of Fair Share Plans addressing affordable housing obligations (Module 3). They also will be useful in complying with the New Jersey Department of Environmental Protection (NJDEP) wastewater management planning requirements under the Water Quality Management Planning rules at N.J.A.C. 7:15-5. The results are intended to assess current municipal conditions as they relate to specific RMP policies and objectives. It is important to note that the build-out analysis incorporates many but not every constraint to development included in the RMP, State regulations or local zoning. Future activities under Plan Conformance will address issues such as more refined or current analyses of land availability, resource capacity, resource protection and utility capacity that may modify these results to either increase or decrease the projected build out of the municipality (e.g., reducing build-out

Municipal Build-Out Report for Oakland Borough

projections through land preservation, increasing build-out projections by increasing Net Water Availability or designation of Highlands Redevelopment Areas).

The results of the municipal build-out analysis are designed to be utilized at a municipal scale and are not appropriate for determining if a particular parcel or development project is consistent with the RMP. Therefore, the Highlands Build-Out Model is not intended to be applied at a parcel level to determine the development potential of that parcel, as the municipality must apply additional planning and zoning analyses to determine appropriate future sustainable development.

All of the data and figures regarding specific parcels, including, but not limited to, preserved lands and water and sewer service, are based on a review of currently available information; however, unintentional inaccuracies may occur and may be formally addressed as RMP Updates. Any request for a formal determination to address updated information may be submitted to the Highlands Council in accordance with the RMP policies and procedures for RMP Updates. In addition, this report does not address any Map Adjustments that a municipality may seek to revise the Land Use Capability Zone Map; these will be addressed at a later date.

It is critical to note that this build-out analysis was conducted based on the requirements of Plan Conformance with the RMP, as applied to parcels deemed potentially developable (vacant, over- sized and redevelopable) as of early 2009. These results do not include:

- development that has been approved but not completed as of early 2009, which may yield more or less growth than the build-out results calculated for the affected parcels;
- the potential impact of some future development that may be deemed exempt from the Highlands Act, which may yield more or less growth than the build-out results calculated for those lands;¹
- the potential impact of future redevelopment that may be approved through designation of Highlands Redevelopment Areas or other approvals granted with waivers as authorized by the Highlands Act, which may yield more growth than the build-out results calculated for those lands;
- the potential impact of certain land use restrictions based on State regulations and local ordinances that could not be assessed through a municipal level of analysis; and

-

¹ Where such development is located in an approved wastewater service area in the RMP Existing Community Zone (not including the Environmentally-Constrained Sub-Zone) or the Lake Community Sub-Zone, the results should be similar because the build-out analysis used local zoning. Future developments that may be authorized within the Environmentally-Constrained Sub-Zones, Protection Zone or Conservation Zone that use public or community on-site wastewater systems will have significantly different yields than calculated through the RMP build-out process. Likewise, the Septic System Yields for lands that will rely on septic systems may be significantly different from what those allowed by current municipal zoning.

Municipal Build-Out Report for Oakland Borough

• any reductions in build-out projections due to land preservation for open space or farmland beyond those preserved lands identified by the municipality through Module 1.

Therefore, the Highlands Municipal Build-Out Report for a municipality is a result of current conditions and application of RMP requirements. It provides a critical planning tool but cannot be used as a definitive prediction of the future or as a basis for parcel-based development potential.

This is a final Municipal Build-Out Report, which supersedes the Module 1 Summary Report. The results may be used in Module 3 by the municipality in support of its Housing Element and Fair Share Plan and other relevant purposes.

Report Structure

This Highlands Council report is based on the municipal build-out results from Modules 1 and 2 performed by Oakland Borough and the Highlands Council, in conformance with the Highlands Regional Master Plan (RMP). These results include consideration of potential land availability, utility capacity, municipal zoning in wastewater utility service areas, Septic System Yield and Net Water Availability in accordance with the RMP. The RMP build-out analysis estimates the potential for new development in Oakland Borough, for the entire municipality (see **Full Build-Out and Constraints Summary**, below).

First, the analysis addressed the build-out potential of the available lands, assuming application of RMP requirements for septic system yields and utility service areas without constraints related to the available capacity of public water supply and wastewater utilities or Net Water Availability. Essentially, the land-based build out represents the maximum potential for development in conformance with the RMP if no other constraints exist. Where sewered development is in conformance with the RMP, municipal zoning is used to determine build-out potential. Where septic systems will be used, the RMP requirements apply and the resulting septic system yield is assumed to be entirely residential in nature. To the extent that septic system capacity is used for non-residential development based on a proportional reallocation from residential development, the projected growth will be different than those reported above. Any reallocations of septic system yield will be addressed in Module 3 – Housing Element and Fair Share Plan.

Second, the public water supply and wastewater demands of development projected for the utility service area are compared to the utility capacity available to the municipality, regarding both public water supply and wastewater utilities. Where capacity is insufficient to support the build-out demand, the build-out estimates are reduced.

Third, the resulting water supply demands from build out in both public water supply utility service areas and domestic well service areas are compared to the Net Water Availability for the HUC14 subwatershed. In many cases, this step required information regarding water supply demands from other municipalities, so that the full demands against each HUC14 subwatershed could be assessed. Again, where Net Water Availability is insufficient to support the build-out demand, the build-out estimates are reduced.

Finally, where a wastewater utility had available capacity for a municipality after meeting all build-out demands, the Highlands Council investigated whether sufficient Net Water Availability exists to support the use of all or part of that wastewater utility capacity for such purposes as affordable housing, TDR Receiving Zones and other purposes supported by the RMP.

This report also includes a discussion of technical methods used in the build-out process, including quality control assessments and build-out impact factors.

Full Build-Out and Constraints Summary for Oakland Borough

Overview

The Oakland Borough is located within both the Preservation Area and Planning Area. The RMP build-out analysis for Oakland Borough estimates the following new development results for potential developable lands for the entire municipality, which are discussed in detail in the following section and summarized in Table 4:

- 1. <u>Development in Wastewater Utility Service Areas</u>: 0 residential dwelling units and 0 square feet of non-residential development, resulting in a wastewater demand of 0 gallons per day (gpd), or 0 million gallons per day (MGD), and estimated public water supply demands of 0 gpd, or 0 MGD.
- 2. <u>Development in Septic System Areas</u>: 16 septic systems in the Planning Area for all RMP Land Use Capability Zones and HUC14 subwatersheds, and 0septic systems in the Preservation Area.

The build-out results based on potential developable lands are not constrained by water supply utility capacity and wastewater utility capacity. The water supply demands from the build-out are not constrained by water availability.

Municipal Capacity Conditions and Analysis

A summary of findings on municipal build-out capacity conditions appears in Table 1. It includes the following: potential developable vacant, over-sized and redevelopable lands in the RMP wastewater utility area; potential developable vacant, over-sized and redevelopable parcels in the septic system areas; RMP Septic System Yield; RMP Build-Out Environmentally Constrained lands; available wastewater utility capacity; and available Public Community Water Supply utility capacity.

All figures are the results of an RMP consistency analysis applied to the information supplied by the Highlands Council, as supplemented and verified by Oakland Borough. Each Figure shows all of the parcels that were used in the build-out process, whether for Septic System Yield or for build out of RMP wastewater utility areas.

- **Figure 1** presents the parcel-based potential developable lands and their association with HUC14 subwatersheds and Land Use Capability Zones, which relate to the RMP Septic System Yield values where the parcels will be served by septic systems.
- Figure 2 presents the parcel-based potential developable lands and the RMP Build-Out Environmentally Constrained lands (i.e., steep slopes, flood prone areas and Highlands Open Water buffers). Some of these areas are within the RMP Environmentally- Constrained Sub-Zones while others are smaller-scale environmental features outside those sub-zones.

Municipal Build-Out Report for Oakland Borough

- **Figure 3** presents the parcel-based potential developable lands and their association with the RMP utility area² for RMP HDSF³ wastewater utilities.
- **Figure 4** presents the parcel-based potential developable lands associated with the RMP utility area⁴ for RMP Public Community Water System utilities.

RMP Build-Out Developable Land, Over-Sized Lot Analysis and Redevelopable Land

Oakland Borough identified 219 acres of potential developable vacant lots and 10 acres of potential developable lands on over-sized lots within areas that will be served by septic systems, for a total of 229 acres of potential developable Septic System Yield lands. These lands were used as the basis for Septic System Yield, regardless of the extent to which any of the lands were steep slopes, flood prone areas or Highlands Open Water buffers.

In addition, there are no (0) acres of potential developable vacant lands and no (0) acres of identified potential redevelopable land (either over-sized lots or specifically identified by the municipality as being a redevelopment target) within the Existing Area Served by utilities. The municipal information for potential developable lands, over-sized lots and redevelopable land was evaluated by the Highlands Council in accordance with the RMP for the build-out analysis. The results for all report figures are summarized in Table 1.

RMP Septic System Yield Analysis

There are three (3) HUC14 subwatersheds located entirely or partially within the Planning Area of Oakland Borough. The RMP Septic System Yield analysis for the Planning Area determined a yield of 0 units for the Conservation Zone, 14 units for the Existing Community Zone and 2 units for the Protection Zone. The RMP Septic System Yield analysis determined a yield of 0 units for the Preservation Area. The total RMP Septic System Yield for Oakland Borough is 16 units. Refer to Table 1 and Figure 1 for additional details.

² The RMP utility area for wastewater includes the Existing Areas Served based on the RMP, plus any NJDEP-approved Sewer Service Area that is within the Existing Community Zone (not including the Environmentally-Constrained Sub-Zone) or the Lake Community Sub-Zone.

³ HDSF - Highlands Domestic Sewerage Facility. These are wastewater treatment works that provide wastewater treatment primarily of sanitary sewage rather than industrial wastewater as a public utility, and may include service areas and treatment capacities sufficient to support redevelopment and regional growth opportunities. As such, they provide service to multiple parcels under different ownership, rather than to specific developments (e.g., schools, shopping centers, public institutions).

⁴ The RMP utility area for public water supply includes the Existing Areas Served based on the RMP, plus any additional properties identified by the municipality that are within the Existing Community Zone (not including the Environmentally-Constrained Sub-Zone) or the Lake Community Sub-Zone.

The build out for septic systems in the Preservation Area identifies the number of septic systems that would be considered permissible under the NJDEP Preservation Area Rules at N.J.A.C. 7:38-3.4. Each vacant or over-sized lot identified through Module 1 and 2 was assessed to determine whether it was of sufficient size to accommodate one or more septic systems, based on NJDEP requirements for 1 unit per 25 acres of non-forested lands, 1 unit per 88 acres of forested lands, or some proportional combination thereof. The yield is assigned by parcel, not by aggregate acreage across multiple parcels, and is compiled for the entire Preservation Area of the municipality as shown in Table 1. Parcels that were too small to accommodate a new septic system under these provisions received no Septic System Yield.

In the Planning Area, the build out for septic systems is based on a yield evaluation for the aggregate of two areas: the acreage of vacant parcels and the net acreage of over-sized parcels. These areas are divided into HUC14 subwatershed/RMP Land Use Capability Zone combinations. Each combination of HUC14 subwatershed and Land Use Capability Zone within the municipality receives its own Septic System Yield, which is not transferable. The yield is based on RMP Policy 2L2, which establishes nitrate targets for each Land Use Capability Zone and incorporates the relevant drought recharge values for each HUC14 subwatershed.

The RMP Septic System Yield is calculated for <u>all</u> potential developable lands reliant on septic systems, which may include lands zoned for both residential <u>and</u> non-residential development. Any yields are provided in "equivalent residential units" which may later be allocated among residential and non-residential development using flow translation factors provided in the *Highlands Regional Build-Out Technical Report* (see Appendix B of this report). Therefore, Septic System Yield calculated for Oakland Borough would equate to 16 residential units only if no yield is allocated to non- residential development. Septic System Yield may be allocated to non-residential development by reducing the number of residential units and increasing the amount of non-residential development proportionally based on relative flows. This allocation process and the implications for affordable housing requirements will be addressed in Module 3 - Housing Element and Fair Share Plan; this analysis is not part of this report. Therefore, no estimate is made here of non-residential development. All development on septic systems is assumed to rely on domestic wells for the purposes of this analysis.

RMP Build-Out Environmentally Constrained Lands

The RMP Build-Out analysis identified portions of the potential developable lands that are environmentally constrained based on the RMP (i.e., steep slopes, flood prone areas and Highlands Open Water buffers). These constraints were used in the build-out analysis to determine, where wastewater utility service was anticipated based on conformance with the RMP and approved sewer service areas, whether specific parcels had at least 1,400 square feet of unconstrained area. In addition, the nature and extent of these lands may influence the future development of lands in the septic system areas regarding the allocation of Septic System Yield to them and utility lands that are suitable for development. Out of the 229 gross developable acres in Oakland Borough, for vacant

parcels there is a potential net developable area of 44 acres in the Planning Area and 0 acres in the Preservation Area; for over-sized parcels there is a potential net developable area of -1 acres in the Planning Area and 0 acres in the Preservation Area. These values are a summation of the parcel-specific analyses. Refer to Table 1 and Figure 2 for additional details. This analysis should be viewed as an indicator of the level of environmental constraints in potentially developable lands, not as a parcel-based measure of development capacity.

In certain instances, the municipal potential net developable acres may be under-reported relative to actual buildable area conditions, and may even show a zero or negative value. A zero or negative value indicates that a very high degree of environmental constraints exists on the potential developable parcels of the municipality as a whole and especially on the over-sized lots; however, some potential developable lands may still exist. This result reflects the evaluation of over-sized lots and of vacant lots that are partly included in the sewer service build-out analysis. The potential developable acres for over-sized parcels are calculated by subtracting the equivalent of a buildable area for a single unit of development (e.g., one house) under the RMP from the total parcel size. Likewise, some parcels are only partially eligible for sewered development. In both cases the environmental constrained acres for these parcels are calculated based on the entire parcel area due to GIS processing issues. This section of the Municipal Build-Out Report uses a municipal aggregate land area analysis. This information will be used in later aspects of Plan Conformance at a parcel level and not as a municipal land aggregate value. Evaluation of the relationship of septic system yield and buildable lands will be based on the build-out parcel data information and not the Table 1 municipal summary reported values.

As part of that analysis, the municipality will be able to use the database to analyze vacant parcels in septic system areas, to help identify parcels that could be considered to have some reasonable potential for development based on the amount of unconstrained land within them. Further analysis in later phases of Plan Conformance would then identify additional constraints to the realistic development potential of these parcels based on one or more of the following factors:

- 1. lack of a minimum one-acre contiguous, unconstrained building site;
- 2. the potential building site is not accessible or access will result in damage to environmentally constrained lands;
- 3. application of municipal zoning constraints such as those prohibiting creation of flag lots, landlocked parcels, etc.; or
- 4. parcel configuration or other parcel-specific issues.

This information on vacant lands with a reasonable potential for development can be used to support the evaluation of Septic System Yield assignment in later phases of Plan Conformance.

Available HDSF Wastewater Utility Capacity

One HDSF facility serving a very small portion of Oakland Borough is Pompton Lakes MUA. The current available Highlands Region capacity for the utility is 0.094 million gallons per day (MGD) (2003 data) for all municipalities served by the system. The current capacity available to Oakland Borough is not available at this time. There is no wastewater generation from the build out for this facility.

Another HDSF facility serving a very small portion of Oakland Borough is NW Bergen County MUA. The current available Highlands Region capacity for the utility is 0.691 million gallons per day (MGD) (2003 data) for all municipalities served by the system. The current capacity available to Oakland Borough is approximately 0.001 MGD, based upon information developed for the build- out process. There is no wastewater generation from the build out for this facility. Refer to Table 1 and Figure 3 for additional details.

Oakland Borough-Indian Hills HS, Skyview/Hibrook, Oakwood Knolls, Mountain View STP, Oakland Care Center, Manito Elementary School, Chapel Hill Estates, and Riverbend are Non-HDSF in Oakland Borough. There is no wastewater generation from build out for these facilities.

Based on the current municipal available capacity minus the build-out demands for this wastewater utility, there may be capacity available for future allocation. Priority shall be given to addressing additional needs based on Objective 2K3e, such as imminent threats to public health from areas of failing septic systems, designated TDR Receiving Zones, and to infill or redevelopment projects in the Existing Community Zone (not including the Environmentally-Constrained Sub-Zone) and the Lake Community Sub-Zone that are consistent with the RMP and either address affordable housing obligations or have final municipal approval. Additional priorities include Highlands Redevelopment Areas or cluster development consistent with the RMP. Capacity may also be allocated to the Existing Area Served for redevelopment purposes.

Available Public Community Water System Utility Capacity

The public water supply utility serving Oakland Borough is the Oakland Water Department. The current available Highlands Region capacity for the utility is 42.39 million gallons per month (MGM). The current capacity available to Oakland Borough is approximately 41.54 MGM. There is no public water demand from the build out for this facility. Refer to Table 1 and Figure 4 for additional details.

Based on the current municipal available capacity minus the build out for this water supply utility, there may be capacity available for future allocation. Priorities are similar to those for wastewater capacity (see RMP Objective 2J4c).

Water Availability Constraints

The build-out results for Oakland Borough, based on developable land and utility capacity, were compared to Net Water Availability by the Highlands Council to determine if Net Water Availability

posed an additional constraint on development capacity. This analysis determined the potential for Net Water Availability constraints by HUC14 subwatershed, including water demands from both Oakland Borough and other municipalities and water users that withdraw water from the same HUC14 subwatershed. The Highlands Council determined whether each demand was consumptive or depletive. For the purpose of this analysis, all septic system units were considered to represent a residential land use in accordance with the Highlands Module 2 Build-out Impact Factors presented in Appendix B, and were addressed as consumptive water uses.

The results were compared to Net Water Availability, whether for non-deficit (surplus) subwatersheds, or deficit (Conditional Water Availability) subwatersheds. These values, whether from a deficit or surplus subwatershed, are collectively referred to as Net Water Availability. In HUC14 subwatersheds dominated by Conservation Zone lands, the water availability dedicated for agricultural purposes is not used for this analysis.

Based on this analysis, the Highlands Council determined that the following HUC14 subwatersheds, both within the municipality and in other municipalities but relied upon for municipal water supply, have insufficient Net Water Availability to support the build out demand:

Table 2 – Net Water Availability Constraints Analysis – Deficits					
Build-Out Net Water Shortfall (MGD) HUC14 Subwatershed Demand (MGD)* Availability (MGD)					
NA					

^{*}Subsequent to any reductions due to utility constraints.

For the remaining HUC14 subwatersheds partially or entirely in the municipality, the Highlands Council also assessed the amount of Net Water Availability remaining after build out. The results are in Table 3, which indicates the remaining Net Water Availability for each HUC14 subwatershed (where positive) and the associated public water supply systems that rely upon the HUC14 subwatershed for supply. This information can be used by the municipality to determine whether there is water available to the public water supply system that could support development within any associated wastewater utility service area, whether within the same HUC14 subwatershed or another, for purposes consistent with the RMP as describe above. The wastewater utility must also have remaining capacity available to the municipality. (Note: this available water cannot be used to increase the Septic System Yield beyond the amount calculated by the Highlands Council, nor can it be used to justify creation or expansion of utilities in violation of RMP requirements.) A decision as to the allocation of this capacity may occur in Module 3 regarding affordable housing needs identified in the Fair Share Plan, or later in the Plan Conformance process regarding other uses. Where a HUC14 subwatershed is relied upon by more than one municipality for water supply, whether on-site or a public water supply system, coordination will be needed among the municipalities to ensure that proposals for additional use do not exceed the remaining Net Water Availability. Also, there may be additional HUC14 subwatersheds not within the municipality that supply water to the municipality, which are not assessed here.

Table 3 – Ne	et Water Availability -	- Remaining Capacity
HUC14 Subwatershed	Remaining Net Water Availability (MGD)	Public Water Supply System(s) Reliant Upon the HUC14 Subwatershed (w/ PWSID)
02030103100050 Ramapo R (Crystal Lk br to BearSwamp Bk)	0.008999	0242001 Oakland Water Department
02030103100060 Crystal Lake/Pond Brook	0.009082	0220001 United Water NJ Franklin Lakes 0242001 Oakland Water Department
02030103100070 Ramapo R (below Crystal Lake bridge)	0.007896	0242001 Oakland Water Department

Final Build-Out Results

The build-out results for Oakland Borough are summarized in Table 4, based on land based capacity (potential developable land in both wastewater and septic system service areas), utility capacity and resource based capacity (Net Water Availability). These results are to be applied in Module 3 - Housing Element and Fair Share Plan toward the determination of affordable housing obligations. To assist in the evaluation of this information, an Excel file of the Module 2 database has been prepared by the Highlands Council for use in Module 3, where applicable. The Excel file is included on the Module 2 CD.

Table 4 – Municipa	l Build-Out Results With	n Resource and Utilit	y Constraints		
Preservation Area Planning Area To					
Residential units – Sewered	0	0	0		
Septic System Yield	0	16	16		
Total Residential Units	0	16	16		
Non-Residential Jobs – Sewered	0	0	0		

Figure 1: Municipal Build-out Report Septic System Yield by HUC14 and LUCM Zone * OAKLAND BOROUGH

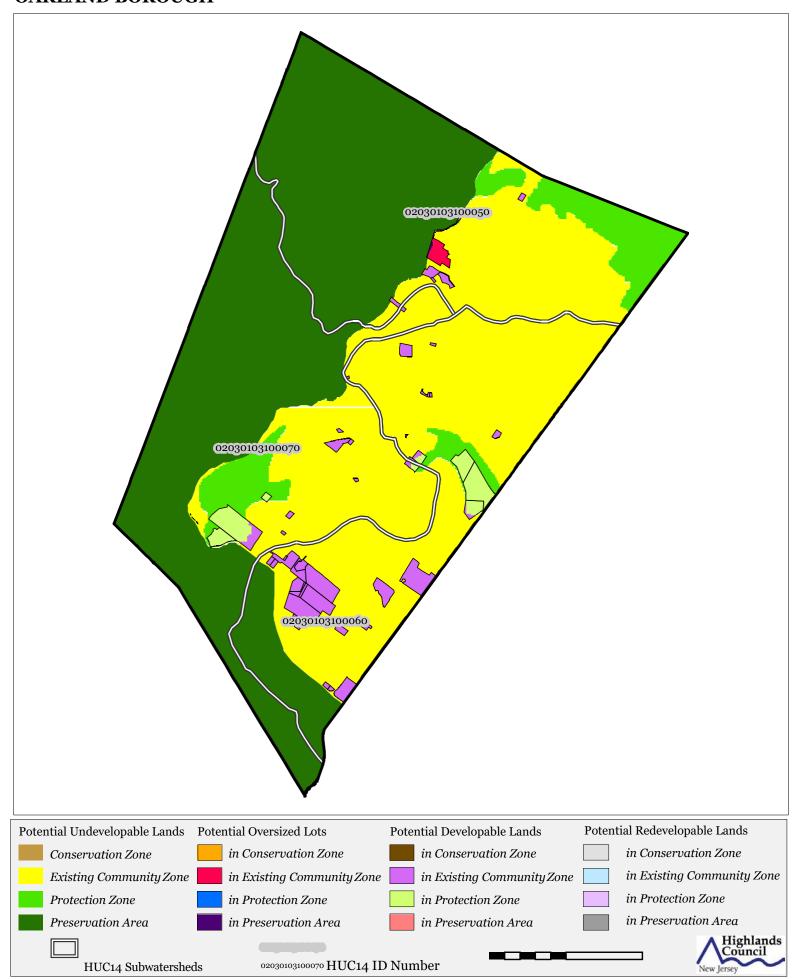
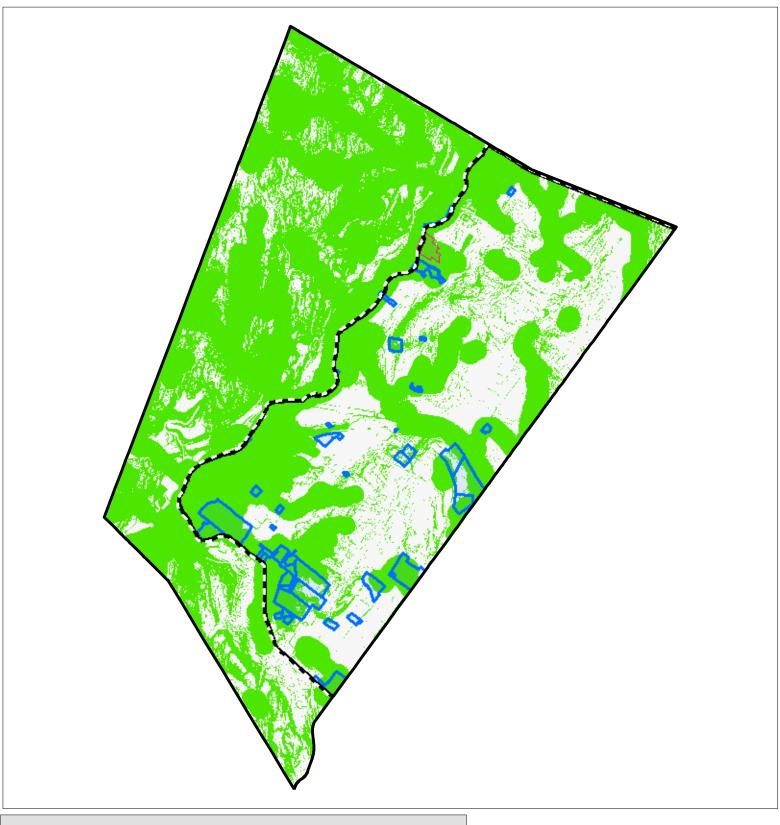
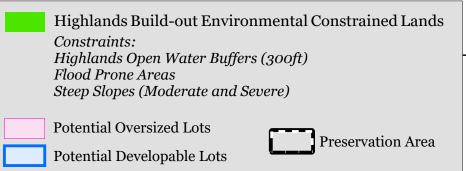


Figure 2: Municipal Build-out Report Environmental Constrained Lands






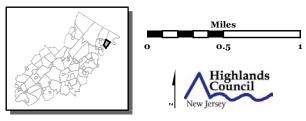


Figure 3: Municipal Build-out Report RMP HDSF Wastewater Utilities

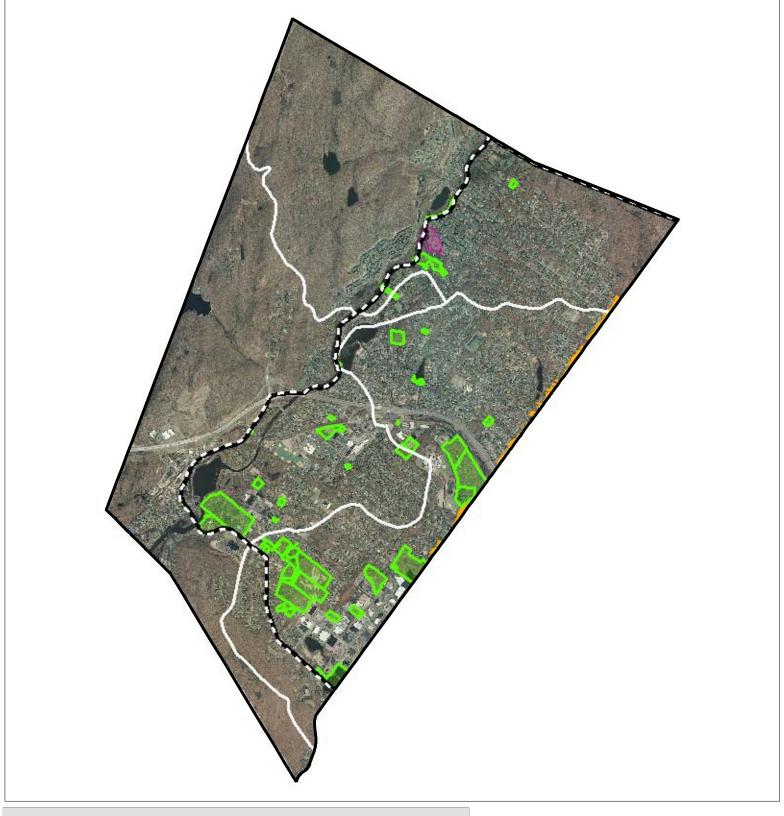

Highlands Domestic Sewerage Facilities "2008 RMP Existing Area Served"

NW Bergen County MUA

Pompton Lakes MUA


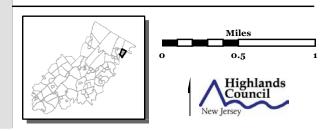


Figure 4: Municipal Build-out Report RMP Public Community Water System Utilities

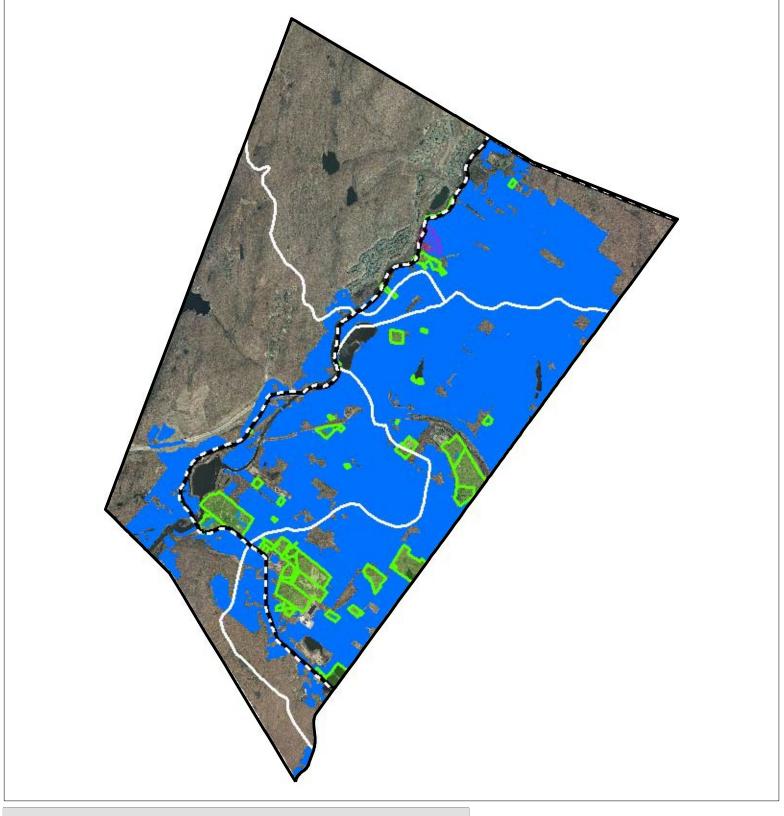

Public Community Water Systems "2008 RMP Existing Area Served"

OAKLAND WATER DEPARTMENT

HUC14 Subwatersheds

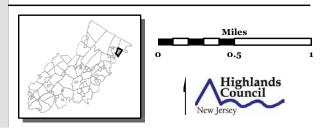


Figure 5: Municipal Build-out Report Final Build-out Results



Table 4 - Municipal	Build-out Results Wi	Table 4 - Municipal Build-out Results With Resource and Utility Constraints					
	Preservation Area Planning Area Totals						
Residential Units - Sewered	0	0	0				
Septic System Yield	0	16	16				
Total Residential Units	0	16	16				
Non-Residential Jobs - Sewered	0	0	0				

Preservation Area Boundary

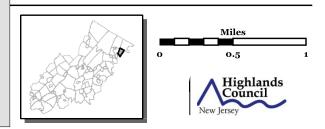


Table 1: RMP Municipal Capacity Conditions based on Module 2 Potential Developable Lands- OAKLAND BOROUGH

MUNICIPALITY	WASTEWATER UTILITY	Total Wastewater Generation (MGD) - Planning Area	Total Wastewater Generation (MGD) - Preservation Area	Municipal Assigned Percentage	Current Available Highlands Capacity (MGD)	Municipal Available Wastewater Capacity (MGD
OAKLAND BOROUGH	NJ0023698 / Pompton Lakes MUA / HDSF	0	0	<1%	0.094	NA
DAKLAND BOROUGH	NJ0024813 / NW Bergen County MUA / HDSF	0	0	<1%	0.691	0.001
OAKLAND BOROUGH	NJ0021253 / OAKLAND BOROUGH INDIAN HILLS HS / NON	0	0	100%	Non HDSF	Non HDSF
OAKLAND BOROUGH	NJ0021342 / Skyview/Hibrook OAKLAND TWP / NON HDSF	0	0	100%	Non HDSF	Non HDSF
OAKLAND BOROUGH	NJ0027774 / Oakwood Knolls Oakland Borough / NON HDSF	0	0	100%	Non HDSF	Non HDSF
OAKLAND BOROUGH	NJ0028002 / Mountain View STP Oakland Borough / NON	0	0	100%	Non HDSF	Non HDSF
DAKLAND BOROUGH	NJ0029858 / Oakland Care Center Oakland Borough / NON HDSF	0	0	100%	Non HDSF	Non HDSF
DAKLAND BOROUGH	NJ0030384 / Manito Elementary School Oakland Borough / NON HDSF	0	0	100%	Non HDSF	Non HDSF
OAKLAND BOROUGH	NJ0053112 / Chapel Hill Estates Oakland Borough WMP / NON HDSF	0	0	100%	Non HDSF	Non HDSF
OAKLAND BOROUGH	NJ0080811 / Oakland Twp Riverbend / NON HDSF	0	0	100%	Non HDSF	Non HDSF

RMP Build-Out POTABLE WATER UTILITY Existing Areas Served (EAS) Analysis						
MUNICIPALITY	WATER UTILITY	Total Water Demand (MGD) - Planning Area	Total Water Demand (MGD) - Preservation Area	Municipal Assigned Percentage	Water Utility Available Capacity (MGM)	Municipal Available Water Utility Capacity (MGM)
OAKLAND BOROUGH	242001 / OAKLAND WATER DEPARTMENT / Facility #61	0	0	98%	42.39	41.54

RMP Build-Out WASTEWATER UTILITY Existing Ar	eas Served (EAS) Analysis Build-out Impact Results				
MUNICIPALITY	WASTEWATER UTILITY	Residential Units	Nonresidential Square Feet	People	Jobs
OAKLAND BOROUGH	NJ0023698 / Pompton Lakes MUA / HDSF	0	0	0	0
OAKLAND BOROUGH	NJ0024813 / NW Bergen County MUA / HDSF	0	0	0	0
OAKLAND BOROUGH	NJ0021253 / OAKLAND BOROUGH INDIAN HILLS HS / NON	0	0	0	0
OAKLAND BOROUGH	NJ0021342 / Skyview/Hibrook OAKLAND TWP / NON HDSF	0	0	0	0
OAKLAND BOROUGH	NJ0027774 / Oakwood Knolls Oakland Borough / NON HDSF	0	0	0	0
OAKLAND BOROUGH	NJ0028002 / Mountain View STP Oakland Borough / NON	0	0	0	0
OAKLAND BOROUGH	NJ0029858 / Oakland Care Center Oakland Borough / NON HDSF	0	0	0	0
OAKLAND BOROUGH	NJ0030384 / Manito Elementary School Oakland Borough / NON HDSF	0	0	0	0
OAKLAND BOROUGH	NJ0053112 / Chapel Hill Estates Oakland Borough WMP / NON HDSF	0	0	0	0
OAKLAND BOROUGH	NJ0080811 / Oakland Twp Riverbend / NON HDSF	0	0	0	0

RMP Build-Out WATER UTILITY Existing Areas Served (EAS) Analysis Build-out Impact Results						
MUNICIPALITY	WATER UTILITY	Residential Units	Nonresidential Square Feet	People	Jobs	
OAKLAND BOROUGH	242001 / OAKLAND WATER DEPARTMENT / Facility #61	0	0	0	0	

RMP Build-Out Septic System Yield Analysis					
Planning Area					
MUNICIPALITY	HUC14	SUBWATERSHED NAME	PLAN CZ YIELD	PLAN ECZ YIELD	PLAN PZ YIELD
OAKLAND BOROUGH	02030103100050	Ramapo R (Crystal Lk br to BearSwamp Bk)	0	1	0
OAKLAND BOROUGH	02030103100060	Crystal Lake/Pond Brook	0	12	1
OAKLAND BOROUGH	02030103100070	Ramapo R (below Crystal Lake bridge)	0	1	1
		totals	0	14	

Preservation Area	
MUNICIPALITY	PRES YIELD
OAKLAND BOROUGH	0

IMP Build-Out Potential Developable Lands Analysis OTENTIAL DEVELOPABLE VACANT LOT SEPTIC SYSTEM ACRES							
MUNICIPALITY	CZ ACRES - PLANNING	ECZ ACRES - PLANNING	PZ ACRES - PLANNING	PRESERVATION ACRES			
OAKLAND BOROUGH	0	1	44 75				
POTENTIAL DEVELOPABLE OVERSIZED LOT SEPTIC SYSTI	EM ACRES						
MUNICIPALITY	CZ ACRES - PLANNING	ECZ ACRES - PLANNING	PZ ACRES - PLANNING	PRESERVATION ACRES			
OAKLAND BOROUGH	0		10 0				
POTENTIAL DEVELOPABLE WASTEWATER UTILITY ACRE	S						
MUNICIPALITY	PLANNING ACRES	PRESERVATION ACRES					
OAKLAND BOROUGH	0		0				
POTENTIAL DEVELOPABLE OVERSIZED LOT WASTEWATI	ER UTILITY ACRES						
MUNICIPALITY	PLANNING ACRES	PRESERVATION ACRES					
OAKLAND BOROUGH	0		0				

RMP Build -Out Environmentally Constrained Lands Ar	nalysis					
Potential Developable Lot Acres						
MUNICIPALITY	POTENTIAL FULL DEVELOPABLE ACRES - Planning Area	ENVIRONMENTAL CONSTRAINED ACRES - Planning Area	NET DEVELOPABLE ACRES - Planning Area	POTENTIAL FULL DEVELOPABLE ACRES - Preservation Area	ENVIRONMENTAL CONSTRAINED ACRES - Preservation Area	NET DEVELOPABLE ACRES - Preservation Area
OAKLAND BOROUGH	219	175	44	0	C) c
Potential Oversized Lot Acres						
		ENVIRONMENTAL CONSTRAINED ACRES - Planning	NET DEVELOPABLE ACRES -	POTENTIAL FULL DEVELOPABLE	ENVIRONMENTAL CONSTRAINED ACRES -	NET DEVELOPABLE ACRES -
MUNICIPALITY	POTENTIAL FULL DEVELOPABLE ACRES - Planning Area	Area	Planning Area	ACRES - Preservation Area	Preservation Area	Preservation Area
OAKLAND BOROUGH	10	11	1	. 0	C	C

Overview of Technical Method for Build-Out Analysis

Module 1 "Current Municipal Conditions and Build-Out Analysis" (results of which are incorporated into or modified as appropriate for this report) was based on municipal information regarding potential developable lands (including identification of preserved lands and fully developed lands) and areas currently served with public water supply and wastewater utilities. It also included the current capacity conditions of public water supply and wastewater utilities, and was evaluated for municipal Land Use Capability in accordance with the RMP. The information was initially prepared by the Highlands Council and has been edited and verified by the municipality as representing the best available information on existing potential developable lands, which include vacant, non-preserved lands, as well as partially-developed lands having potential for further development (i.e., over-sized parcels) or redevelopment. The Highlands Council performed a quality control assessment to ensure that the database was technically sufficient for the build-out process (see Appendix A – Module 1). The build-out capacity conditions represent the complete build out of potential developable lands in accordance with the RMP, assuming no constraints other than location within areas served by water supply or wastewater utilities or, for those lands not within a wastewater utility service area, the Septic System Yield based upon RMP Land Use Capability Zone Map policies (which incorporate the NJDEP Rules for the Preservation Area at N.J.A.C. 7:38-3.4). The Module 1 Summary Report was prepared by the Highlands Council and provided to the municipality, which further verified or corrected land availability and municipal zoning information in the report as the first step in Module

The build-out capacity conditions in Module 1 identified the available utility capacity (in units of flow) allocated to the municipality for associated Highlands Domestic Sewerage Facilities (HDSF), on-site wastewater facilities, and Public Community Water Supply Systems. The Highlands Council initially used available capacity information from the *Utility Capacity Technical Report (2008)*, which used 2003 data for wastewater utilities (comparing permitted flows to the rolling maximum three month daily average in million gallons per day, or MGD) and 2004 data for public water supply utilities (comparing permitted flows to the maximum monthly demand, in million gallons per month, or MGM). The available capacity estimates initially assumed that the capacity for regional utilities (i.e., serving more than one municipality) would be allocated on a first-come, first-served basis; available capacity was apportioned among the municipalities based on relative land availability in the service area municipalities. In the Module 1 process, municipalities and regional utilities were requested to provide both updated flow data and any available information on contracted flows for a municipality. Where such information was provided and verified, it was used to update both utility- wide and municipal available capacity estimates.

The build-out impacts analysis within RMP utility areas was performed by the Highlands Council using build-out environmental constraints, municipal zoning and various impact factors (e.g., water demand, sewerage demand, population, jobs) as identified in the *Highlands Regional Build-Out Technical Report* (2008) and listed in Appendix B of this report. This analysis was applied only within the RMP utility service areas, defined as the lands within a NJDEP approved utility service area that are also

located within the Existing Community Zone or Lake Community Sub-Zone (not including the Existing Community-Environmentally-Constrained Sub-Zone). Of these lands, only parcels with at least 1,400 square feet of land that is not environmentally constrained based on the RMP (i.e., steep slopes, flood prone areas and Highlands Open Water buffers) were evaluated for build out in RMP utility service areas. Potential developable lands that did not meet the criteria of the build-out RMP utility areas were evaluated as lands contributing to Septic System Yield.

In addition, the RMP Septic System Yield was calculated for the municipality. The build out for septic system areas in the Planning Area is based on the RMP Septic System Yield Analysis and does not incorporate or evaluate the effects of environmental constraints or municipal zoning. The build- out of septic system areas in the Preservation Area is based on the NJDEP Preservation Area Rules at N.J.A.C. 7:38-3.4, as required by the RMP. The total acreage of all vacant lands, the net acreage of over-sized parcels (i.e., the total lot size minus the acreage needed for one lot under the RMP) and redevelopable lands were used in the Septic System Yield analysis. In the Planning Area, the analysis used the nitrate target for the appropriate Land Use Capability Zone and the drought recharge value for the appropriate HUC14 subwatershed. In the Preservation Area, the analysis used the forested and non-forested lands at a parcel level. In keeping with RMP policies, preserved lands (including SADC, Green Acres, federal, State, county and local lands, and land trust properties and conservation easements where known) were excluded from this analysis. Environmentally constrained lands (i.e., steep slopes, flood prone areas and Highlands Open Water buffers) were included in the septic system yield analysis because the methodology assumes a mixture of constrained and unconstrained lands, but will affect how Septic System Yield is allocated in later stages of the Plan Conformance Process.

The information from Module 1 directly supported the Module 2 Land Use and Resource Capacity Analysis, results of which are incorporated into this report. In Module 2, the Highlands Council and the municipality evaluated the build-out impacts and the associated wastewater and water supply demands within the RMP utility areas as identified in Module 1.

In Module 2, municipalities reviewed the RMP build-out impacts for RMP utility areas and verified that they reflect densities allowed by existing municipal zoning. Areas included in the build-out process for sewer service included those lands within the wastewater Existing Area Served, as defined by the RMP, and also those lands within an NJDEP-approved Sewer Service Area that is also within the Lake Community Sub-Zone or the Existing Community Zone (excluding the Existing Community-Environmentally Constrained Sub-Zone). If the existing municipal zoning conditions have changed from the 2005 data used by the Highlands Council, then the municipality provided the current zoning and the Highlands Council revised the build-out impacts accordingly. The Highlands Council performed a quality control assessment to ensure that the database was technically sufficient for the build-out process (see Appendix A – Module 2).

When the land based build out of potential developable lands in Module 1 exceeded the available utility capacity conditions, further analysis by the Highlands Council was required in Module 2 to

determine the extent to which the build out was constrained by the lack of utility capacity. In such cases, the land-based build-out potential is lowered proportionately for residential and non-residential development within the service area. It is important to note that no change is made to the Existing Area Served for the utility; only the build-out potential is reduced.

Where utility capacity exceeded the land-based build out of potential developable lands in Module 1, the utility capacity is potentially available for future demands. The municipality will evaluate utility capacity assignment in Module 3 where appropriate to support affordable housing, and in support of later phases of Plan Conformance.

For some HUC14 subwatersheds in the municipality, the projected consumptive or depletive water demand based on both domestic wells sources (either as derived from Septic System Yield, which is assumed to be supplied by domestic wells, or within a RMP wastewater utility area served by domestic wells) and water supply utility service indicate that the complete municipal build out of potential developable lands might exceed the Net Water Availability. In such cases, the Highlands Council then calculated Net Water Availability values in Module 2 for use as a further constraint on growth, and determined the extent to which the Net Water Availability would reduce the build out. The Highlands Council also assessed the extent to which the use of remaining wastewater utility capacity (i.e., beyond full build-out), if any, would be constrained by Net Water Availability. This information can be used by the municipality to determine whether the wastewater utility capacity can reasonably be used for purposes consistent with the RMP (e.g., affordable housing projects, TDR receiving zones, Highlands Redevelopment Areas, redevelopment within the Existing Area Served) as provided for by Objective 2K3e. A decision as to the allocation of this capacity will occur in Module 3 regarding affordable housing needs identified in the Fair Share Plan, or later in the Plan Conformance process regarding other uses.

Appendix A: Technical Sufficiency Review

MODULE 1

The Module 1 Geodatabase (GDB) and utility capacity spreadsheet information submitted by the municipality were evaluated for technical sufficiency and quality assurance and quality control purposes by the Highlands Council staff. The Highlands Council reviewed the GDB (GDB#1 and GDB#2, with GDB#3, where relevant) to determine that all the changes that the municipality made to the GDB are technically sufficient in order to process for RMP Build-out. All revisions made to a GDB by the Highland Council are reflected in the NJHC_QA_QC_COMMENTS field of the GDB. The same Build-out QA/QC Review method is conducted for both GDB#1 and GDB#2. These results were reviewed by the municipality in Module 2 (see below). Any database issues that were not specifically responsive to the technical sufficiency review and not specific to the Module 1 Build-Out Analysis were flagged in the GDB by the Highlands Council for future reference.

When a municipality received GDB#3 (the updated public water utility database), the Council joined and updated the PWSID data from GDB#3 into GDB#1 so all the Module 1 information was in GDB#1 for build-out processing.

Before a GDB is processed for Build-out, the Highlands Council reviewed the material submitted by the municipality including cover letters and any email correspondence for additional information relevant to the build-out analysis. The Highlands Council utilizes Microsoft Access to process the GDB through the NJHC QA/QC review method to create a Technical Protocol Status (TPS) report that flags all parcels that have contradictory data, as well as a SDE check which identifies inserted, deleted and updated information in the GDB. The Highlands Council utilized the TPS Report and the GDB along with the supporting documentation to evaluate any contradictory data reported as Error Codes on the TPS Report.

The TPS report created by the Highlands Council identifies parcels that may contain contradictory data in the GDB and therefore not process correctly in the build-out. There are 11 Error Codes and 5 Data Conditions that may potentially be flagged by the Highlands Council within a GDB. The identification of an Error Code may or may not result in an edit by the Council. If an edit was required in order to technically correct the GDB for build-out processing, the edit was conducted by the Highlands Council and recorded in the GDB. The following is a list of the TPS Error Codes and Data Conditions that may be applicable to the municipality:

• Error Code 01: Municipal Verification Field Missing - every verifiable field and row should include the Module 1 verifier's name. If a row was blank, the NJHC QA/QC reviewer would populate the field with the verifier's name or consult with the municipality as required, and enter a comment in the NJHC_QA_QC_COMMENTS field in the GDB.

- Error Code 02: Parcels identified as both a Condo and Open Space the Highlands Council evaluated the parcel's development and land preservation status to determine if the necessary data fields were populated correctly by the municipality.
- Error Code 03: Parcels identified as both Developable and Open Space the Highlands Council evaluated the parcel's development status and land preservation status and determined if the necessary data fields were populated correctly by the municipality.
- Error Code 04: Parcels identified as Oversized or Redevelopable and missing the oversized or redevelopable acreage value the Highlands Council would either consult with the municipality in order to edit the data field or utilized the GDB information to determine the missing value.
- Error Code 05: Parcels identified as Oversized or Redevelopable that were also listed as Not Developable the Highlands Council evaluated the parcel and edited the PARC_STAT_DEV_STATUS data field accordingly.
- Error Code 06: Parcels identified as connected to a wastewater utility however no System Provider was identified the Highlands Council would consult with the municipality and/or review the GDB and supporting documentation in order to edit the missing entry.
- Error Code 07: Parcels identified as a "Yes" indicating they are currently both connected and not connected to a wastewater utility the Highlands Council edited Not Developable, oversized or redevelopable parcels in the wastewater no connect field to a "No." and if the parcel is vacant and developable then the Highlands Council edited the wastewater existing served field to a "No."
- Error Code 08: Parcels identified as being connected to a wastewater utility and also identified as vacant or developable the Highlands Council evaluated these parcels to see if they are developable, redevelopable or oversized and edited and documented accordingly in the GDB.
- Error Code 09: Parcels identified as connected to a public water utility however no System Provider was identified the Highlands Council would consult with the municipality and/or review the GDB and supporting documentation in order to edit the missing entry.
- Error Code 10: Parcels identified as a "Yes" indicating they are currently both connected and not connected to a public water utility the Highlands Council edited Not Developable, oversized or redevelopable parcels in the public water no connect field to a "No." and if the parcel is vacant and developable then the Highlands Council edited the public water existing served field to a "No."
- Error Code 11: Parcels identified as being connected to a public water utility and also identified as vacant or developable the Highlands Council evaluated these parcels to see if they are developable, redevelopable or oversized and edited and documented accordingly in the GDB.

- Data Condition 1: Parcels identified as Not Developable due to Environmental Constraints or Inadequate Lot Geometry these parcels were evaluated in septic served areas to ensure that the environmentally constrained parcels in the GDB were not a water body and therefore not appropriate for inclusion in the RMP Septic System Area analysis. Otherwise, vacant parcels indicated to be "Not Developable" due to environmentally constrained lands were included in the Septic System Yield analysis. Parcels that were identified as an inadequate lot geometry but developable with an adjacent parcel may require further review by the municipality to ensure that the build-out process was applied correctly because the Highlands Council is not able to discern the adjacent parcel record that is in common ownership and referenced by the municipality.
- Data Condition 2: Parcels identified as having a WW Utility with a Contractual Allocation were flagged in the TPS Report.
- Data Condition 3: Parcels identified for PW Utility with a Contractual Allocation were flagged in the TPS Report.
- Data Condition 4: Parcels containing entries as "OTHER" with associated comments were reviewed to see if the proper data field associated with the comment had been completed correctly and to assist in the review of the GDB information.
- Data Condition 5: Parcels with entries in any of the "Comment" data fields- the Council reviewed this information as a means to assist in GDB technical evaluation and QA/QC review.

In addition to going through the TPS Report as described above, the Council evaluated all open space parcels to ensure they are technically correct in the GDB. The Council also reviewed parcels that have no provider listed for public water or wastewater to ensure that there are no "Yes" data fields in the utility connection status data field, as these parcels are on septic/domestic wells and not relevant regarding a utility connection status in the GDB. Lastly, the Council QA/QC reviewer initialed and dated the GDB to complete the TPS Report and QA/QC Review process.

The municipality then received a modified GDB that:

- 1. incorporated the results of all edits by the Highlands Council;
- 2. merged the final results of GDB's #1 and, where applicable, #2 and #3 into a single GDB;
- 3. identified the parcels that were processed for build out as potential developable vacant, redevelopable and over-sized lots in both septic system and sewer areas; and
- 4. incorporated additional fields used by the Highlands Council in running the build-out process, including municipal zoning for potential developable vacant and redevelopable parcels associated with sewer service conforming with RMP requirements, and having at least 1,400 square feet of land that is not environmentally constrained. Where such parcels were associated with public water supply service, they were also evaluated for water demands.

The Municipal Conditions Geodatabase may include in some cases duplicate parcel records within the municipality. These duplicates derive from the process of creating a spatial representation of parcels in GIS. The Highlands Council has taken the necessary steps to avoid double counting of developable duplicate parcels, in the summary reports and in the geodatabase and any derivatives thereof.

MODULE 2

In Module 2, the municipality completed a final check on parcel information and verified the municipal zoning applicable to parcels that were processed for build out in RMP utility areas. Where edits were made and returned to the Highlands Council, the Council incorporated the edits and, where necessary, performed a revised build-out analysis, the results of which are reflected in this report.

Please note that the Type A and Type B edits conducted by the municipality were reviewed by the Highlands Council and only when an edit was relevant to the RMP Build-out analysis was it incorporated and re-processed for build-out analysis as required.

Type A Edits – Tabular

- The information will be updated in the GDB as indicated.
- The nature and extent of the information may or may not affect the build-out results.
- Type A tabular edits that require a revised build-out will be processed and reported as a Module 2 Municipal Build-out Summary Report.

Type A Edits – Spatial

- The revised spatial information will be reviewed in accordance with the Module 1Technical Review Protocols.
- Type A spatial edits that require a revised build-out will be processed and reported as a Module 2 Municipal Build-out Summary Report.

Type B Edits – Municipal Zoning

- The information will be updated in the GDB as indicated.
- Updated zoning changes only affect parcels in RMP utility areas.
- Type B edits that require a revised build-out will be processed and reported as a Module 2 Municipal Build-out Summary Report.

Appendix B – Highlands Module 2 Build-Out Model Impact Factors

Highlands Zone Type	Comparison Zone/Unit Type	Source	Region	Density Dwelling unit (du)/acre *	Efficiency Factor % (1)	Average Household Size (2)	Average School Children in Household (2)	Percent Impervious (3)	Consumptive/Depletive Water Use includes Indoor demand (gpd per person) plus outdoor demand as (gpd per unit) multiplied by Consumptive/Depletive Use Coefficient (4)	Public Water System Demand (5)	Public Wastewater System Generation (6)
SF Estate Residential or (PA-5)				0.05 to 0.20 (0.17 maximum)	95			0.075* acres	(75 gpd/person + 50 gpd/unit) * Consumptive/Depletive Coefficient	100 gallons per person per day	75 gallons per person per day
	Single-family Detached 4-5 BR	Statewide NJ Demographic	Northern ¹			3.809	1.072				
	Single-family Detached 4-5 BR	Multipliers (2)	Central ²			3.780	1.094				
SF Rural Residential, Resource Residential, or (PA-4B)				0.21 to 0.5 du/acre (0.17 maximum)	95			0.075* acres	(75 gpd/person + 50 gpd/unit) * Consumptive/Depletive Coefficient	100 gallons per person per day	75 gallons per person per day
	Single-family Detached 4-5 BR	Statewide NJ Demographic	Northern ¹			3.809	1.072				
	Single-family Detached 4-5 BR	Multipliers (2)	Central ²			3.780	1.094				
SF Low Density or (PA-4)				0.51 to 1.0 du/acre (1.16 maximum)	80			0.075* acres	(75 gpd/person + 50 gpd/unit) * Consumptive/Depletive Coefficient	100 gallons per person per day	75 gallons per person per day
	Single-family Detached 4-5 BR	Statewide NJ Demographic	Northern ¹			3.809	1.072				
	Single-family Detached 4-5 BR	Multipliers (2)	Central ²			3.780	1.094				
SF Medium Density, Suburban Residential, or (PA-3)				1.01 to 3.0 du/acre (3.81 minimum)	75			26.7	(75 gpd/person + 30 gpd/unit) * Consumptive/Depletive Coefficient	gallons per person per day	75 gallons per person per day
	Single-Family Detached, 2-3 BR	Statewide NJ Demographic	Northern ¹			3.137	0.607				
	Single-Family Detached, 2-3 BR	Multipliers (2)	Central ²			2.578	0.367				
SF High Density or (PA-2)				3.01 to 8.0 du/acre (7.04 minimum)	75			33.7	(75 gpd/person + 5 gpd/unit) * Consumptive/Depletive Coefficient	75 gallons per person per day	75 gallons per person per day
	Single-Family Attached, 2-3 BR	Statewide NJ Demographic	Northern ¹			2.477	0.296				
	Single-Family Attached, 2-3 BR	Multipliers (2)	Central ²			2.296	0.292				
Attached/Townhouse or (PA-1)				8.01 to 16.0 du/acre (9.78 minimum)	75			45.7	(75 gpd/person + 5 gpd/unit) * Consumptive/Depletive Coefficient	75 gallons per person per day	75 gallons per person per day

Appendix B – Highlands Module 2 Build-Out Model Impact Factors

Highlands Zone Type	Comparison Zone/Unit Type	Source	Region	Density Dwelling unit (du)/acre *	Efficiency Factor % (1)	Average Household Size (2)	Average School Children in Household (2)	Percent Impervious (3)	Consumptive/Depletive Water Use includes Indoor demand (gpd per person) plus outdoor demand as (gpd per unit) multiplied by Consumptive/Depletive Use Coefficient (4)	Public Water System Demand (5)	Public Wastewater System Generation (6)
	Single-Family Attached, 2-3 BR	Statewide NJ Demographic Multipliers (2)	Northern ¹			2.477	0.296				
	Single-Family Attached, 2-3 BR		Central ²			2.296	0.292				
Garden Apartment or (PA-1)				16.01+ du/acre (9.78 minimum)	70			57.1	(75 gpd/person + 5 gpd/unit) * Consumptive/Depletive Coefficient	75 gallons per person per day	75 gallons per person per day
	5+ Units (Own/Rent), 2-3 BR	Statewide NJ Demographic	Northern ¹			2.262	0.308				
	5+ Units (Own/Rent), 2-3 BR	Multipliers (2)	Central ²			2.342	0.373				
Mixed use/Age Restricted Housing (percent mix based on 40% residential and 60% non-residential as Office/Commercial)		Municipal Zoning		Apply zone density and FAR value Note: Use Retail/Commercial Impact factors for non-res %	70	Varies Based on zoning Du/Acre description	0.00	68.8	(75 gpd/person + 5 gpd/unit) * Consumptive/Depletive Coefficient	75 gallons per person per day	75 gallons per person per day
Mixed use (percent mix based on 40% residential and 60% non-residential as Office/Commercial)		Municipal Zoning		Apply zone density and FAR value Note: Use Retail/Commercial Impact factors for non-res %	70	Varies Based on zoning Du/Acre description	Varies Based on zoning Du/Acre description	42.0	(75 gpd/person + 5 gpd/unit) * Consumptive/Depletive Coefficient	75 gallons per person per day	75 gallons per person per day
Senior or Age restricted Housing		Municipal Zoning		Varies Based on zoning Du/Acre description	70	Varies Based on zoning Du/Acre description	0.00	60.3	(75 gpd/person + 5 gpd/unit) * Consumptive/Depletive Coefficient	75 gallons per person per day	75 gallons per person per day

Highlands Build-Out Residential Impact Factors – Sources

^{*} Residential dwelling units generated by the build-out model include both market rate and affordable units.

⁽¹⁾ Source: Efficiencies are given as a percentage, between 0 and 100, where a 100 value means complete efficiency (no land lost to development), and a 0 value means no buildings will be estimated for that land use. For example an efficiency of 70% may be representative of developable land that has a 10% set aside for parks and 20% for roads (100% - 10% - 20% = 70%). Project determined values.

⁽²⁾ Source: Who Lives in New Jersey Housing? New Jersey Demographic Multipliers, The Profile of Occupants of Residential and nonresidential Development. Listokin, D., Voicu, I., Dolphin, W., Camp, M. Center for Urban Policy Research. Rutgers University. November 2006. Northern NJ values were applied to Bergen, Morris, Passaic, Sussex and Warren County municipalities. Central NJ values were applied to Hunterdon and Somerset County municipalities.

1 Table II-C-1 North Region of New Jersey Total Persons and Persons by Age (2000) (p. 99)

⁽³⁾ Source: NCNBR, Rutgers University, April 27, 2006. The impervious surface area for new dwelling units large lot zoned areas (*) is based on an average 15% impervious surface value (per NJDEP LU/LC) and a project determined average homestead area of 0.50 acres. No impact value is attached to the remaining undeveloped area. The impact percentage factors for the other residential composite zones represent weighted averages of NJ Highlands Percent Impervious Surface for all residentially developed lands in that composite zone. The raw data was obtained by overlaying NJ Highlands Zoning and DEP 2002 LU/LC spatial data files, and extracting the calculated percent impervious surface area attached to each LU/LC residential developed land polygon and the acres of associated developed land in each intersecting municipal zone polygon. The impervious surface areas in each municipal zone within the composite zone were aggregated and then divided by the total developed residential land area, to produce a weighted IS average for each composite zone.

⁽⁴⁾ Source: Center for Urban Policy Research (CUPR), September 2000. NJGS Consumptive Use Coefficients. For consumptive uses, a factor of 29% is utilized. For depletive uses, a factor of 100% is used

⁽⁵⁾ Source: NJDEP N.J.A.C. 7:10 Safe Drinking Water Act Regulations Adopted November 4, 2004, 7:10-12.6 Water Volume Requirements and State Plan Impact Assessment


⁽⁶⁾ Source: NJDEP N.J.A.C. 7:14A-23.3 Pollutant Discharge Elimination System: Technical Requirements For TWA Applications; Projected flow criteria


Appendix B – Highlands Module 2 Build-Out Model Impact Factors

Highlands Composite Zone Type	Floor Area Ratio	Efficiency Factor %(1)	Region	Jobs per 1,000 sf (2)	Percent Impervious (3)	Consumptive/Depletive Water Use multiplied by Consumptive/Depletive Use Coefficient (4)	Public Water System Demand (5)	Public Wastewater System Generation (6)
Office/Commercial	Based on zoning	80	Northeast US	2.99	78.3	0.125 gpd/sf * Consumptive/Depletive Coefficient	0.125 gallons/day/sf	0.10 gallons/day/sf
Retail	Based on zoning	80	Northeast US	1.63	72.5	0.125 gpd/sf * Consumptive/Depletive Coefficient	0.125 gallons/day/sf	0.10 gallons/day/sf
Industrial	Based on zoning	80	Northeast US	1.11	53.4	25 gpd/person * Consumptive/Depletive Coefficient	25 gallons per person per day	25 gallons per person per day

Highlands Build-Out Non-Residential Impact Factors – Sources

- (1) Source: Efficiencies are given as a percentage, between 0 and 100, where a 100 value means complete efficiency (no land lost to development), and a 0 value means no buildings will be estimated for that land use. For example an efficiency of 70% may be representative of developable land that has a 10% set aside for parks and 20% for roads (100% 10% 20% = 70%). Project determined values.
- (2) Source: Who Lives in New Jersey Housing? New Jersey Demographic Multipliers, The Profile of Occupants of Residential and nonresidential Development. Listokin, D., Voicu, I., Dolphin, W., Camp, M. Center for Urban Policy Research. Rutgers University. November 2006.
- a Table II-I-3 Commercial Office Employees per 1,000 Square Feet of Gross Floor Area (GFA) (p. 136) (Reported Northeast mean value).
- b Table II-I-4 Commercial Retail Employees per 1,000 Square Feet of Gross Floor Area (GFA) (p. 139)
- (Value derived by averaging the mean number of employees per 1,000 sq. ft. of GFA for retail (excluding mall), retail (enclosed mall), and retail (strip shopping mall) space in the Northeast).
- c Table II-I-6 Industrial Warehouses Employees per 1,000 Square Feet of Gross Floor Area (GFA) (p. 143)
- (Value derived by averaging the mean number of employees per 1,000 sq. ft. of GFA for Non-Refrigerated and Refrigerated space in the Northeast).
- (3) Source: NCNBR, Rutgers University, April 27, 2006. The impervious surface area for new dwelling units large lot zoned areas (*) is based on an average 15% impervious surface value (per NJDEP LU/LC) and a project determined average homestead area of 0.50 acres. No impact value is attached to the remaining undeveloped area. The impact percentage factors for the other residential composite zones represent weighted averages of NJ Highlands Percent Impervious Surface for all residentially developed lands in that composite zone. The raw data was obtained by overlaying NJ Highlands Zoning and DEP 2002 LU/LC spatial data files, and extracting the calculated percent impervious surface area attached to each LU/LC residential developed land polygon and the acres of associated developed land in each intersecting municipal zone polygon. The impervious surface areas in each municipal zone within the composite zone were aggregated and then divided by the total developed residential land area, to produce a weighted IS average for each composite zone.
- (4) Source: Center for Urban Policy Research (CUPR), September 2000. NJGS Consumptive Use Coefficients. For consumptive uses, a factor of 29% is utilized. For depletive uses, a factor of 100% is used
- (5) Source: NJDEP N.J.A.C. 7:10 Safe Drinking Water Act Regulations Adopted November 4, 2004, 7:10-12.6 Water Volume Requirements and State Plan Impact Assessment
- (6) Source: NJDEP N.J.A.C. 7:14A-23.3 Pollutant Discharge Elimination System: Technical Requirements For TWA Applications: Projected flow criteria



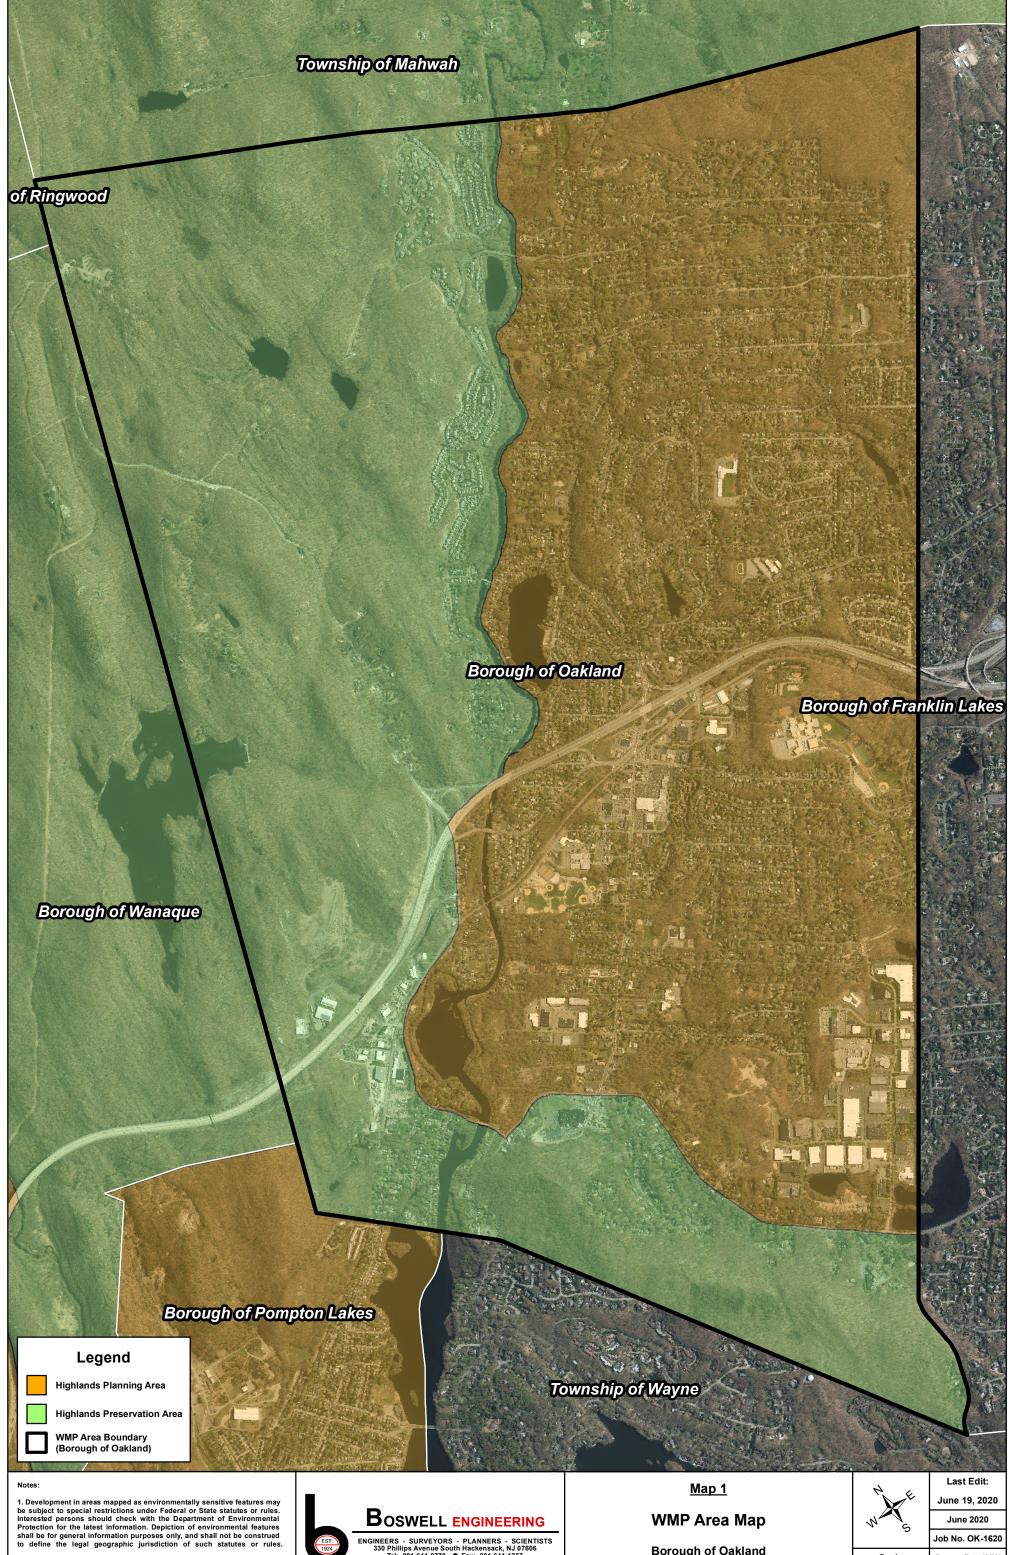


2. The aerial base map was prepared using the 2015 New Jersey High Resolution Orthoimagery from the New Jersey Information Warehouse.

ENGINEERS - SURVEYORS - PLANNERS - SCIENTISTS 330 Phillips Avenue South Hackensack, NJ 07606 Tel: 201-641-0770 • Fax: 201-641-1757 N.J. Certificate of Authorization No. 24GA27958000

Borough of Oakland

Bergen County New Jersey Drawn By: JMW

Check By: GD 1 in = 1,600 ft

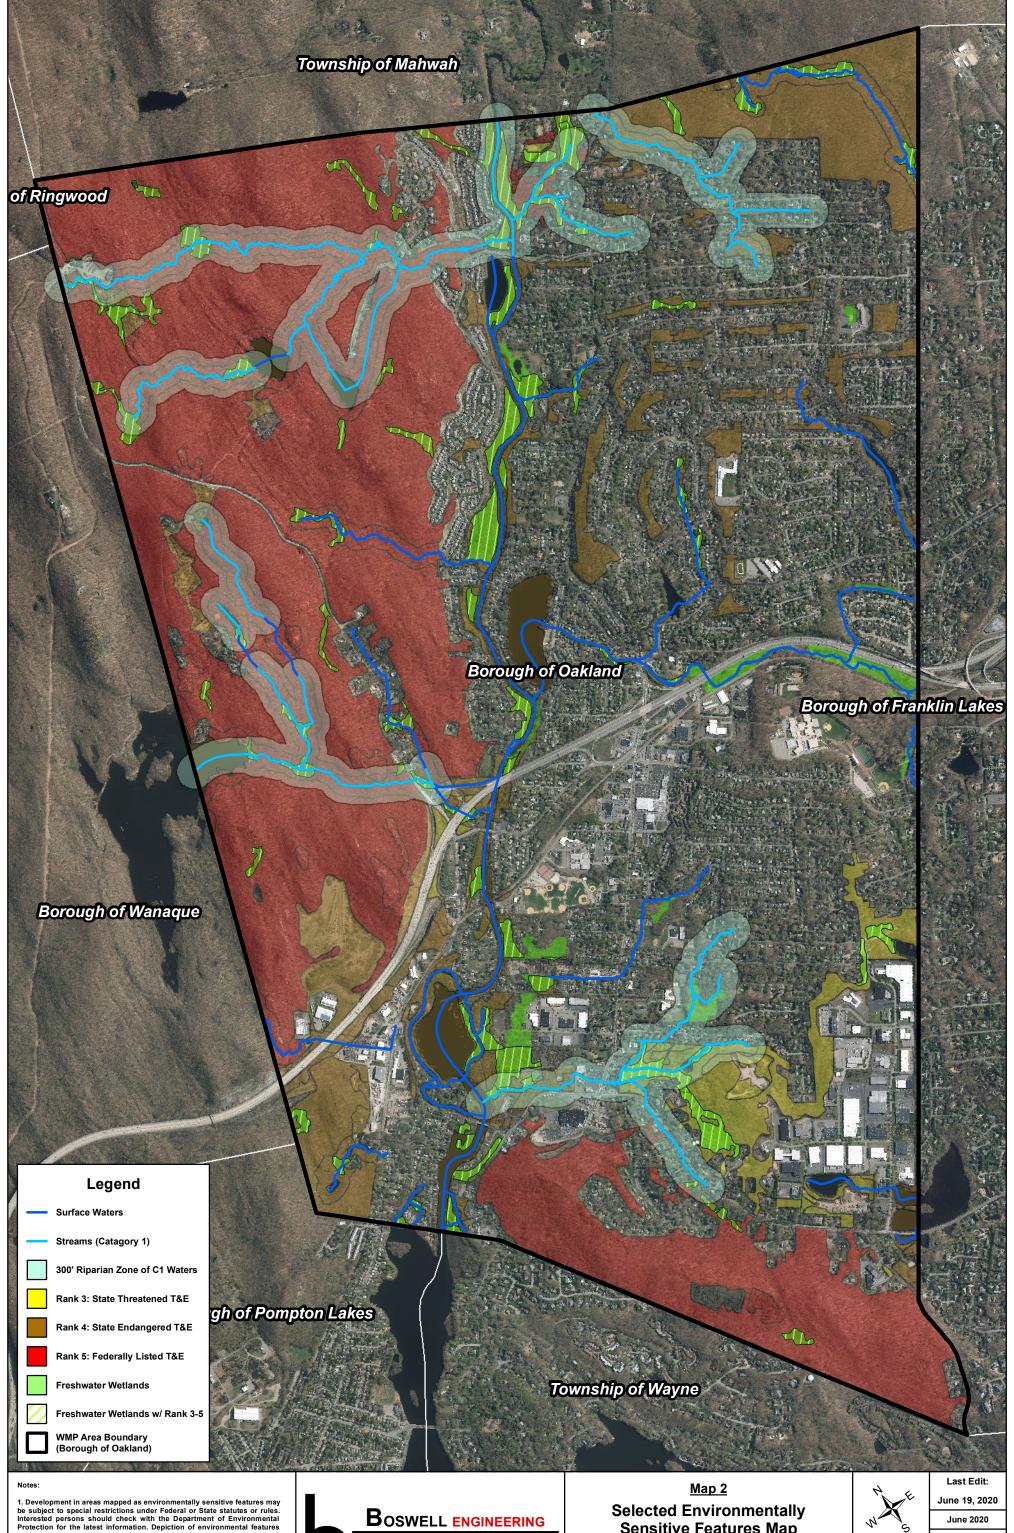

2. The aerial base map was prepared using the 2015 New Jersey High Resolution Orthoimagery from the New Jersey Information Warehouse.



ENGINEERS - SURVEYORS - PLANNERS - SCIENTISTS 330 Phillips Avenue South Hackensack, NJ 07606 Tel: 201-841-1757 N.J. Certificate of Authorization No. 24GA27958000

Sensitive Features Map

Borough of Oakland


Bergen County New Jersey



Job No. OK-1620

1 in = 1,600 ft

Drawn By: JMW Check By: GD

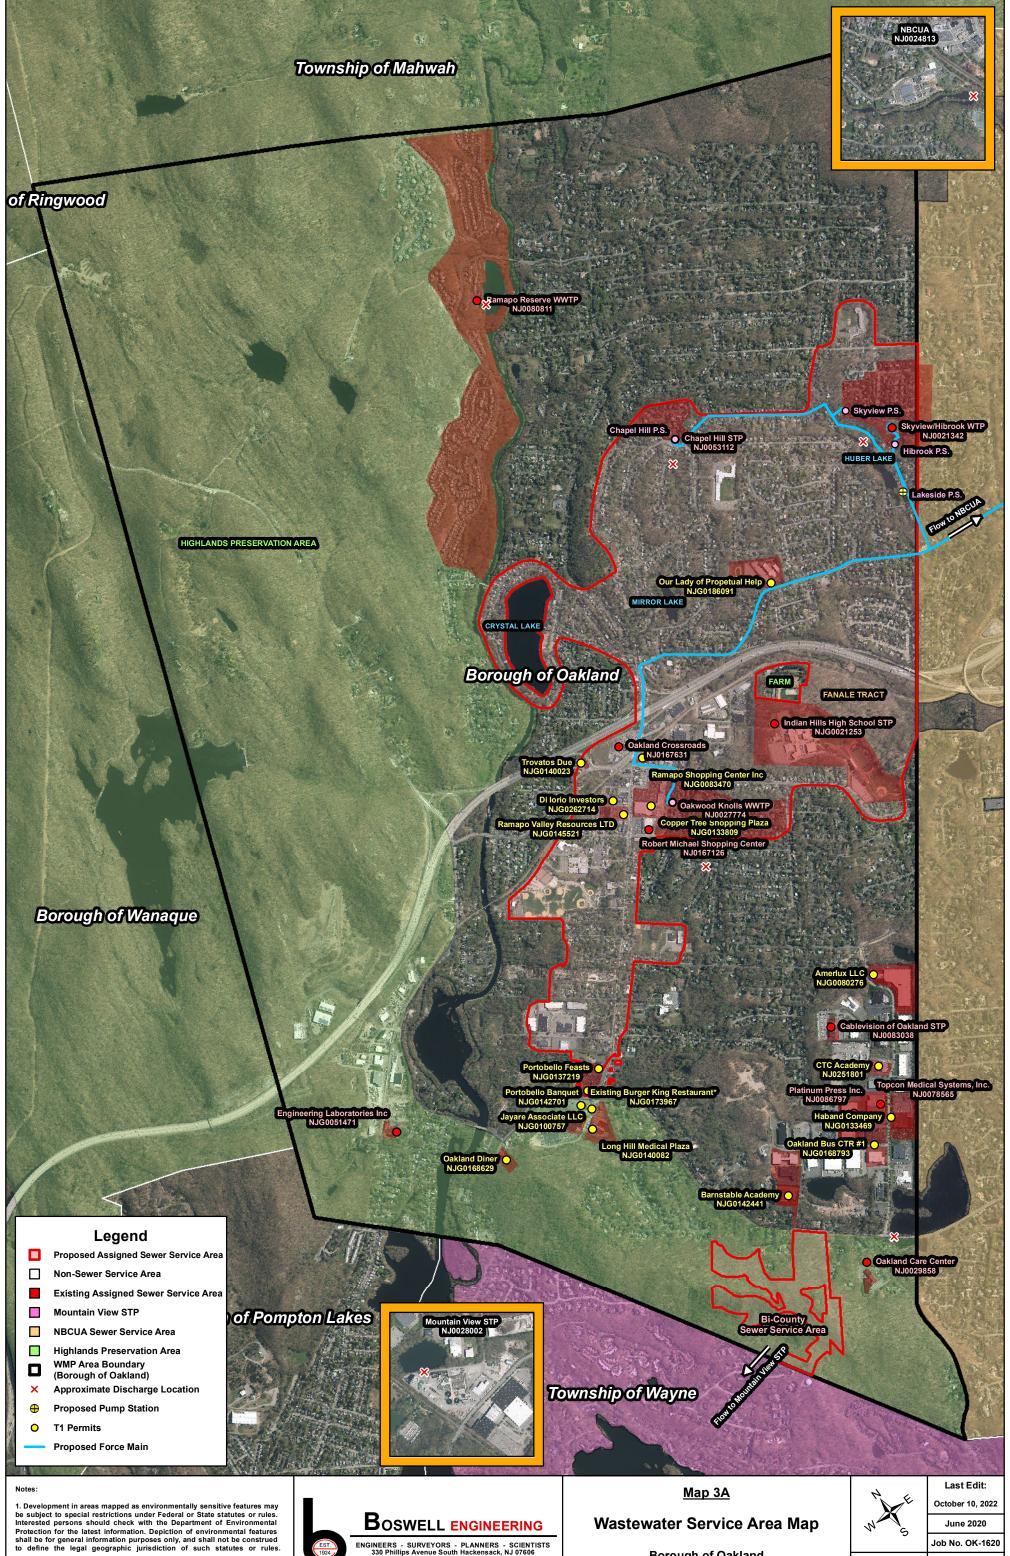


2. The aerial base map was prepared using the 2015 New Jersey High Resolution Orthoimagery from the New Jersey Information Warehouse.

ENGINEERS - SURVEYORS - PLANNERS - SCIENTISTS 330 Phillips Avenue South Hackensack, NJ 07606 Tel: 201-641-7770 • Fax: 201-641-7757 N.J. Certificate of Authorization No. 24GA27958000

Borough of Oakland

Bergen County New Jersey Drawn By: JMW

1 in = 1,600 ft Check By: GD

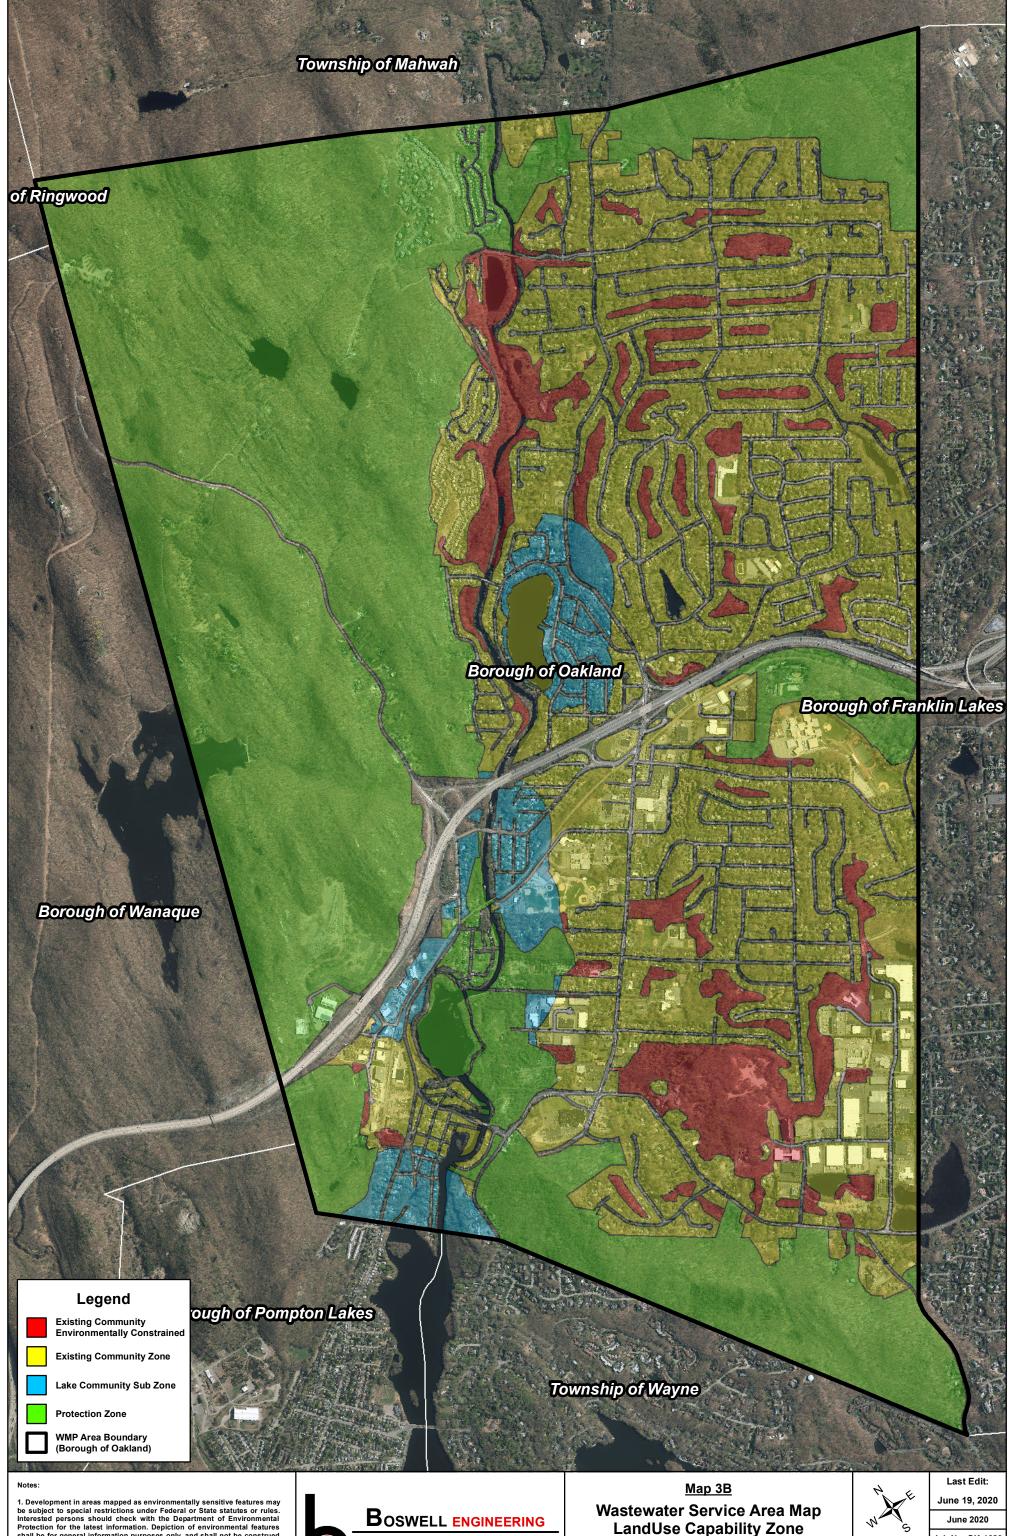

2. The aerial base map was prepared using the 2015 New Jersey High Resolution Orthoimagery from the New Jersey Information Warehouse.



ENGINEERS - SURVEYORS - PLANNERS - SCIENTISTS 330 Phillips Avenue South Hackensack, NJ 07606 Tel: 201-841-1757 N.J. Certificate of Authorization No. 24GA27958000


LandUse Capability Zone

Borough of Oakland

Bergen County New Jersey

Job No. OK-1620

Drawn By: JMW Check By: GD 1 in = 1,600 ft

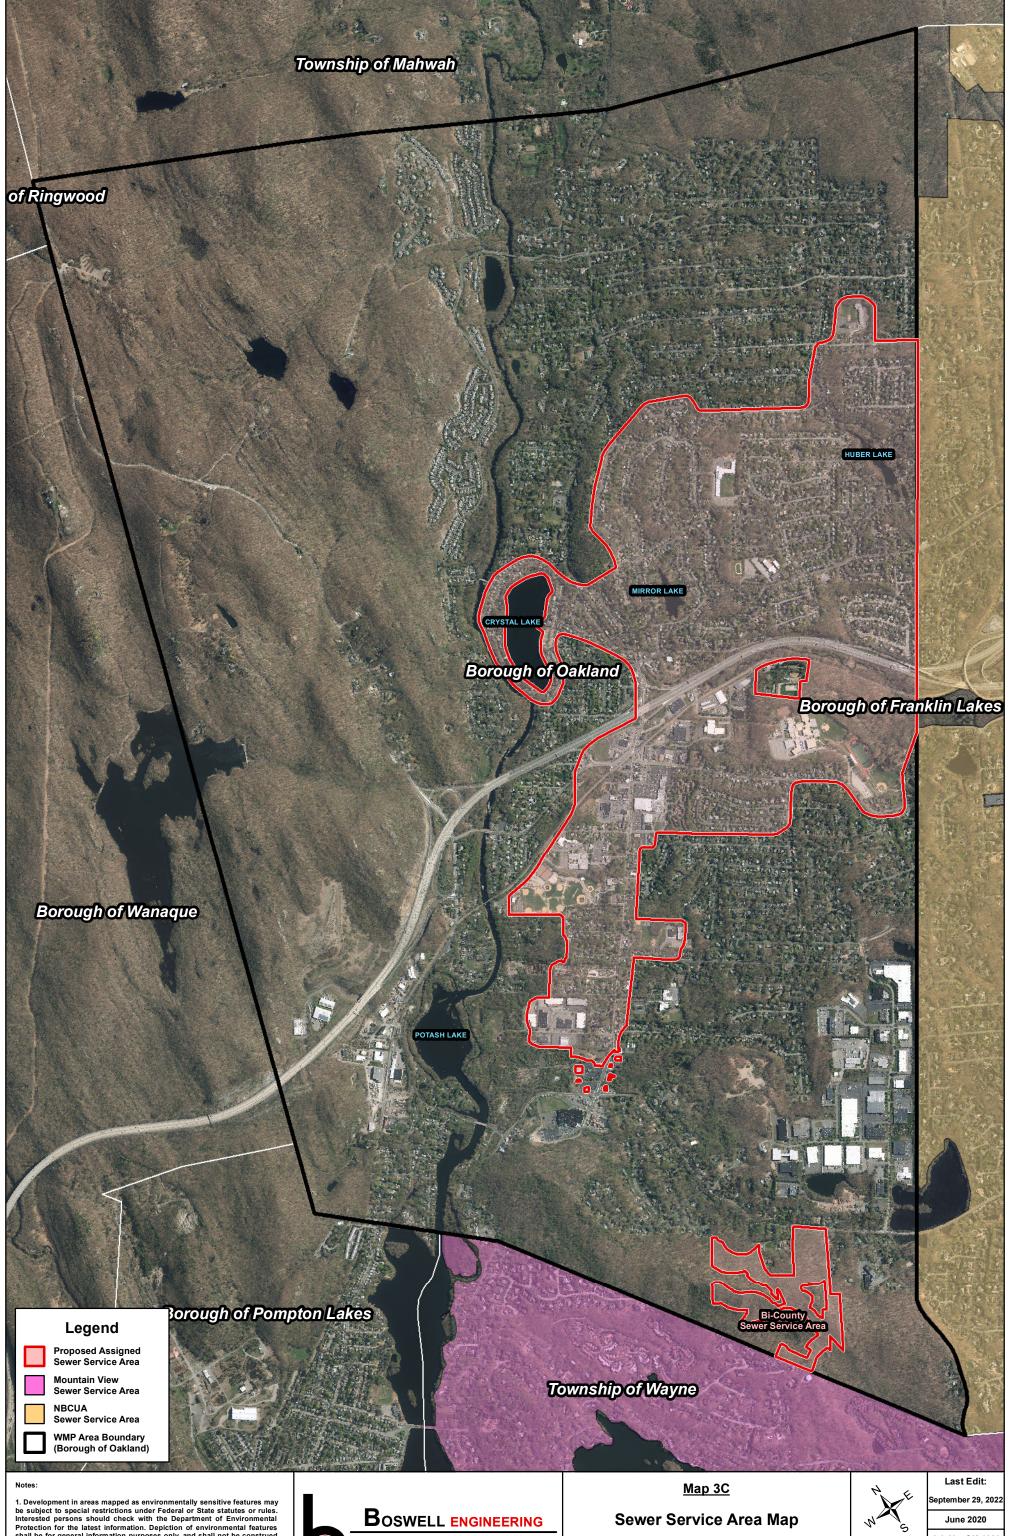

2. The aerial base map was prepared using the 2015 New Jersey High Resolution Orthoimagery from the New Jersey Information Warehouse.

ENGINEERS - SURVEYORS - PLANNERS - SCIENTISTS 330 Phillips Avenue South Hackensack, NJ 07606 Tel: 201-641-7770 • Fax: 201-641-7757 N.J. Certificate of Authorization No. 24GA27958000


Borough of Oakland

Bergen County New Jersey



Job No. OK-1620 Drawn By: JMW

Check By: GD 1 in = 1,600 ft

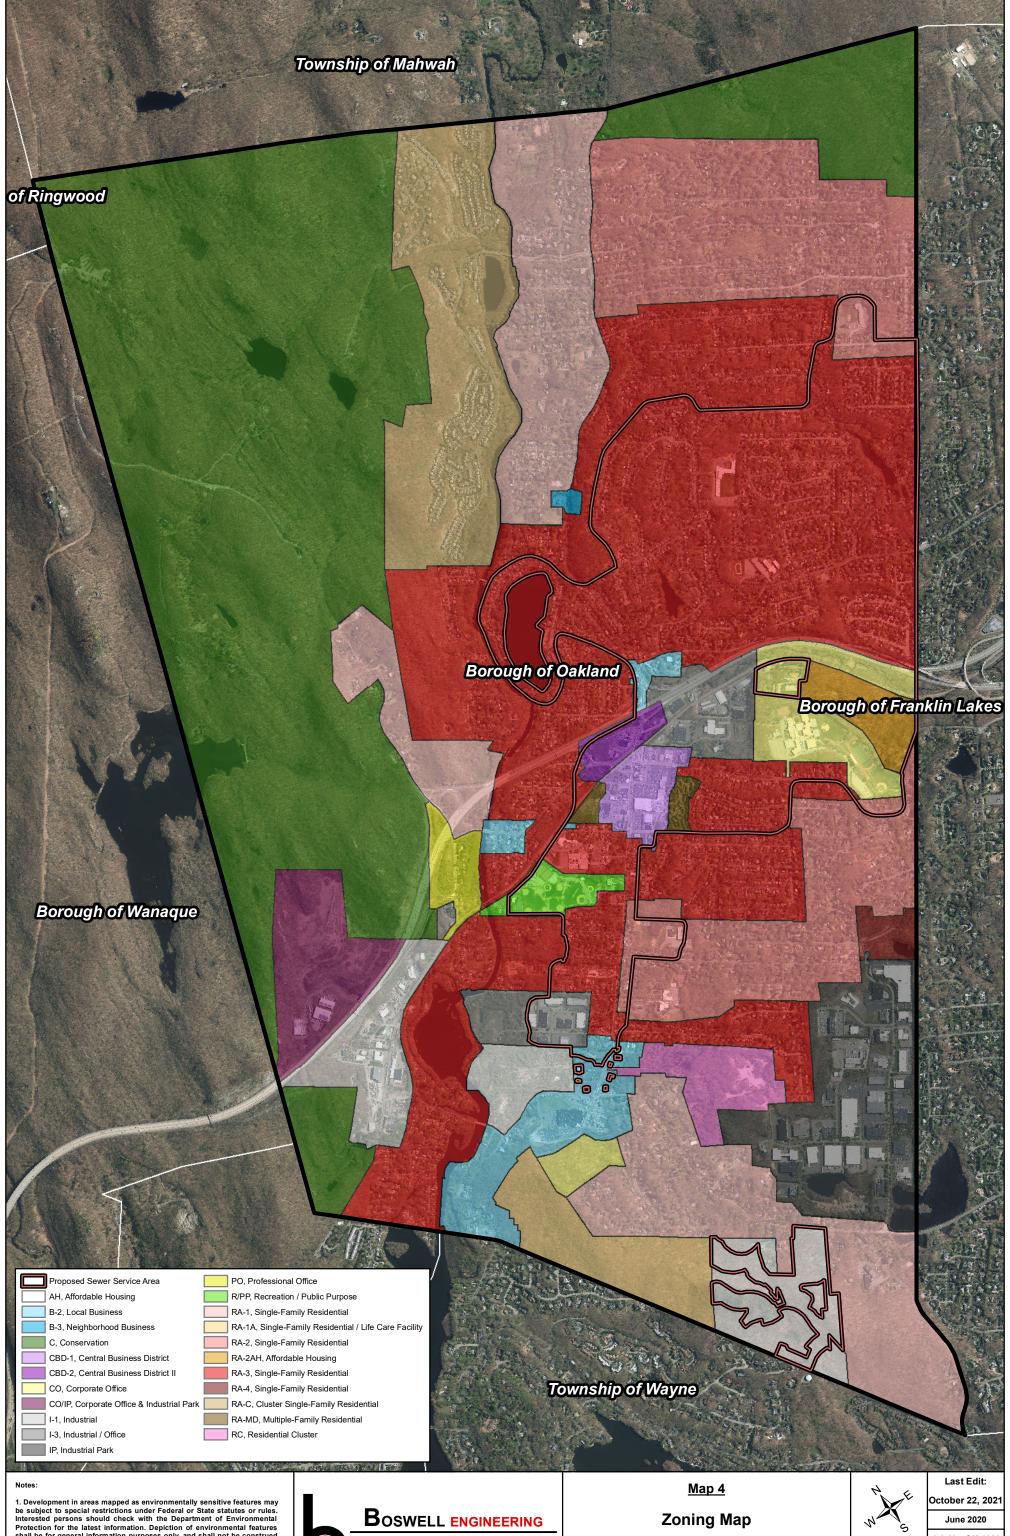

2. The aerial base map was prepared using the 2015 New Jersey High Resolution Orthoimagery from the New Jersey Information Warehouse.



ENGINEERS - SURVEYORS - PLANNERS - SCIENTISTS 330 Phillips Avenue South Hackensack, NJ 07606 Tel: 201-641-0770 • Fax: 201-641-1757 N.J. Certificate of Authorization No. 24GA27958000

Borough of Oakland

Bergen County New Jersey



1 in = 1,600 ft

Job No. OK-1620

Drawn By: JMW Check By: GD



2. The aerial base map was prepared using the 2015 New Jersey High Resolution Orthoimagery from the New Jersey Information Warehouse.




ENGINEERS - SURVEYORS - PLANNERS - SCIENTISTS 330 Phillips Avenue South Hackensack, NJ 07606 Tel: 201-641-0770 • Fax: 201-641-1757 N.J. Certificate of Authorization No. 24GA27958000

Borough of Oakland

Bergen County New Jersey Job No. OK-1620

Drawn By: JMW Check By: GD 1 in = 1,600 ft

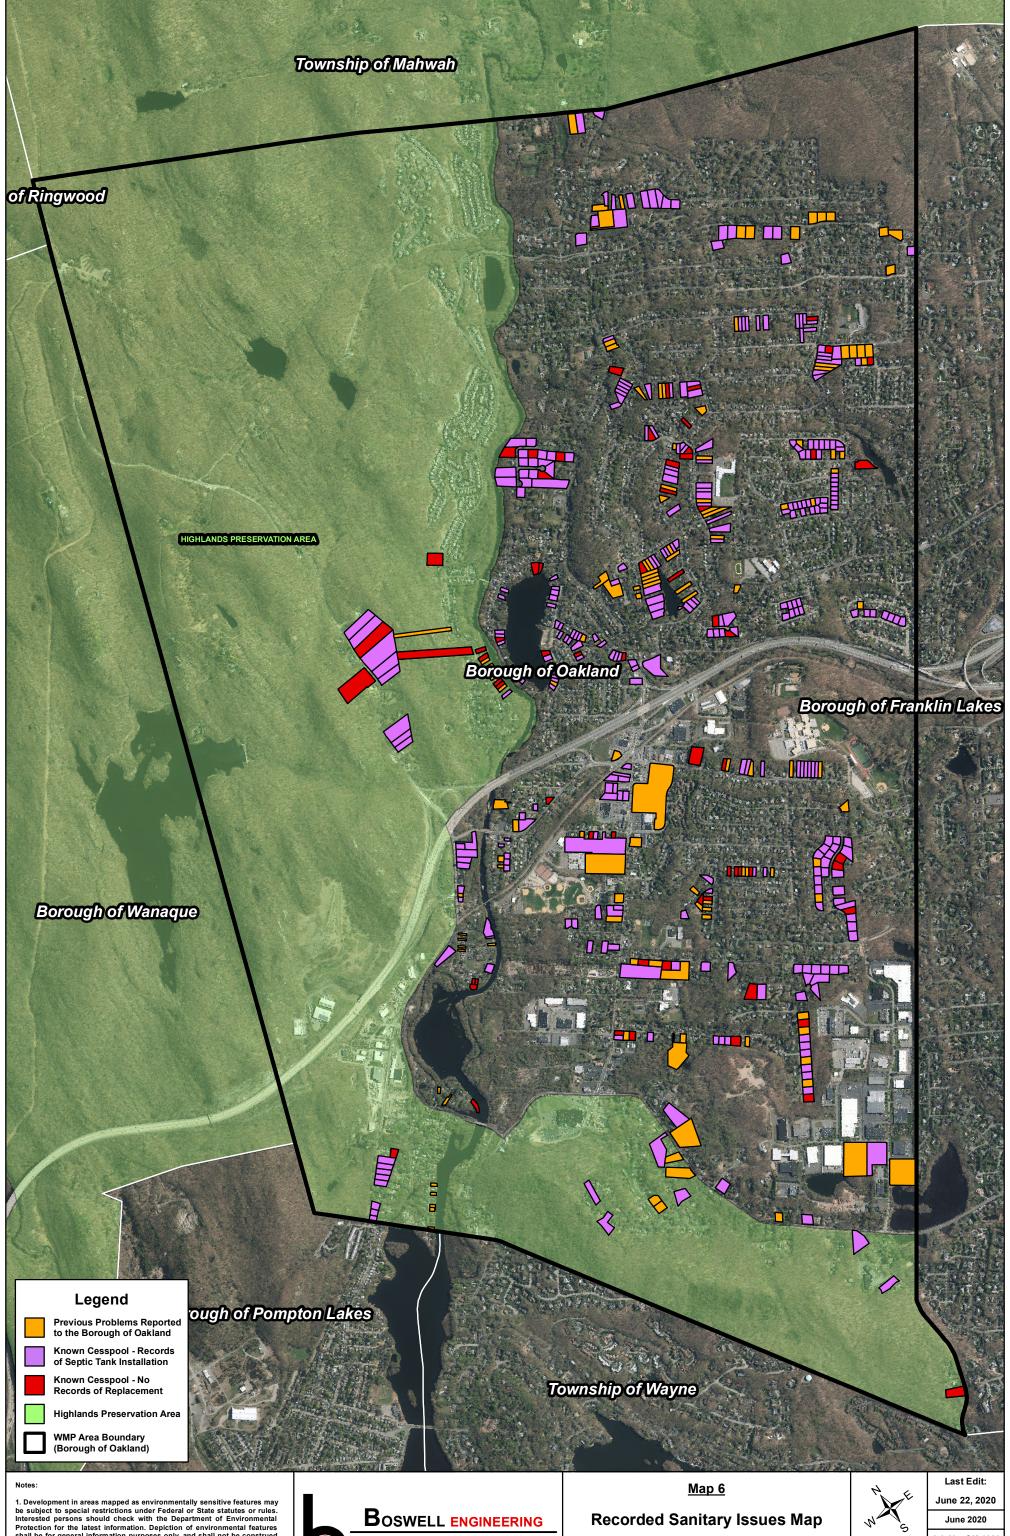

Protection for the latest information. Depiction of environmental features shall be for general information purposes only, and shall not be construed to define the legal geographic jurisdiction of such statutes or rules.

2. The aerial base map was prepared using the 2015 New Jersey High Resolution Ortholmagery from the New Jersey Information Warehouse.



ENGINEERS - SURVEYORS - PLANNERS - SCIENTISTS 330 Phillips Avenue South Hackensack, NJ 07606 Tel: 201-541-0770 • Fax: 201-541-1757 N.J. Certificate of Authorization No. 24GA27958000

Borough of Oakland

Bergen County New Jersey



Job No. OK-1620

Drawn By: JMW

Check By: GD 1 in = 1,600 ft

APPENDIX C – PREVIOUS STUDIES

Wastewater Treatment Plant Investigation Septic Data Base



Wastewater Treatment Plant Investigation

Our File No: OK-1607





TABLE OF CONTENTS

SECTION 1.0	EXECUTIVE SUMMARY						
SECTION 2.0	Introduction						
SECTION 3.0	INVESTIGATION						
	3.1 SKYVIEW-HIBROOK WTP						
	3.2 CHAPEL HILL ESTATES WTP						
	3.3 OAKWOOD KNOLLS WTP						
SECTION 4.0	SUMMARY AND RECOMMENDATION						
APPENDIX	A LOCATION MAP						
	B PHOTOGRAPHS						
	C COST ESTIMATE						

1.0 EXECUTIVE SUMMARY

Boswell Engineering (Boswell) was retained by the Borough of Oakland (Borough) to perform an evaluation of the three (3) existing wastewater treatment plants (WTP), Skyview-HiBrook, Chapel Hill and Oakwood Knolls. The three (3) WTPs have a combined average daily flow of 65,000 gallons per day (gpd).

After performing an assessment of each facility, it was determined that the plants are at the end of their useful life. Preparation of an equipment repair prioritization list was not feasible due to the condition of the existing assets. Full replacement of the plants is required.

Boswell has identified two (2) alternatives to remedy the situation and avoid failure of the system:

- a) Complete replacement of the three (3) WTP with new packaged plants.
- b) Decommissioning of the plants and installation of pumping stations to convey flow to the Northwest Bergen County Utilities Authority (NBCUA).

2.0 INTRODUCTION

The Borough owns and maintains three WTPs, which serve selected areas of the Borough.

The Skyview-HiBrook WTP is located at the north end of Lakeside Boulevard. This facility services 68 homes. The design average flow is 23,000 gpd. Actual flow has averaged 15-16,000 gpd.

The Chapel Hill WTP is located at the intersection of Hiawatha Boulevard and Calumett Avenue. This facility serves 24 homes in the Chapel Hill Estates development. Average daily flow is 7,000 gallons.

The Oakwood Knolls WTP is located on the east side of Oak Street, south of Yawpo Avenue. This facility services 166 hook-ups from the Oakcrest Townhouse Development and the Coppertree Mall. The plant has a design average daily flow of 35,000 gallons.

All three (3) facilities are package activated sludge systems with in-ground steel treatment tanks.

3.0 INVESTIGATION

Boswell Engineering, in accordance with the Borough's request, conducted initial and follow-up site inspections to determine existing conditions, and needed repairs/upgrades required to maintain continued operations at each facility.

Inspections were conducted at the Skyview-HiBrook plant on November 22, 2016 and January 17, 2017, at the Chapel Hill plant on December 6, 2016 and January 19, 2017, and at the Oakwood Knolls plant on December 30, 2016 and January 24, 2017.

The investigations were conducted by Edward Stephens, P.E. of Boswell McClave Engineering and Gerald Kastner, the licensed operator for the Borough of Oakland.

This report details the findings for each facility and makes recommendations for needed modifications.

3.1 SKYVIEW-HIBROOK WTP

The Skyview-HiBrook plant includes an influent comminutor, two aeration and settling tanks, a junction and splitter box, four sand filters, a flow meter, a chlorine contact tank, a dechlorination chamber, and an outfall sewer.

Also included are a blower building, a sludge storage tank, and a chlorination building. The plant is 50 years old.

Much of the equipment in the existing plant is aged and in a deteriorated condition. The following conditions are noted:

- a. There is no on-site emergency generator. Provision is made for the hook-up of a portable generator when needed.
- b. The aeration blowers are approximately 20 years old. Only one of three units is presently operating, some spare parts are available.
- c. The power supply to the Blower Building is in need of repair, as critical parts (circuit breakers) are missing. Also, there is no phase protection, or heat in the building.
- d. Control valves on the incoming and bypass piping are frozen in place, and will require replacement.
- e. The inflow comminutor has failed and been removed.
- f. The smaller of the two steel aeration/settling basins is out of service due to leaks caused by corrosion. The retaining wall adjacent to this basin has developed a bulge. The larger aeration/settling tank, currently in use, requires replacement.
- g. Piping systems inside the basins are deteriorated and need replacement.
- h. Electrical wiring has deteriorated, causing shorts.
- i. The concrete dosing chamber just upstream of the sand filters is in a deteriorated condition, requiring repair.
- j. The sand filters themselves are operating and in reasonably good condition. Downstream of the sand filters, the chlorine contact tank is leaking and requires repair. The chlorine building needs replacement.
- k. Downstream of the chlorine contact tank a clearwell houses a weir flow meter. The flow meter requires replacement. The clearwell tank is leaking into the driveway and needs repair. The clearwell tank also includes the de-chlorination chamber.
- 1. A steel sludge holding tank is in reasonably good condition.

- m. Electric conduit and wiring throughout the plant is severely deteriorated. Temporary above ground wiring has been used to replace corroded underground conduit and wiring in some areas. Control panels also need replacement.
- n. The plant will require a copper (cu) removal system.
- o. It is noted that two ejector stations discharge into the Skyview-HiBrook plant, the Lakeside Boulevard and the Tuscarora Street stations. Both stations have leaks, and deteriorated controls and piping. Both stations require replacement.

3.2 CHAPEL HILL ESTATES WTP

The Chapel Hill Estates plant consists of an influent bar screen and comminutor, an aeration and settling tank, a feed well, an upflow clarifier, flocculation tank, tube filters, two media filters, a clear well, UV disinfection, a flow meter and outfall sewer.

A waste sludge storage tank, and a media filter backwash mud well are also included.

Standby power is provided by a 30 kw emergency generator, with a buried diesel fuel storage tank.

The plant was constructed in 1986.

The site survey revealed the following conditions:

- a. The influent comminutor is functioning in a deteriorated condition and requires replacement.
- b. The aeration tank air delivery system, including the blowers, diffusers and piping requires replacement.
- c. The return activated sludge piping is also in need of repair or replacement.
- d. The feedwell pumps, and float controls, which deliver flow from the settling tank to the upflow clarifier, need replacement. The feedwell tank is also cracked.
- e. The media in the upflow clarifier needs replacement.
- f. The flocculation tank equipment is inoperative, and is not used.
- g. The media in the two filter wells requires replacement.
- h. All pumping systems within the clearwell need replacement, including two effluent pumps, two filter backwash pumps, and one upflow clarifier backwash pump, along with controls.
- i. The clear well aeration system is not operative. This was an added on system.
- j. The ultra violet disinfection system leaks and requires replacement.
- k. The discharge well piping needs replacement. Groundwater intrusion into the discharge well is also a problem. A sump pump is needed to remove the ground water.
- 1. Two pumps in the mud well, which receives the filter backwash flow, require replacement.
- m. The air compressor for the filter scour system requires replacement.

- n. This plant will also require a system for copper (cu) removal.
- o. The flow-thru facilities are enclosed in in-ground steel tanks which have incurred corrosion in many sections.
- p. The underground diesel fuel tank is 20 years old and needs to be inspected.

3.3 OAKWOOD KNOLLS WTP

The Oakwood Knolls Wastewater Treatment Plant was constructed around 1967.

Facilities include an influent splitter box, inflow comminutor, equalization tank, aeration and settling tank, feed well, upflow clarifier, filter tank, backwash tanks, (2), chlorine contact tank, denitrification clear well, effluent flow meter, outfall and two sludge holding tanks.

The following observations were noted, during the site investigations:

- a. The electrical wiring to the comminutor has been replaced.
- b. The weir control in the influent diversion chamber needs repair, due to corrosion.
- c. The grinders in the equalization tank need to be replaced. The equalization tank aeration blower also requires replacement.
- d. The pipeline from the equalization back to the aeration tank needs replacement.
- e. Piping inside the aeration tank needs replacement.
- f. The aeration tank walls above ground, are corroded in some areas, and the tank is leaking.
- g. The underground air line from the blowers has corroded. Temporary above-ground piping has been installed. A new underground installation is required.
- h. The v-notch weirs in the aeration tank have been replaced.
- i. The pumps in the feed well, which discharge to the upflow clarifier, require replacement.
- j. The filter tank, downstream from the upflow clarifier is not working due to deteriorated controls and corrosion. This tank was installed in 1992, also the filter media requires replacement. The Air Scour System also needs upgrading.
- k. The system for backwashing the filter media requires upgrading. The backwash tanks are not used, due to leaks caused by corrosion. The filter backwash pumps require replacement.
- 1. The chlorine contact tank is severely corroded. The underground piping has been replaced with piping on grade.
- m. The dechlorination building equipment and controls, need a total upgrade. The dechlorination building structure is adequate.
- n. The clear well is in adequate condition.
- o. The plant flow meter requires replacement.

p. The blower control panel in the blower building needs replacement. In the same building, the electric panel and the generator Automatic Transfer Switch (ATS) need replacement. Alarms are not functioning. The blower building roof is leaking.

4.0 SUMMARY AND RECOMMENDATION

Based on the fact that all three (3) facilities are at the end of their expected service life and have extensive deficiencies, it is recommended that the plants are decommissioned and either replaced in their entirety or replaced with pumping stations to convey flow to NBCUA.

A construction cost estimate for the replacement of the plants is included in Appendix C.

The timeline for design and construction would differ depending on the source of funding. If the Borough funds the project, the design phase can commence after funding is available. The following is the schedule:


Sept 1, 2017	Notice to proceed
Jan 14, 2017	Preliminary Design Plans for review by the DPW
Feb 15, 2017	Submission of a Treatment Works Approval (TWA) Permit Application
	to NJDEP
May 8, 2018	Receive TWA permit
May 22, 2018	Bid Project
June 16, 2018	Receive Bids
July 28, 2018	Award Project
Aug 12, 2018	Construction Begins
Apr 30, 2019	Completion of Project

If the Borough seeks funding through the New Jersey Environmental Infrastructure Trust Fund (NJEIT), the following is the schedule for the project:

Sept 1, 2017	Notice to proceed
Jan 14, 2017	Preliminary Design Plans for review by the DPW; Submission of Loan
	Application and documents to the NJEIT for review
Feb 15, 2017	Submission of a Treatment Works Approval (TWA) Permit Application
	to NJDEP
May 8, 2018	Receive TWA permit
July 16, 2018	Receive Authorization to Bid from the NJEIT
Aug 15, 2018	Bid Project
Sept 8, 2018	Receive Bids

Oct 3, 2018 Award Project
Oct 25, 2018 Construction Begins
Nov 24, 2019 Completion of Project

ES/ajf 170208ajfR1.doc







PHOTOGRAPHS

ENGINEERS • PLANNERS • SURVEYORS • SCIENTISTS

CLIENT NAME:SITE LOCATION:PROJECT NAME:PROJECT NO.:Borough of OaklandSkyview Hi-brook WTPWastewater Treatment Plant InvestigationOK-1607

Photo No. 1. Description:

Blower Room (one of the three (3) operating)



Photo No. 2.

Description:

Sludge Storage Tank and Blower Building



BOSWELL MCCLAVE ENGINEERING ENGINEERS • PLANNERS • SURVEYORS • SCIENTISTS

PHOTOGRAPHS

CLIENT NAME: Borough of Oakland SITE LOCATION: Skyview Hi-brook WTP PROJECT NAME:

Wastewater Treatment Plant Investigation | OK-1607

PROJECT No.:

Photo No. 3.

Description:

Smaller treatment tank (not used due to corrosion)



Photo No. 4.

Description:

In-service treatment tank, junction box and splitter tank for sand filters



BOSWELL MCCLAVE ENGINEERING ENGINEERS • PLANNERS • SURVEYORS • SCIENTISTS

PHOTOGRAPHS

CLIENT NAME: Borough of Oakland SITE LOCATION: Skyview Hi-brook WTP

PROJECT NAME:

PROJECT No.:

Wastewater Treatment Plant Investigation OK-1607

Photo No. 5. Description:

Retaining wall bulge at smaller treatment tank and sand filters.



Photo No. 6.

Description:

Sand Filters



PHOTOGRAPHS

ENGINEERS • PLANNERS • SURVEYORS • SCIENTISTS

CLIENT NAME: Borough of Oakland SITE LOCATION: Skyview Hi-brook WTP

PROJECT NAME: Wastewater Treatment Plant Investigation | OK-1607

PROJECT No.:

Photo No. 7. Description:

In-use aeration and settling tanks.



Photo No. 8.

Description:

Concrete deterioration at splitter box.



ENGINEERS • PLANNERS • SURVEYORS • SCIENTISTS

CLIENT NAME: Borough of Oakland SITE LOCATION: Chapel Hill WTP PROJECT NAME:

Wastewater Treatment Plant Investigation | OK-1607

PHOTOGRAPHS

Project No.:

Photo No. 1.

Description:


Underground Diesel Storage Tank



Photo No. 2.

Description:

Clearwell, Mixed Media Filters and Mud Well

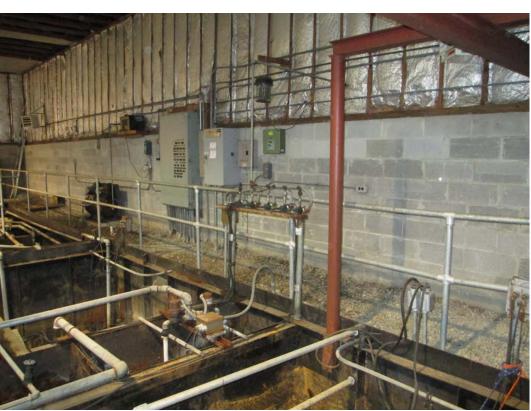

BOSWELL MCCLAVE ENGINEERING ENGINEERS • PLANNERS • SURVEYORS • SCIENTISTS

PHOTOGRAPHS

CLIENT NAME: Borough of Oakland SITE LOCATION: Chapel Hill WTP

PROJECT NAME:

Wastewater Treatment Plant Investigation | OK-1607

PROJECT No.:

Photo No. 3.

Description:

Walkway at Clearwell



Photo No. 4. Description:

Clearwell, Flocculation Tank and Denitrification Filter



BOSWELL MCCLAVE ENGINEERING ENGINEERS • PLANNERS • SURVEYORS • SCIENTISTS

PHOTOGRAPHS

CLIENT NAME: Borough of Oakland SITE LOCATION: Chapel Hill WTP

PROJECT NAME:

Wastewater Treatment Plant Investigation | OK-1607

PROJECT No.:

Photo No. 5.

Description:

Mud Well (for backwash water)



Photo No. 6.

Description:

Emergency Generator



ENGINEERS • PLANNERS • SURVEYORS • SCIENTISTS

CLIENT NAME: Borough of Oakland SITE LOCATION: Chapel Hill WTP PROJECT NAME:

Wastewater Treatment Plant Investigation OK-1607

PHOTOGRAPHS

PROJECT No.:

Photo No. 7. Description:

Inlet End looking downstream



Photo No. 8. Description:

Aeration Blowers



PHOTOGRAPHS

ENGINEERS • PLANNERS • SURVEYORS • SCIENTISTS

SITE LOCATION: Chapel Hill WTP CLIENT NAME: Borough of Oakland

PROJECT No.: PROJECT NAME: Wastewater Treatment Plant Investigation | OK-1607

Photo No. 9. Description:

Flocculation Tank and Denitrification Filter



Photo No. 10.

Description:

Feed Well





PHOTOGRAPHS

CLIENT NAME: Borough of Oakland SITE LOCATION: Chapel Hill WTP

PROJECT NAME:

Wastewater Treatment Plant Investigation | OK-1607

PROJECT No.:

Photo No. 11.

Description:

Sludge Holding Tank



Photo No. 12.

Description:

Flocculation, Tube Media, Mixed Media, Denitrification and Mud Well



ENGINEERS • PLANNERS • SURVEYORS • SCIENTISTS

CLIENT NAME: Borough of Oakland SITE LOCATION: Chapel Hill WTP PROJECT NAME:

Wastewater Treatment Plant Investigation OK-1607

PHOTOGRAPHS

PROJECT No.:

Photo No. 13.

Description:

Mud Well



Photo No. 14.

Description:

Walkway at Aeration and Settling Tank



ENGINEERS • PLANNERS • SURVEYORS • SCIENTISTS

CLIENT NAME: Borough of Oakland SITE LOCATION: Oakwood Knolls WTP PROJECT NAME:

Wastewater Treatment Plant Investigation OK-1607

PHOTOGRAPHS

PROJECT No.:

Photo No. 1.

Description:

Equalization tank (not used due to leaks)



Photo No. 2.

Description:

Aeration-sedimentation tank



BOSWELL MCCLAVE ENGINEERING ENGINEERS • PLANNERS • SURVEYORS • SCIENTISTS

PHOTOGRAPHS

CLIENT NAME: Borough of Oakland SITE LOCATION: Oakwood Knolls WTP

PROJECT NAME:

Wastewater Treatment Plant Investigation | OK-1607

PROJECT No.:

Photo No. 3.

Description:

Un-used chambers



Photo No. 4. Description:

Circular sludge tanks (2); Aeration-settling tank and Filter Building



BOSWELL MCCLAVE ENGINEERING ENGINEERS • PLANNERS • SURVEYORS • SCIENTISTS

PHOTOGRAPHS

CLIENT NAME: Borough of Oakland SITE LOCATION: Oakwood Knolls WTP PROJECT NAME:

Wastewater Treatment Plant Investigation | OK-1607

PROJECT No.:

Photo No. 5.

Description:

Temporary air line from Blower Building; Original line corroded



Photo No. 6.

Description:

Chlorine Contact tank (corroded)



ENGINEERS • PLANNERS • SURVEYORS • SCIENTISTS

CLIENT NAME: Borough of Oakland SITE LOCATION: Oakwood Knolls WTP PROJECT NAME:

Wastewater Treatment Plant Investigation OK-1607

PHOTOGRAPHS

PROJECT No.:

Photo No. 7.

Description:

Top of Filter and Upflow Clarifier, Filter Building




Photo No. 8.

Description:

Electrical Panels, Filter Buildings






Borough of Oakland Treatment Plant Replacements Manufacturer's Design and Construction Cost (Package Plants) Our File No. OK-1607

	Construction*
Sky View – HiBrook	\$ 765,000
Chapel Hill	\$1,200,000
Oakwood Knolls	<u>\$1,355,000</u>
Total Manufacturer's Cost Contingency (5%) Engineering/Inspection (15%)	\$3,320,000 \$ 160,000 \$ 520,000
Total	\$4,000,000

^{*}Includes demolition of existing equipment, furnishing and installing new equipment.

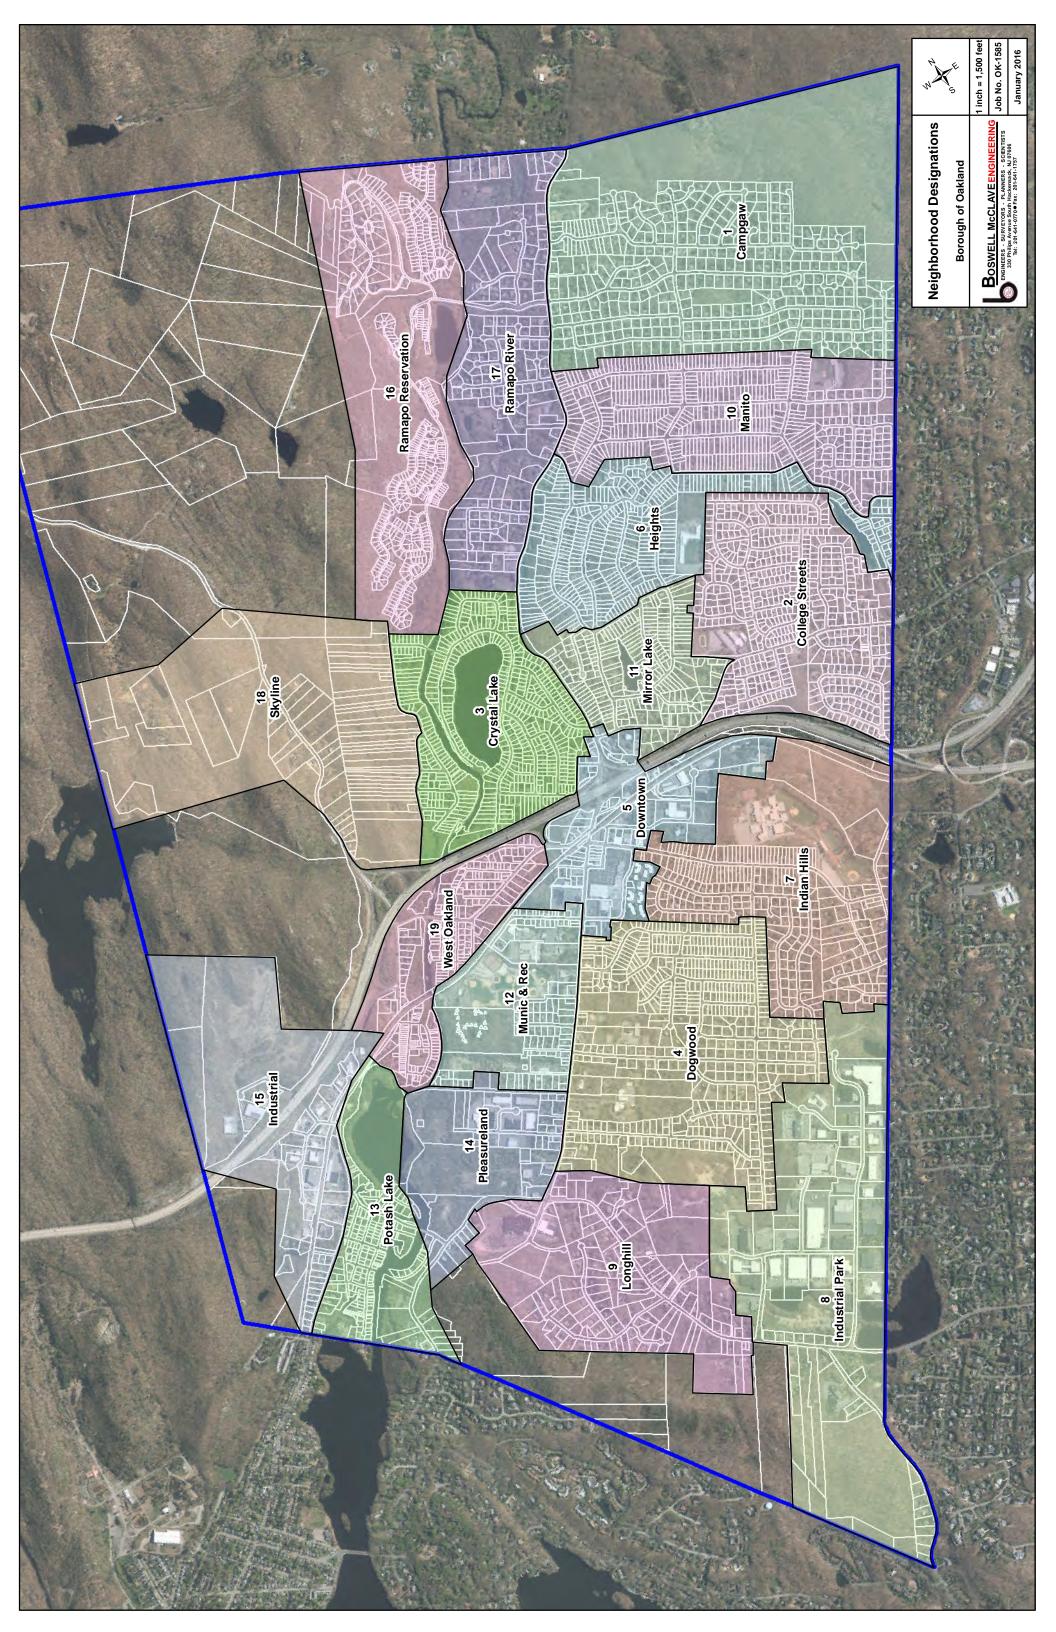



Borough of Oakland Septic Problem Statement OK-1585 Neighborhood 1: Campgaw

Cesspool (Y/N) Comments	- Z	·	- N	N 2010 - New system / 2013 - Asbuilts received	- N	- N	- N	N 2010 - New system	- N	- N	- N	N 2014 - New System	- N	N 2009 - New System	- N	- N	- N	- N	- N	- Z	- N	- N											
System Failures	,	,	,	•	1983 - Overflowing septic	•	,	•	,	1983 - Draiange field very wet, not overflowing	•	•	•	1976,1977 - Malfunctioning septic system	•		•	,	,	,	2006 - Septic Overflow	2006 - Septic Overflow	1978 - Septic backup, overflow within house		-							- - - - - 1983 - Septic Malfunction	
Year Repaired	1973	1972 / 1991	1970 / 1989 / 2006	1976 / 2010	1972 / 1984 / 2005	1984 / 2007	1984 / 1988	2010	1980 / 1990 / 1999	2000 / 2001	1992	1976 / 1983 / 2014	1998	1975 / 1984 / 1996 / 2009	1	1982	-	1978 / 1989 / 1991	1		2014	1985 / 2006	1980 / 1987 / 1995	,		1993 / 2007	1993 / 2007	1993 / 2007 1964 / 1988 1973 / 1979	1993 / 2007 1964 / 1988 1973 / 1979	1993 / 2007 1964 / 1988 1973 / 1979	1993 / 2007 1964 / 1988 1973 / 1979 - 1969 1972 / 2000	1993 / 2007 1964 / 1988 1973 / 1979 - 1969 1972 / 2000	1993 / 2007 1964 / 1988 1973 / 1979 - 1969 1972 / 2000 1966 / 1985
Year Designed	1964	1964	1964	1964	1964	1964	1964	1964	1964	1963	1961	1967	1968	1961	1973	1967	1973	1973	1972	1972	1973	1973	1973	1972		1960	1960	1960 1960 1960	1960 1960 1960 1958	1960 1960 1960 1958	1960 1960 1960 1958 1960	1960 1960 1960 1958 1960 1960	1960 1960 1960 1958 1960 1960 1960
Street Address	200 Manito Ave	206 Manito Ave	210 Manito Ave	214 Manito Ave	213 Manito Ave	209 Manito Ave	205 Manito Ave	199 Manito Ave	193 Manito Ave	117 Chicasaw Dr	117 Algonquin Trail	113 Algonquin Trail	149 Chuckanutt Dr	2 Cree Ct	8 Cree Ct	12 Cree Ct	135 Chuckanutt Dr	129 Chuckanutt Dr	123 Chuckanutt Dr	117 Chuckanutt Dr	111 Chuckanutt Dr	105 Chuckanutt Dr	99 Chuckanutt Dr	110 Andrew Ave	94 Iroquiois Ave		100 Iroquiois Ave	100 Iroquiois Ave	100 Iroquiois Ave 106 Iroquiois Ave 114 Iroquiois Ave	100 Iroquiois Ave 106 Iroquiois Ave 114 Iroquiois Ave 60 Chuckanutt Ave		100 Iroquiois Ave 106 Iroquiois Ave 114 Iroquiois Ave 60 Chuckanutt Ave 64 Chuckanutt Ave 68 Chuckanutt Ave	100 Iroquiois Ave 106 Iroquiois Ave 114 Iroquiois Ave 60 Chuckanutt Ave 64 Chuckanutt Ave 68 Chuckanutt Ave 72 Chuckanutt Ave
Block/Lot			1 3			1 1	8		10	11	1 12	1 13	14	1 15	1 16	17	18	19					1 24			,,,,,,			7 8 4				
В	5504	5504	5504	5504	5504	5504	5504	5504	5504	5504	5504	5504	5504	5504	5504	5504	5504	5504	5504	5504	5504	5504	5504	5504	5404	5404		5404	5404	5404 5404 5404	5404 5404 5404 5404	5404 5404 5404 5404 5404	5404 5404 5404 5404 5404
Neighborhood	1. Campgaw	1. Campgaw	1. Campgaw	1. Campgaw	1. Campgaw	1. Campgaw	1. Campgaw	1. Campgaw	1. Campgaw	1. Campgaw	1. Campgaw	1. Campgaw	1. Campgaw	1. Campgaw	1. Campgaw	1. Campgaw	1. Campgaw	1. Campgaw	1. Campgaw	1. Campgaw	1. Campgaw	1. Campgaw	1. Campgaw	1. Campgaw	1. Campgaw	1. Campgaw		1. Campgaw		1. Campgaw 1. Campgaw 1. Campgaw	1. Campgaw 1. Campgaw 1. Campgaw 1. Campgaw	1. Campgaw 1. Campgaw 1. Campgaw 1. Campgaw 1. Campgaw	1. Campgaw 1. Campgaw 1. Campgaw 1. Campgaw 1. Campgaw 1. Campgaw



Neighborhood 1: Campgaw Borough of Oakland

	Septic Problem Statement	OK-1585
Δ	Sept	

Comments							2015 - New System	2009 - New pits installed								Also Repaired in: 1994 / 1995			1998 - New System						2000 - Septic tank cave in		•				•		
Cesspool (Y/N)	>	Υ	Z	У	Ν	Z	Z	N	N	N	У	Z	N	•	Υ	Υ	γ	•	У	Ν	Υ	Z	Y	Z	-	Z	>	N	У	Х	У	Υ	>
System Failures	-			1977 - System Malfunction, overflow												1977 - System Malfunction			1977 - System overflow						1971,1972 - Overflow in front yard and into street		,						
Year Repaired	1965 / 1976 / 2007	1972	1975	1975 / 1993	1983	1987 / 1997	1975 / 2015	1976 / 1979 / 1983 / 1988	1970	1978 / 2003	-	1995	1966	1975 / 1997 / 2004 / 2007	1988 / 1999	1967 / 1977 / 1980 / 1986	1967 / 2011	1999 / 2000	1975 / 1998	1968 / 1980 / 1985	1983 / 1985	2015	1975 / 1989 / 1998	1976 / 1988	1972 / 2000 / 2014	1971 / 2004	1974 / 1990	1972 / 1978 / 2013	1984 / 1986	1974 / 2007	1972 / 2002	-	1980 / 2004 / 2005
Year Designed	1961	1962	1963	1962	1965	1969	1968	1969	1968	1969	1964	1961	1963	-	1961	1960	1962	-	1962	1962	1976	1980	1958	1970	-	1953	1961	1963	1954	1955	1964	1964	1963
Street Address	80 Chuckanutt Ave	84 Chuckanutt Ave	88 Chuckanutt Ave	92 Chuckanutt Ave	96 Chuckanutt Ave	63 Algonquin Trail	8 Hopi Ct	9 Hopi Ct	7 Hopi Ct	55 Algonquin Trail	47 Algonquin Trail	41 Algonquin Trail	35 Algonquin Trail	778 Ramapo Valley Rd	782 Ramapo Valley Rd	788 Ramapo Valley Rd	790 Ramapo Valley Rd	792 Ramapo Valley Rd	794 Ramapo Valley Rd	800 Ramapo Valley Rd	14 Andrew Ave	16 Andrew Ave	18 Andrew Ave	20 Andrew Ave	22 Andrew Ave	24 Andrew Ave	28 Andrew Ave	30 Andrew Ave	34 Andrew Ave	38 Andrew Ave	42 Andrew Ave	46 Andrew Ave	50 Andrew Ave
Block/Lot	5404 10	5404	5404 12	5404 13	5404 14	5404 15		5404 17	5404 18		5404 20	5404 21	5404 22	5304 2			5304 5	5304 6	5304 7	5304 8	5304 9	5304 10	5304 11	5304 12	5304 13	5304 14	5304 15	5304	5304 18	5304 19	5304 20	5304 21	5304 22
Neighborhood	1. Campgaw	1. Campgaw								1. Campgaw									1. Campgaw									1. Campgaw		1. Campgaw	1. Campgaw	1. Campgaw	1. Campgaw



Borough of Oakland Septic Problem Statement OK-1585 Neighborhood 2: College Streets

	Comments	2004 - New system	1998 - New septic tanks		2013 - New System				1994 - New System																	Also repaired in: 2002 / 2015	,			1994 - Dining room addition	2005 - Second floor addition	1999 - Pool addition		2003 - New bedroom addition
	Cesspool (Y/N)	λ	λ	λ	А	λ	Х	Х	λ	λ	А	λ	λ	λ	λ	λ	λ	λ	λ	λ	\	-		1	λ	У	Y	Х	•	Х	λ	А	А	λ
	System Failures		1979 - Overflowing system				•	•	1982,1984 - Overflowing system					•			•					•	•			•				•			-	-
500	Year Repaired	1973 / 2004	1972 / 1977 / 1998	1967 / 1972	1986 / 2013	1999 / 2015	2011	1964 / 2004	1984 / 1994	1966	2009 / 2014	1956 / 1967 / 1983 / 2014	1982 / 1986	1990 / 2007	1978 / 2005	1986 / 2002	2014	1972 / 1978 / 1989 / 2004	1959 / 1972 / 2001	1964 / 1988 / 2005	1963 / 1998	1981 / 1989	1987	2002	1972 / 1985 / 1992	1962 / 1969 / 1979 / 1988	1965 / 1989	1960 / 1999	1954 / 1956 / 1973 / 1999	1992	2005	1969 / 1995 / 1999	1982 / 2014 / 2015	2003
	Year Designed	1953	1954	1953	1954	1954	1954	1954	1954	1954	1953	1953	1953	1953	1953	1953	1953	1951	1951	1951	1951	-	-	-	1951	1951	1951	1951	-	1953	1953	1955	1953	1953
	Street Address	26 Princeton Terr	4 Sienna Way	6 Sienna Way	8 Sienna Way	10 Sienna Way	12 Sienna Way	14 Sienna Way	16 Sienna Way	18 Sienna Way	20 Sienna Way	49 Rutgers Dr	37 Rutgers Dr	15 Yale Way	13 Yale Way	9 Yale Way	5 Yale Way	11 Wellesley Dr	9 Wellesley Dr	7 Wellesley Dr	5 Wellesley Dr	3 Wellesley Dr	14 Mt. Holyoke Dr	16 Barnard Dr	20 Barnard Dr	22 Barnard Dr	24 Barnard Dr	9 Vassar Pl	7 Vassar Pl	3 Cornell PI	50 Rutgers Dr	52 Rutgers Dr	54 Rutgers Dr	
	Block/Lot) 2	3	4) 2	9 (7	8 (6 (10	11	12	13	14	15	17	19	1	3 2	3	4	9 2	9 8	7	8 8	6 8	3 10	11	12	1	2 2	2 3		5 2
	B	4910	4910	4910	4910	4910	4910	4910	4910	4910	4910	4910	4910	4910	4910	4910	4910	4403	4403	4403	4403	4403	4403	4403	4403	4403	4403	4403	4403	2005	2005	5002		2005
	Neighborhood	2. College Streets	2. College Streets	2. College Streets	2. College Streets	2. College Streets			2. College Streets	2. College Streets	2. College Streets	2. College Streets	2. College Streets	2. College Streets	2. College Streets	2. College Streets	2. College Streets	2. College Streets	2. College Streets	2. College Streets	2. College Streets	2. College Streets	2. College Streets	2. College Streets	2. College Streets			2. College Streets	2. College Streets	2. College Streets		2. College Streets		2. College Streets



Borough of Oakland Septic Problem Statement OK-1585 Neighborhood 2: College Streets

Comments		2000 - Pool addition		2000 - Septic tank installed					2004 - 3 Bedroom addition			2000 - Cesspool was replaced with Septic tank									2003 - House addition			-		2010 - Pool and deck replacement				1997 - Septic tank installed	2014 - New System	-	
Cesspool (Y/N)	>	>	Υ	У	N	Z	N	N	-	Т	У	У	У	У	Z	У	У	У	У	У	У	У	N	-	-	N	-	У	Y	Υ	Ν	N	Z
System Failures		,		Leaves dumped in wooded area						-				Laundry discharge into street							-		Septic overflow in rear yard	-	Septic overflow in rear yard				Laundry waste flowing into street			1985 - Septic Overflow	
Year Repaired	1972 / 2003	2003 / 2004	1969 / 1987	2000	1989 / 2000	2007	1988 / 2010	1999	2004 / 2005	-	1992 / 1999	2000 / 2013	1987	1963 / 1986	1986	1969	2001 / 2004	2003	1968 / 1973 / 1986 / 2002	1966 / 1999	1987 / 2003 / 2010 / 2011	1988	1993	-	1969	1965 / 1986 / 1994	-	2002	-	1972 / 1997	1979 / 2014	1973	1982
Year Designed	1955	1953	1953	1953	1954	1954	1954	1954	1954	1966	1955	1955	1955	1955	1	1955	1955	1955	1955	1955	1954	1959	1985	1954	1954	1954	1954	1955	1968	1955	1966	1965	1966
Street Address	58 Rutgers Dr	60 Rutgers Dr	62 Rutgers Dr	64 Rutgers Dr	66 Rutgers Dr	26 Colgate Rd	28 Colgate Rd	30 Colgate Rd	32 Colgate Rd	34 Colgate Rd	11 Colgate Rd	6 Hobart Pl	8 Hobart Pl	38 Seton Hall Dr	40 Seton Hall Dr	42 Seton Hall Dr	44 Seton Hall Dr	46 Seton Hall Dr	48 Seton Hall Dr	50 Seton Hall Dr	54 Seton Hall Dr	60 Seton Hall Dr	27 Colgate Rd	25 Colgate Rd		21 Colgate Rd	19 Colgate Rd	17 Colgate Rd	15 Colgate Rd	13 Colgate Rd	54 Thackeray Rd	60 Thackeray Rd	66 Thackeray Rd
Block/Lot	5002 6	5002 7	5002 8	5002 9	5002 10	5002	5002 12	5002 13	5002 14	5002 15	5003	5003 2	5003 3	5003 4	5003 5	5003 6	5003 7	5003 8	5003 9	5003 10	5003 11	5003 12	5003 13	5003 14	5003 15	5003 16	5003 17	5003 18	5003 19	5003 20	4306 1	4306 2	4306 3
Neighborhood	2. College Streets	2. College Streets	2. College Streets	2. College Streets		College Streets	College Streets		College Streets	College Streets		College Streets	2. College Streets		College Streets				College Streets		College Streets	2. College Streets	College Streets		College Streets	College Streets	College Streets		College Streets	2. College Streets	College Streets	College Streets	2. College Streets

EST. 1924

Boswell Engineering 330 Phillips Avenue South Hackensack, NJ 07606

Borough of Oakland Septic Problem Statement OK-1585 Neighborhood 2: College Streets

	Comments		-	•		Also repaired in: 2012		•	•																
	Cesspool (Y/N)	N	N	N	N	N	N	У	У	У	У	N	\	У	Z	\									
: 1	System Failures	-	-		-	-			-		-														
	Year Repaired	1971 / 2005	2012	1994	1993 / 2007	1973 / 1986 / 1988 / 1991	1972 / 1984 / 1988 / 2006	1994 / 2015	1968 / 1970 / 1978	2006 / 2012	1972 / 1996	2002	6661 / 9661	1979 / 1988	1980	1983									
	Year Designed	1966	1966	1965	1965	1965	1965	1964	1963	1963	1963	1963	1963	1963	1964	1964									
	Street Address	70 Thackeray Rd	74 Thackeray Rd	78 Thackeray Rd	84 Thackeray Rd	90 Thackeray Rd	98 Thackeray Rd	31 Whittier Lane	27 Whittier Lane	23 Whittier Lane	19 Whittier Lane	17 Whittier Lane	15 Whittier Lane	11 Whittier Lane	7 Whittier Lane	3 Whittier Lane									
	Block/Lot				7			10	11		13		15	16	17	18	 								
i	Blo	4306	4306	4306		4306		4306	4306		4306			4306	4306	4306									
	Neighborhood	2. College Streets	2. College Streets	2. College Streets	2. College Streets	2. College Streets	2. College Streets	2. College Streets	2. College Streets	2. College Streets	2. College Streets	2. College Streets													



Comments	1979 - New system			,			,							,	1975 - Combined Lots - New house		2013 - New system				,												1990 - New pit installed
Cesspool (Y/N)	Х	У	Z	Z	\	Z	Z	Z	N	N	Y	Ь	У	\	Z	N	N	N	N	Z	Z	N	N	N	Т	Т	N	N	N	У	N	У	У
System Failures				,	,		,	,			,			,	,				,		,	,											
Year Repaired	1969 / 1979 / 1992	1997 /	1984 / 1993	1997	1967	1989	1996 / 2006	1970 / 1986	1972 / 1975	1975	1982 / 1985 / 1992	-	1965 / 2011	1990	•	1983	2013	2014	•	1995 / 1999	1965	2009	1991	1967	-	-	-	1963	-	1977 / 2005	1982	1984 / 1992	1951 / 1957 / 1962
Year Designed	1955	1953	1959	1958	1960	1956	1957	ı	-	1964	1957	1960	1957	1957	1974	1954	1956	1969	6961	1956	1956	1976	1987	1961	1958	1958	1961	1958	1960	1	1973	1954	1948
Street Address	191 Lakeshore Dr	189 Lakeshore Dr	187 Lakeshore Dr	185 Lakeshore Dr	183 Lakeshore Dr	181n Lakeshore Dr	179 Lakeshore Dr	177 Lakeshore Dr	173 Lakeshore Dr	171 Lakeshore Dr	169 Lakeshore Dr	167 Lakeshore Dr	165 Lakeshore Dr	163 Lakeshore Dr	161 Lakeshore Dr	155 Lakeshore Dr	153 Lakeshore Dr	147 Lakeshore Dr	145 Lakeshore Dr			119 Lakeshore Dr	117 Lakeshore Dr	113 Lakeshore Dr	111 Lakeshore Dr	105 Lakeshore Dr	103 Lakeshore Dr	101 Lakeshore Dr	99 Lakeshore Drive	93 Lakeshore Dr	89 Lakeshore Dr	85 Lakeshore Dr	83 Lakeshore Dr
Block/Lot	1501 3	1501 4	1091		1201	1201 8	1501 9	1501 10	1101	1501 12	1501	1501	1501	1201	1101	1501	1021		1501 21			1501 32	1501 33	1501 34	1501 35	1501 39		1501 38		1501 41	1501 43	1501 44	1501 45
Neighborhood	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake



	Comments		1948,1954 - Changed Owners (maybe septic install)	1989 - New Pits	•			(OKES-1207)	•		•			2004 - New System		2015 - Tenants out, Oakland wants to replace septic	-	•							2008 - Second floor addition	•				2006 - Aditional floor with bathrooms and bedrooms	•	•		•
	Cesspool (Y/N)	>-	Z	>-	N	Z	Z	N	Х	>	N	>	Z	X	>	>	X	Ν	Z	Z	>	Z	>	Z	Ν	Ν	\	>	Z	У	Ν	У	У	2
Jud J. Olystal Lanc	System Failures		-	-		-		-				-	-	-		1995 - Open cesspool, sewage overflow			-															
NOTHORN	Year Repaired	1986	1982 / 1990 / 2002	1973 / 1989	1981 / 1999	1988	1996	1996 / 1999 / 2001	-	2012	2009	1964 / 2014	1965 / 1983	2004	1978 / 2005	1995 / 2010	1964 / 2003	1964 / 1975 / 1999		•	1985	2006 / 2014	2000 / 2001	2003	2008	1985	2008		2000	2000 / 2006	1984 / 2010	1999 / 2000	1989	1998
	Year Designed	1956	1	1956	1958	1956	1960		1956	1959	1964	1953	1960	1956	1958	1954	1955	1958	1954	1956	1959	1959	1957	1958	1958	1955	1958	1955	1959	1955	1959	1980	1955	1958
	Street Address	79 Lakeshore Dr	77 Lakeshore Dr	75 Olakeshore Dr	73 Lakeshore Dr	71 Lakeshore Dr	69 Lakeshore Dr	67 Lakeshore Dr	57 Lakeshore Dr	55 Lakeshore Dr	_	49 Lakeshore Dr	45 Lakeshore Dr	43 Lakeshore Dr	39 Lakeshore Dr	37 Lakeshore Dr	35 Lakeshore Dr	33 Lakeshore Dr	31 Lakeshore Dr	143 Lakeshore Dr	141 Lakeshore Dr	139 Lakeshore Dr	137 Lakeshore Dr	135 Lakeshore Dr	133 Lakeshore Dr	127 Lakeshore Dr		32 Nokomis Ave	34 Nokomis Ave	36 Nokomis Ave	38 Nokomis Ave	40 Nokomis Ave	42 Nokomis Ave	
	Block/Lot)1 46		01 48			01 51)1 56			01 59		19 10	01 62	01 63	10 64			24		,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,	27		1 1		3	74 4	04 5)4 6	7 7)4 8
	Neighborhood	3. Crystal Lake 1501	3. Crystal Lake 1501	3. Crystal Lake 1501	Crystal Lake	Crystal Lake	3. Crystal Lake 1501	3. Crystal Lake 1501	Crystal Lake	Crystal Lake	3. Crystal Lake 1501	Crystal Lake	Crystal Lake	Crystal Lake	3. Crystal Lake 1501	3. Crystal Lake 1501	Crystal Lake	3. Crystal Lake 1501	3. Crystal Lake 1501	Crystal Lake	3. Crystal Lake 150	3. Crystal Lake 1501	Crystal Lake	Crystal Lake	3. Crystal Lake 1501	3. Crystal Lake 1501	3. Crystal Lake 4504	3. Crystal Lake 4504	3. Crystal Lake 4504	3. Crystal Lake 4504	Crystal Lake			

EST.

Boswell Engineering 330 Phillips Avenue South Hackensack, NJ 07606

Comments									2007 - Cesspool replaced with septic tank	•					-	1994 - Septic tank installed					1		•		•							•	2005 - Pool added to property
Cesspool (Y/N)	Υ	N	Х	У	N	Z	N	λ	\	У	N	•	У	N	Z	У	N	Ν	\	А	>	λ	N	Х	У	У	N	Z	Т	Т	N	Ν	N
System Failures											odors from septic system															-		Exposed septic tank	-		-	Pool not emptied and septic odors	
Year Repaired	2010 / 2011	-	1983 / 2003 / 2004	1971 / 1994 / 2001	1987	1992 / 1993 / 2001	1983 / 1995 / 2003	1982 / 2013	2007 / 2015	1986 / 2007	-	2010	1983 / 2004	2010	2014	1993 / 1994 / 2014	1981 / 2015	1970 / 2005	1967 / 1984	1987 / 1999	1983 / 1988	1	1965	2001	1974 / 1998 / 2014 / 2015	1968	1963 / 1974 / 1987 / 2005	1	-	-	-	-	1982 / 2005
Year Designed	1956	1958	1958	1957	1974	1957	1967	1955	1956	1956	1978	1976	1977	1957	1956	1954	1956	1953	1956	1955	1957	1955	1959	1963	1956	1961	1950	1956	1954	1962	1963	1963	1963
Street Address	46 Nokomis Ave	64 Lakeshore Dr	66 Lakeshore Dr	25 Rockaway Ave	23 Rockaway Ave	21 Rockaway Ave	19 Rockaway Ave	17 Rockaway Ave	15 Rockaway Ave	13 Rockaway Ave	11 Rockaway Ave	9 Rockaway Ave	5 Rockaway Ave	23 Sioux Ave	19 Sioux Ave	17 Sioux Ave	15 Sioux Ave	13 Sioux Ave	11 Sioux Ave	9 Sioux Ave	7 Sioux Ave	5 Sioux Ave	3 Sioux Ave	469 Ramapo Valley Rd	461/465 Ramapo Valley Rd	92 Roosevelt Blvd	94 Roosevelt Blvd	96 Roosevelt Blvd	98 Roosevelt Blvd	100 Roosevelt Blvd	102 Roosevelt Blvd	104 Roosevelt Blvd	106 Roosevelt Blvd
Block/Lot	4504 9	4504 10	4504 11	4504 12	4504 13	4504 14	4504 15	4504 16	4504 17	4504 18	4504 19	4504 20	4504 22	4504 23	4504 24	4504 25	4504 26			4504 29	4504 30	4504 31	4504 32	4504 33		1606 1	1606 2	1606 3	1606 4	1606 5		1606 7	1606 8
Neighborhood	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake		3. Crystal Lake

EST. 1924

Boswell Engineering 330 Phillips Avenue South Hackensack, NJ 07606

	Comments	1989 - One story addition	1997 - Deck added to dwelling			•		•													
	Cesspool (Y/N)	>	А	Ν	N	Ь	Ν	Х													
Neignbornood 5: Crystal Lake	System Failures	-	Septic system running over rear yard	-	Septic disposal field is bleeding out and odorous																
Neigilbor	Year Repaired	1974 / 1983 / 1989	1980	1988 / 2009	2008	-	-	-													
	Year Designed	1959	1960	,	1966	1960	1961	1954													
	Street Address	108 Roosevelt Blvd	110 Roosevelt Blvd	112 Roosevelt Blvd	114 Roosevelt Blvd	116 Roosevelt Blvd	118 Roosevelt Blvd	62 Truman Blvd													
	Block/Lot	6	10	11	12	13	14	15	 				 		 				 		
	Bloc	1606	1606	1606	1606	1606	1606	1606													
	Neighborhood	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake	3. Crystal Lake													



Borough of Oakland Septic Problem Statement OK-1585 Neighborhood 4: Dogwood

					MEIGINO	Neiginbolliood 4. Dogwood		
Neighborhood	Block/Lot	s/Lot	Street Address	Year Designed	Year Repaired	System Failures	Cesspool (Y/N)	Comments
4. Dogwood	3801	43	61 Walton Ave	1961	2015		>	
4. Dogwood	3801	44	59 McNomee St	1960	1989 / 1998	-	Ν	
4. Dogwood	3801	45	57 McNomee St	1957	1987		Ν	
4. Dogwood	3801	46	55 McNomee St	1963	2007	-	Ν	
4. Dogwood	3801	47	53 McNomee St	1959	2003	Leakage caused polluted water	Ν	
4. Dogwood	3801	48	51 McNomee St	1958	2007		Ν	
4. Dogwood	3801	46	49 McNomee St	1958	-	•	Z	
4. Dogwood	3801	20	47 McNomee St	1957	2011	,	Z	
4. Dogwood	3801	51	43 McNomee St	1958	2006	•	Z	
4. Dogwood	3801	53	42 McNomee St	1954	1998	•	٨	
4. Dogwood	3801	54	44 McNomee St	1960	-	,	Z	
4. Dogwood	3801	22	48 McNomee St	1960	2012	•	N	
4. Dogwood	3801	99	50 McNomee St	1982	1984 / 1989 / 1995 / 2003	Heavy drainage and mud from front yard	Z	Also repaired in: 2005
4. Dogwood	3801	22	52 McNomee St	1958	-	Very bad septic odor	Ь	
4. Dogwood	3801	28	53 McNomee St	1961	2015	-	У	
4. Dogwood	3801	26		1960	1979 / 2005	•	Ν	2005 - New deck installed
4. Dogwood	3801	09	49 Walton Ave	1959	-	Cesspool overflow	Y	
4. Dogwood	3801	19	47 Walton Ave	1968	1993	Seepage tanks and seepage covers exposed	Ν	
4. Dogwood	3801	63	43 Walton Ave	1958	1965 / 1978 / 2004	Neighbors complianed of spectic odors	Ν	
4. Dogwood	3801	- 64	41 Walton Ave	1963	1995		Ν	2005 - Added a pool
4. Dogwood	3801	99	39 Walton Ave	1960	1989	Septic tank overflow	Ν	
4. Dogwood	3801	99	37 Walton Ave	1967	1997 / 1998		N	1998 - New septic system, 2004 - House addition
4. Dogwood	3804	3	20 Bannehr St	1959	-	•	Ь	
4. Dogwood	3804	4	22 Bannehr St	1957	1995	-	Ν	1995 - New kitchen and deck
4. Dogwood	3804	2	24 Bannehr St	1957	-	•	Х	-
4. Dogwood	3804	9	26 Bannehr St	1957	-	Laundry soap in storm drain	Y	•
4. Dogwood	3804	7	28 Bannehr St	1956	1975 / 1996 / 2015	Septic system overflowing on ground	У	1975 - Septic tanks put in
4. Dogwood	3804	8	30 Bannehr St	1959	1986 / 1998	Drainage and runoff from mound on 83 McNomee	Ν	1987 - Addition put onto existing house
4. Dogwood	3804	6	32 Bannehr St	1957	-	-	Х	•
4. Dogwood	3804	10	34 Bannehr St	1963	1998 / 2005	•	У	-
4. Dogwood	3804	11		1957	1972	-	N	•
4. Dogwood	3804	12	38 Bannehr St	1968	2009		N	
4. Dogwood	3804	13	40 Bannehr St	1958	1965 / 1982 / 1986	•	Υ	1965 - Septic tank installed



Neighborhood 4: Dogwood Borough of Oakland

Comments						1986 - Detached garage construction	2012 - Decking added					2012 - New System											1997 - Deck added to dwelling						1964 - Cesspool was replaced with septic tank			-	
Cesspool (Y/N)	Z	Ν	Z	Ν	Ь	λ	Υ	N	Ϋ́	λ	Ν	Ν	Ν	Y	Z	Z	>	Z	Z	Y	λ	Ν	Ь	λ	У	Ϋ́	·		Ь	•	Ν	Z	Z
System Failures		Septic tank overflow, ground always wet		Stream next to property polluted with septic	•	Terrible septic odor		Placed perforated drain pip across septic field																•	Sewage leakage onto ground causing health hazard						•		Water in the cellar
Year Repaired	2001 / 2003	1992 / 2007	1980	2003	-	1661	1974 / 2001	1998		1976 / 2006	1975 / 2004	2012	1973 / 1979 / 1996	1990	1982	1968	1988 / 2004 / 2005	1999	2003	•	1976 / 2015	1976 / 1987	-	1968	1982	1965	1977	1977 / 2008	1964 / 2010 / 2013	1990	-	•	
Year Designed	1968	1969	1956	1965	1958	1958	1952	1959	1959	1959	1959	1961	1963	1959	1959	1960	1960	1961	1959	1959	1959	1961	1963	1952	1952	1	•	1951	1953	1948	1968	1976	1966
Street Address	42 Bannehr St	44 Bannehr St	246 Ramapo Valley Rd	8 Dogwood Dr	16 Dogwood Dr	24 Dogwood Dr	238 Ramapo Valley Rd	44 Dogwood Dr	32 Dogwood Dr	38 Dogwood Dr	50 Dogwood Dr	124 Mandigo Ave	125 Mandigo Ave	58 Dogwood Dr	64 Dogwood Dr	70 Dogwood Dr	46 Hickory Dr	52 Hickory Dr	58 Hickory Dr	62 Hickory Dr	68 Hickory Dr	74 Hickory Dr	198 Ramapo Valley Rd	194 Ramapo Valley Rd	8 & 10 Grove St	14 Grove St	18 Grove St	22 Grove St	26 Grove St	30 Grove St	34 Grove St	40 Grove St	42 Grove St
Block/Lot	3804 14	3804 15	3501 1	3501 2	3501 3	3501 4	3501 5	3501 6	3501 7	3501 8	3501 9	3501 10	3501 11	3501 12	3501 13		3501 15	3501 16	3501 17	3501 18	3501 19	3501 20	3401 1	3401 2	3401 3	3401 4	3401 5	3401 6		3401 8	3401 9	3401 10	3401 12
Neighborhood	4. Dogwood	4. Dogwood																	4. Dogwood														

EST.

Boswell Engineering 330 Phillips Avenue South Hackensack, NJ 07606

Borough of Oakland Septic Problem Statement OK-1585 Neighborhood 4: Dogwood

	S																							
	Comments		•	•	•	•	•	-	-	•	•	•	•	-										
	Cesspool (Y/N)		N	N	Ν	Ν	Ν	А	А	Х	Х	-	N	N										
Neighbolhou 4. Dogwood	System Failures		New septic system overflows when doing laundry	-						-			Septic running down driveway											
INCIDINO	Year Repaired	1987 / 1999	1999 / 2014 / 2015	-	2008	1984 / 2014	1976 / 1999 / 2015	2004	2008	1992	-	-	1987 / 1998 / 2012	1970 / 1975 / 2002 / 2013										
	Year Designed	1968	1977	1955	1955	1955	1955	1956	1964	1964	1954	1986 / 1989	1961	1953										
	Street Address	44 Grove St	48 Grove St	52 Grove St	56 Grove St	60 Grove St	64 Grove St	70 Grove St	74 Grove St	80 Grove St	84 Grove St	86 Grove St	88 Grove St	90 Grove St										
	Block/Lot	13	14	15	16	17	18	20	21	22	23	24	25	26				 	 					
	Bloc	3401	3401	3401	3401	3401	3401	3401	3401	3401	3401	3401	3401	3401										
	Neighborhood	4. Dogwood	4. Dogwood	4. Dogwood	4. Dogwood	4. Dogwood	4. Dogwood	4. Dogwood	4. Dogwood	4. Dogwood	4. Dogwood	4. Dogwood	4. Dogwood	4. Dogwood										



Borough of Oakland

veignboi nood 5: Downtown

Comments	Columbia Bank	Starbucks	Walgreens	Current 1706 7-8 (Lots behind Walgreens)	Current Walgreens & Parking	Current Walgreens Parking	Tony's Brothers (Lukas)							Horse Farm	84 Lumber				1972 - Removed Cesspool														
Cesspool (Y/N)	Z	N	Z	У	У	N	У	У	У	Ν	У	Υ	У	У	Z	N	Ν	Z	У	У	У	У	N	N	N	У	γ	Υ	У	У	У	Ν	>
System Failures					Old shopping plaza next to Tony's Brothers	Old shopping plaza next to Tony's Brothers	1999 - Pit overflow																										
Year Repaired		2015	2008	1969 / 1998	1981 / 1984		1966 / 1989 / 1999	1978 / 1997	1985	-	1989	1966 / 1977 / 2011	1971 / 1982 / 1985 / 1991	1968 / 1978 / 1989 / 1997	2008	1997	1985	1984	1972 / 1989	1962 / 1972 / 2001	1964 / 1988	1963 / 1998	1989	-	2002	1972 / 1985	1969 / 1979 / 1988 / 2002	1965 / 1989	1960 / 1999	1973 / 1999	1977 / 1986	-	1973 / 1984
Year Designed	2008	2008	1961	1960	1960 - 1964	2008	1958	1948	1962	1966	1961	1953	1966	1950	1976	1987	1984	1978	1951	1951	1951	1951	1981	1983	-	1951	1951	1951	1951	1954	1964	1972	1965
Street Address	413 Ramapo Valley Rd	411 Ramapo Valley Rd	409 Ramapo Valley Rd	OLD Block and Lot	OLD Block and Lot		20 West Oakland Ave	15 Terhune St	11 Terhune St	373 Ramapo Valley Rd	357 Ramapo Valley Rd	6-14 Elm St	20 Elm St	127 McCoy Rd	18 Raritan Rd	21 Raritan Rd	17 Raritan Rd	13 Raritan Rd	11 Wellesley Dr	9 Wellesely Dr	7 Wellesely Dr	5 Wellesely Dr	3 Wellesely Dr	14 Mt. Holyoke Dr	16 Barnard Dr	20 Barnard Dr	22 Barnard Dr	24 Barnard Dr	9 Vassar Pl	7 Vassar Pl	6 & 12 Franklin Ave	20 Franklin Ave	391 Ramapo Valley Rd
Block/Lot	2	2.01	3	3/4	5.02	4	9	2	3	4	2	9	7	4/5	2	3	9	7	1	2	3	4	5	6	7	8	6	10	11	12	1	2	_
Bloc	1706	1706	1706	2303.01	2303.01	1706	1706	1802	1802	1802	1802	1802	1802	4004	4004	4004	4004	4004	4403	4403	4403	4403	4403	4403	4403	4403	4403	4403	4403	4403	4404	4404	1708
Neighborhood	5. Downtown	5. Downtown	5. Downtown	5. Downtown	5. Downtown	5. Downtown	5. Downtown	5. Downtown	5. Downtown	5. Downtown	5. Downtown	5. Downtown	5. Downtown	5. Downtown	5. Downtown	5. Downtown	5. Downtown	5. Downtown	5. Downtown	5. Downtown	5. Downtown	5. Downtown	5. Downtown	5. Downtown	5. Downtown	5. Downtown	5. Downtown	5. Downtown	5. Downtown	5. Downtown	5. Downtown	5. Downtown	5. Downtown

1924

Boswell Engineering 330 Phillips Avenue South Hackensack, NJ 07606

Borough of Oakland Septic Problem Statement OK-1585 Neighborhood 5: Downtown

Comments	1963 - Removed Cesspool	1976 - Removed Cesspool																			
Cesspool (Y/N)	Ь	А	А	У	N	N	А	А	А												
System Failures				1969 - Septic overflow																	
Year Repaired	1957 / 1963 / 2013	1959 / 1968 / 1976	1974 / 2007	1969 / 2015	1975 / 1991	•	2001	1974 / 1998	1980 / 1989												
Year Designed	1949	1948	1954	1957	1964	1985	1963	1956	1962												
Street Address	383 Ramapo Valley Rd	379 Ramapo Valley Rd	12 Terhune St	326 Ramapo Valley Rd	330 Ramapo Valley Rd	11 East Oak St	469 Ramapo Valley Rd	461-465 Ramapo Valley Rd	4 Court House Pl												
Block/Lot	3	4	5	85	98	87	33	34	36	 	 	 									
Bloc	1708	1708	1708	3903	3903	3903	4204	4204	4204												
Neighborhood	5. Downtown	5. Downtown	5. Downtown	5. Downtown	5. Downtown	5. Downtown	5. Downtown	5. Downtown	5. Downtown												



Borough of Oakland Septic Problem Statement OK-1585 Neighborhood 6: Heights

					Milipi	Neighboillood o. Heights		
Neighborhood	Block/Lot	/Lot	Street Address	Year Designed	Year Repaired	System Failures	Cesspool (Y/N)	Comments
6. Heights	5204	1	4 Oneida Ave	1954	1960 / 1991 / 2007 / 2008	Septic water surfacing onto ground	>-	1991 - Cesspool replaced with septic tank
6. Heights	5204	2	6 Oneida Ave	1957	1970 / 2010 / 2011	•	N	
6. Heights	5204	3	8 Oneida Ave	1957	1980	•	А	2012 - Room renovations
6. Heights	5204	4	10 Oneida Ave	1958	1964 / 2012	,	Z	,
6. Heights	5204	5	12 Oneida Ave	1956	1972 / 1987		N	
6. Heights	5204	9	14 Oneida Ave	1958	1988	Overflowing sewage disposal system	Υ	,
6. Heights	5204	7	16 Oneida Ave	1959	1987 / 2006	Odors in catch basin in front of dwelling	>	,
6. Heights	5204	8	18 Oneida Ave	1958	-		Ь	
6. Heights	5204	6	20 Oneida Ave	1953	9/61	•	А	•
6. Heights	5204	10	22 Oneida Ave	1957	0/61	•	Z	
6. Heights	5204	11	24 Oneida Ave	-	1984	,	Z	,
6. Heights	5204	12	28 Oneida Ave	1961	2014	,	λ	,
6. Heights	5204	13	32 Oneida Ave	1959	5006	•	Υ	
6. Heights	5204	14	17 Iroquois Ave	1958	-		Ь	
6. Heights	5204	15	13 Iroquois Ave	1956	1861		А	
6. Heights	5204	16	11 Iroquois Ave	1964	-		Ν	•
6. Heights	5204	17	7 Iroquois Ave	1958	2011 / 2015	,	Z	,
6. Heights	5204	18	5 Iroquois Ave	1958	2000 / 2002 / 2008	Overflowing septic system	N	2005 - Additional second level 3 bedrooms & 2 baths
6. Heights	5204	16	165 Hiawatha Blvd	1971	2004		Ν	•
6. Heights	5204	20	163 Hiawatha Blvd	1959	-	•	N	•
6. Heights	5204	21	159 Hiawatha Blvd	1957	-	•	N	•
6. Heights	5204	22	157 Hiawatha Blvd	1961	-	•	У	•
6. Heights	5204	47	137 Hiawatha Blvd	1958	•	•	N	
6. Heights	5204	48	135 Hiawatha Blvd	1963	2009	•	У	
6. Heights	5204	49	23 Seneca Ave	1958		-	\	
6. Heights	5204	20	21 Seneca Ave	1956	1970 / 1991	•	У	
6. Heights	4803	1	46 Calumet Ave	1957	2004 / 2006 / 2008	-	Ν	2006 - New kitchen / 2008 - Pool installed
6. Heights	4803	2	48 Calumet Ave	1963	1989 / 2003	•	N	
6. Heights	4803	3	52 Calumet Ave	1955	1974 / 1983 / 2004 / 2005	-	У	-
6. Heights	4803	5	58 Calumet Ave	1963	1995	-	Z	
6. Heights	4803	9	60 Calumet Ave	•	1985 / 1987	Someone dumped junk on property, it stinks	Z	
6. Heights	4803	7	66 Calumet Ave	1956	1987		Z	
6. Heights	4803	8	68 Calumet Ave	1958	_	-	Υ	2010 - Bathroom addition and remodel



Borough of Oakland Septic Problem Statement OK-1585 Neighborhood 6: Heights

	Comments		•			•								•			•	•	1997 - New septic tank installed					•							•			
	Cesspool (Y/N)	N	N	У	У	У	Ь	N	γ	Y	У	Ь	>	У	Z	Z	-	У	Y	Z	>	>	Ь	У	У	У	У	>	Z	У	У	N	У	
HIGGA V. Heights	System Failures	Previous owner built patio over septic field					Water in backyard	System overflow				•	•	•	Washing water runs over driveway					1	Septic water running onto the street	Septic water running onto the street	•		Septic installation caused heavy runoff clogging drain			1	-		1977 - System Malfunction		-	
MINITER	Year Repaired	1979	2004	1972 / 2004	2004	1971 / 1987 / 2007	•	1980 / 1999	2005	1992	1981			1969 / 2002	1985 / 2000 / 2015	1987 / 1990 / 1994 / 2006	1984 / 1985	1966 / 1997	1997	•	1967 / 2000 / 2001	1980		1975 / 1979	1985 / 2009	1980 / 2009	2009	1996	1994	1977 / 2012	1970 / 1977	2006	1968 / 2002	
	Year Designed	1956	1959	1956	1958	1959	1965	-	0961	1961	1957	1959	1957	1954	1957	-	-	1956	1956	1969	1958	1957	1958	1956	1956	1954	1957	1957	1958	1956	1957	1963	1958	
	Street Address	70 Calumet Ave	72 Calumet Ave	74 Calumet Ave	78 Calumet Ave	80 Calumet Ave	84 Calumet Ave	144 Hiawatha Blvd	146 Hiawatha Blvd	148 Hiawatha Blvd	131 Seminole Ave	127 Seminole Ave	123 Seminole Ave	72 Seminole Ave	74 Seminole Ave	11 Lehigh Way	76 Seminole Ave	78 Seminole Ave	82 Seminole Ave	84 Seminole Ave	86 Seminole Ave	88 Seminole Ave	92 Seminole Ave	96 Seminole Ave	98 Seminole Ave	102 Seminole Ave	104 Seminole Ave	106 Seminole Ave	110 Seminole Ave	120 Seminole Ave	122 Seminole Ave	124 Seminole Ave	126 Seminole Ave	
	Block/Lot	4803 9	4803 10	4803 11	4803 12	4803 13	4803 14	4803 20			4803 23				4804 2	4804 3	4804 4	4804 5	4804 7	4804 8	4804 9	4804 10	4804 11	4804 12	4804 13	4804 14	4804 15	4804 16	4804 17		4804 23	4804 24	4804 25	
	Neighborhood	6. Heights	6. Heights						6. Heights	6. Heights			6. Heights		6. Heights	6. Heights	6. Heights	6. Heights	6. Heights	6. Heights	6. Heights		6. Heights	6. Heights	6. Heights					6. Heights	6. Heights	6. Heights		



Borough of Oakland Septic Problem Statement OK-1585 Neighborhood 7: Indian Hills

F											ı			T	T		I				T		T	1	T	T	T				,	•		
	Comments	•	•			•		1992 - Septic tank installed		·		•	•						·			Holding tank						•	•	•	•			•
	Cesspool (Y/N)	А	λ	λ	λ	λ	>	>	\	>	Z	N	Z	Z	Z	Z	>	>-	>	λ	>	Z	Z	Z	Z	/	Z	N	Z	N	Т	Ν	Ν	Z
IOOU 7. III'UIUI IIII'S	System Failures	-	Overflowing septic system	-		-	Septic water discharging from pipe in rear yard	_	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-		Water runs onto the street	-	'
INCIDITION	Year Repaired	1981 / 1989 / 2014	1970 / 1971	1965	1967 / 1989	1989	1963 / 1992	1961 / 1992	1995	2000 / 2001	1983	1986	2015	1970 / 1997 / 1999	1971	1968	1983	1964 / 1992	1994	1661	2012	1970	1977 / 1981		1983 / 1986		1984 / 1999	-	2001	1986 / 1996 / 2006	-	1995 / 2008	-	1962 / 1986 / 2005
	Year Designed	1959	1960	1960	1959	1960	1959	1959	1959	1959	1955	1956	1956	1956	1955	1955	1959	1959	1959	1959	1959	1969	1965	1965	,	1950	1965	1958	1957	-	1958	1959	1961	1958
	Street Address	63 Hopper St	57 Hopper St	51 Hopper St	45 Hopper St	41 Hopper St	33 Hopper St	27 Hopper St	21 Hopper St	15 Hopper St	11 Hopper St	7 Hopper St	3 Hopper St	6 Hopper St	10 Spear St	14 Spear St	20 Spear St	26 Spear St	32 Spear St	38 Spear St	44 Spear St	15 Yawpo Ave	19 Yawpo Ave	25 Yawpo Ave	43 Yawpo Ave	41 Yawpo Ave	47 Yawpo Ave	51 Yawpo Ave	53 Yawpo Ave		61 Yawpo Ave	63 Yawpo Ave	65 Yawpo Ave	69 Yawpo Ave
	/Lot	1	2	3	4	2	9	7	8	6	10	11	12	13	14	15	16	17	18	19	20	_	2	3	4	2	9	7	8	6	11	12	13	14
	Block/Lot	3702	3702	3702	3702	3702	3702	3702	3702	3702	3702	3702	3702	3702	3702	3702	3702	3702	3702	3702	3702	3902	3902	3902	3902	3902	3902	3902	3902	3902	3902	3902	3902	3902
	Neighborhood	7. Indian Hills	7. Indian Hills	7. Indian Hills	7. Indian Hills	7. Indian Hills	7. Indian Hills	7. Indian Hills	7. Indian Hills	7. Indian Hills	7. Indian Hills	7. Indian Hills	7. Indian Hills	7. Indian Hills	7. Indian Hills	7. Indian Hills	7. Indian Hills	7. Indian Hills	7. Indian Hills	7. Indian Hills	7. Indian Hills	7. Indian Hills	7. Indian Hills	7. Indian Hills	7. Indian Hills	7. Indian Hills	7. Indian Hills	7. Indian Hills	7. Indian Hills	7. Indian Hills	7. Indian Hills	7. Indian Hills	7. Indian Hills	7. Indian Hills



Borough of Oakland Septic Problem Statement OK-1585 Neighborhood 7: Indian Hills

ISTA 1924

Boswell Engineering 330 Phillips Avenue South Hackensack, NJ 07606

Borough of Oakland Septic Problem Statement OK-1585 Neighborhood 7: Indian Hills

	Comments	•		1998 - New System																
	Cesspool (Y/N)	>	γ	Υ	Z	Z														
Neighborhood 7. Illulah illing	System Failures	-			•	1988/1999 - Septic odors, no overflow														
I CIDOLINI	Year Repaired	1998	1991	1962 / 1998	1998 / 2002 / 2006	1977														
	Year Designed	1958	1956	1957	1961	1969														
	Street Address	107 Yawpo Ave	105 Yawpo Ave	103 Yawpo Ave	101 Yawpo Ave	99 Yawpo Ave														
	Block/Lot	18	16	20	21	22														
	Bloc	4101	4101	4101	1014	4101														L_
	Neighborhood	7. Indian Hills	7. Indian Hills	7. Indian Hills	7. Indian Hills	7. Indian Hills														



Borough of Oakland Septic Problem Statement OK-1585 Neighborhood 8: Industrial Park

Comments		•			Also repaired in: 2005			•			•	Also repaired in: 2005	Also repaired in: 2014					2008 - Septic tank installed				•	2008 - Kitchen addition	•			•					-	
Cesspool (Y/N)	Z	N	N	Ν	У	N	N	N	N	N	N	Υ	N	Z	Z	N	Ь	У	У	У	У	У	У	У	У	Υ	У	У	N	N	У	N	Х
System Failures		•	•	Odor coming from floor drains in restrooms	•		•	•	•	•	•		Sewage odors in basement			•		•	Terrible septic odor	•	•	Overflowing sewage causing health hazard			•	Septic malfunction, ponding over seepage pit	•	Sewage leakage in front lawn is a health hazard	•				
Year Repaired	1986 / 2002 / 2003	1979 / 2013	1998 / 2007 / 2013	1999 / 2000	9661/8/61/2/61/9/61	1661 / 3/61	1661 / 0661	1987	1985 / 1987	2003	1984 / 1986	1990 / 2000 / 2003 / 2004	1973 / 1979 / 2000 / 2001	2000 / 2001	8661/3661/2261/9261	1977 / 2008	-	1987 / 2006 / 2008	1976 / 1986 / 2012	1987	9/61	1973 / 1978	1996 / 2008	1982 / 1997	161	1988	-	9661 / 6861	-	-	1966 / 1997	1	1978 / 1989 / 2000
Year Designed	1975	1979	1979	1976	1970	1966	1969	-	-	1972	-	1974	1966	,	,	-	1957	1957	1957	1957	1957	1956	1956	1956	1957	1957	1961	1962	1968	1968	1958	1959	1963
Street Address	7 Wright Way	16 Thornton Rd	12 Thornton Rd	8 Thornton Rd	103 Bauer Drive	99 Bauer Drive	95 Bauer Drive	215 Long Hill Rd	199 Long Hill Rd	193 Long Hill Rd	187 Long Hill Rd	181 Long Hill Rd	100 Bauer Drive	104 Bauer Drive	112 Bauer Drive	118 Bauer Drive	169 Page Dr	167 Page Dr	165 Page Dr	163 Page Dr	161 Page Dr	159 Page Dr	159 Page Dr	155 Page Dr	153 Page Dr	151 Page Dr	149 Page Dr	147 Page Dr	145 Page Dr	143 Page Dr	137 Page Dr	10 Fox Ct	12 Fox Ct
Block/Lot	3201 1	3201 2	3201 3	3201 4	3201 5	3201 6	3201 7	3201 9	3201 12	3201 13	3201 14	3201 15	3204 2	3204 3	3204 4	3204 5	3601 1	3601 2	3601 3	3601 4	3601 5	3601 6	3601 7	3601 8	3601 9	3601 10	3601 11	3601 12	3601 13	3601 14	3601 15	3601 16	3601 17
Neighborhood	8. Industrial Park	8. Industrial Park	8. Industrial Park	8. Industrial Park	8. Industrial Park	8. Industrial Park	8. Industrial Park	8. Industrial Park	8. Industrial Park	8. Industrial Park	8. Industrial Park	8. Industrial Park	8. Industrial Park	8. Industrial Park	8. Industrial Park	8. Industrial Park	8. Industrial Park	8. Industrial Park	8. Industrial Park	8. Industrial Park	8. Industrial Park	8. Industrial Park	8. Industrial Park	8. Industrial Park	8. Industrial Park	8. Industrial Park	8. Industrial Park	8. Industrial Park	8. Industrial Park	8. Industrial Park	8. Industrial Park	8. Industrial Park	8. Industrial Park

1924

Boswell Engineering 330 Phillips Avenue South Hackensack, NJ 07606

Borough of Oakland Septic Problem Statement OK-1585 Neighborhood 8: Industrial Park

	Comments		1973 - Septic tank installed			1971 - Septic tank installed	1971 - Septic tank installed	1974 - Septic tank installed	1968 - Septic tank installed															•	•					
	Cesspool (Y/N)	Y	У	N	N	λ	λ	λ	λ	λ	λ	N	N	λ	N	Х	Ν	N	Ν	Ν	Ν	Ь	N	N	N	N				
Neighborhood o. madathair ain	System Failures		•	•	•	•	•	,	•		,	•		•		•	•	2 open wells on vacant property	•	•	-	•	•	•	•	-				
Neighbon	Year Repaired	2004	1973 / 1991 / 2015	-	2010	1971 / 2002 / 2003	1971 / 2000	1963 / 1974 / 1987 / 2003	1968	1973 / 1987	1982 / 2003	1992 / 2011 / 2012	1994 / 2015	1974 / 1995	1976 / 1986 / 2002	1989	1989 / 2004 / 2005	2001 / 2002 / 2003	1986 / 1998 / 2001 / 2006	2009	1983	-	1981	-	2006	1991				
	Year Designed	1960	1962	1960	1960	1958	1958	1957	1958	1958	1958	-	1970	1949	1975	1955	1	-	1978	1958	1960	1957	1958	1954	1973	1973				
	Street Address	15 Fox Ct	11 Fox Ct	129 Page Dr	125 Page Dr	120 Dogwood Dr	126 Dogwood Dr	132 Dogwood Dr	138 Dogwood Dr	144 Dogwood Dr	150 Dogwood Dr	206 Long Hill Rd	210 Long Hill Rd	8 Breakneck Rd	20 Breakneck Rd	44 Breakneck Rd	48 Breakneck Rd	8 Breakneck Rd	100 Breakneck Rd	122 Breakneck Rd	126 Breakneck Rd	134 Breakneck Rd	140 Breakneck Rd	146 Breakneck Rd	150 Breakneck Rd	162 Breakneck Rd				
	Block/Lot		01 19										01 3					01 8		01 11	01 12		01 14	01 15	01 16	01 17	 	 	 	
	Neighborhood	8. Industrial Park 3601	8. Industrial Park 3601	8. Industrial Park 3601				8. Industrial Park 3601			8. Industrial Park 3601	8. Industrial Park 3101	8. Industrial Park 3101	8. Industrial Park 3101		8. Industrial Park 3101		8. Industrial Park 3101	8. Industrial Park 3101	8. Industrial Park 3101	8. Industrial Park 3101	8. Industrial Park 3101	8. Industrial Park 3101	8. Industrial Park 3101		8. Industrial Park 3101				



Borough of Oakland Septic Problem Statement OK-1585 Neighborhood 9: Longhill

Comments				2006 - Finished basement with additional bedroom		2006 - Sunroom addition	2005 - Finished basement added																										
Cesspool (Y/N)	У	Ν	Ν	Ν	Ν	Ν	Ν	Ν	Ν	Ν	У	Z	Ν	Z	Z	Ν	Ν	Z	>	Z	Z	Z	Ν	N	Ν	Ν	Ν	Z	У	Ν	Ν	N	У
System Failures														Septic is running onto surface of ground		Septic overflow						Bed area not graded and seeded, bad odor from septic	Odors in catch basin, wet basement, dry wells							•			
Year Repaired	1971 / 1988	2006	1968	2006 / 2007	2012 / 2013	1999 / 2004	2006	2004 / 2005	2004	2014	2004 / 2010 / 2011	1993	2009	1975 / 2011 / 2012	1971 / 1996 / 2015	-	2008	2003	1985	,	1993	1974 / 1993 / 2012	1985 / 2009	1984 / 1985 / 2006 / 2013	1979	1989	1988 / 1989	1976 / 1978 / 1988 / 2006	1969 / 2006	1979 / 2004	2002 / 2003 / 2006	1982 / 1996	1975 / 2004 / 2005
Year Designed	1954	1960	1961	-	-	1963	-	-	1980	1968	1974	1961	1963	1963	1964	1969	1965	-	1955	1967	8961	8961	1969	1969	1968	1968	-	-	-	-	1961	1965	1956
Street Address	55 Long Hill Rd	59 Long Hill Rd	51 Long Hill Rd	10 Ponds Way	13 Ponds Way	31 Long Hill Rd	9 Ponds Way	5 Ponds Way	15 Long Hill Rd	50 Long Hill Rd	62 Long Hill Rd	70 Long Hill Rd	74 Long Hill Rd	78 Long Hill Rd	86 Long Hill Rd	94 Long Hill Rd	100 Long Hill Rd	104 Long Hill Rd	20 Martha Pl	30 Martha Pl	4 Stone Fence Rd	10 Stone Fence Rd	16 Stone Fence Rd	22 Stone Fence Rd	28 Stone Fence Rd	36 Stone Fence Rd	38 Stone Fence Rd	40 Stone Fence Rd	91 Martha Pl	89A Martha Pl	89 Martha Pl	83 Martha Pl	79 Martha Pl
Block/Lot)1 44)1 45		11 47)1 48)1 50)1 53)1 3)1 5)1 9)1 10	11)1 12)1 13)1 14)1 15	16)1 18	10)1 20)1 41)1 42		
Neighborhood	9. Longhill 3401	9. Longhill 3401	9. Longhill 3401		9. Longhill 3401			9. Longhill 3401		9. Longhill 2801				9. Longhill 2801	9. Longhill 2801	9. Longhill 2801	9. Longhill 2801	9. Longhill 2801		9. Longhill 2801							9. Longhill 2801					9. Longhill 2801	9. Longhill 2801

EST.

Boswell Engineering 330 Phillips Avenue South Hackensack, NJ 07606

Borough of Oakland Septic Problem Statement OK-1585 Neighborhood 9: Longhill

Comments			-				2010 - Hot tub installed																			
Cesspool (Y/N)	Z	N	Z	N	Z	Z	N	N	N	N	Z	Z	N	Z	Z	Z	λ	Z								
System Failures	Septic overflowing into street	-	-	•	-	-	•	Septic overflow on front yard	•	-	-	-	-	-	-		-	-								
Year Repaired	1996 / 2006	1985 / 2003	1985 / 2000 / 2007	2005	1984 / 1985 / 1990	1983 / 1984 / 2002	1983 / 1993 / 2010	1996	-	1984 / 1985	1975	1986 / 2014	1990	1974 / 1987	1972 / 1986 / 2014	1984	1972	1999								
Year Designed	,	-	•	-	•	•	-	-	1983	-	1966	1965	-	1965	,	1953	,	1								
Street Address	67 Long Hill Rd	23 Thornton Rd	19 Thornton Rd	Rear Thornton Rd	12 Wright Way	8 Wright Way	169 Long Hill Rd	163 Long Hill Rd	151 Long Hill Rd	149 Long Hill Rd	147 Long Hill Rd		137 Long Hill Rd	133 Long Hill Rd	129 Long Hill Rd	123 Long Hill Rd	115 Long Hill Rd	111 Long Hill Rd								
Block/Lot	3301 1	3301 3	3301 4	3301 5			3301 9			3301 13	3301 14			3301 18	3301 20	3301 21	3301 22		 	 	 	,,,,,,,,,,,,	 ,,,,,,,,,,,,	 ***************************************	 	
Neighborhood	9. Longhill	9. Longhill	9. Longhill	9. Longhill	9. Longhill	9. Longhill	9. Longhill	9. Longhill	9. Longhill	9. Longhill	9. Longhill	9. Longhill	9. Longhill	9. Longhill	9. Longhill	9. Longhill	9. Longhill	9. Longhill								



Borough of Oakland Septic Problem Statement OK-1585 Neighborhood 10: Manito

Comments								-		-	-	•	-			•												2015 - New System			-	-	•
Cesspool (Y/N)	>	>	>	Z	Т	Α	>	>-	/	\	>-	Y	\	Z	Y	λ	Α	Z	Z	Z	Z	Z	Z	Α	А	>	λ	Z	N	У	N	У	Z
System Failures			1979 - System overflow	1985 - System overflow					•		1973 - System overflow	1980 - Cesspool in front yard collapsed	1967 - System overflow	1976 - System Malfunciton	•	1987 - Septic installed within 10ft from propertly line								1955 - Cesspool overflow					-				
Year Repaired	1983 / 1989 / 1998	1984 / 2013	1979 / 1983 / 1992	1985	1661 / 6961	1963 / 1986 / 1988	1989 / 1993	1970 / 1986	,	1974	1986	1980 / 2000	1968 / 1974 / 1990 / 1997	1991 / 2004	-	1861 / 8261	1984	-	1983 / 2012	7004	1987	1985 / 2003	1661 / 2014	1955 / 1967 / 1994 / 2013	1961 / 1971 / 2004	1972 / 1996 / 1999	1970 / 1984 / 1998 / 2003	2015	1974 / 1988	1968 / 1970 / 2011	•	2003	8661 / 0861
Year Designed	1957	1957	1958	1963	1958	1958	1958	1960	1960	1959	1961	1961	1959	1961	1963	1963	1964	1963	1965	1964	1963	1963	1963	1953	1951	1956	1955	1955	1958	1955	1955	1961	1962
Street Address	38 Monhegan Ave	42 Monhegan Ave	44 Monhegan Ave	46 Monhegan Ave	48 Monhegan Ave	50 Monhegan Ave	52 Monhegan Ave	92 Manito Ave	96 Manito Ave	102 Manito Ave	108 Manito Ave	112 Manito Ave	118 Manito Ave	124 Manito Ave	14 Cayuga Ave	13 Massasoit Trail	9 Massasoit Trail	5 Massasoit Trail	3 Massasoit Trail	1 Massasoit Trail	4 Massasoit Trail	8 Massasoit Trail	12 Massasoit Trail	76 Pawnee Ave	78 Pawnee Ave	80 Pawnee Ave	82 Pawnee Ave	84 Pawnee Ave	86 Pawnee Ave	88 Pawnee Ave	90 Pawnee Ave	92 Pawnee Ave	
Block/Lot	5004 10	5004 11	5004 12	5004 13	5004	5004 15	5004 16	5004 17	5004 18	5004 19					5004 24			5004 27	5004 28	5004 29		5004 31	5004 32	5401 10	5401	5401 12	5401 13	5401 14	5401 15	5401 16	5401	5401 18	5401 19
Neighborhood	10. Manito	10. Manito				10. Manito	10. Manito								10. Manito		10. Manito							10. Manito	10. Manito		10. Manito	10. Manito			10. Manito	10. Manito	



Borough of Oakland Septic Problem Statement OK-1585 Neighborhood 10: Manito

	Cesspool (Y/N)	- N		·		- N	\	- λ	- N	·	- N	- N	·	- N	·	·				- N		- N	- N	- N	- N		- N	\	- N	- N	- N	- N	nk N -	
Ullioud IV. Maillitu	System Failures		-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-	-		-	-	-	-	-	Sewage on front lawn coming from leaking septic tank	Sewage on front lawn coming from leaking septic tank
Meldillo	Year Repaired	1986	1970 / 2004	1979	1959 / 2007 / 2010	2013		1972 / 1994	1965 / 2009	1979 / 2002 /	1989	1989 / 2012	1999	1988	1993 / 2004	1970 / 2009	1990	1973 / 1982 / 2005	2001 / 2015	1978 / 2015	1978	1970	1974 / 1981	1980	-	-	1978 / 2009		2001	1982	1979 / 1983	-	1973 / 1985 / 1989	1967 / 1985 / 2003
	Year Designed	1958	1957	1955	1955	1957	1957	1956	1958	1956	1958	1958	1961	1957	1957	1957	1960	1959	1958	1960	1957	1958	1960	1960	1958	1953	9561	1958	6961	1954	-	1968	1967	1956
	Street Address	98 Pawnee Ave	110 Pawnee Ave	112 Pawnee Ave	114 Pawnee Ave	118 Pawnee Ave	71 Monhegan Ave	69 Monhegan Ave	67 Monhegan Ave	65 Monhegan Ave	63 Monhegan Ave	85 Manito Ave	81 Manito Ave	79 Manito Ave	23 Wenonah Ave	21 Wenonah Ave	19 Wenonah Ave	17 Wenonah Ave	13 Wenonah Ave	98 Minnehaha Blvd	100 Minnehaha Blvd	102 Minnehaha Blvd	106 Minnehaha Blvd	672 Ramapo Valley Rd	674 Ramapo Valley Rd	676 Ramapo Valley Rd	680 Ramapo Valley Rd	686 Ramapo Valley Rd	688 Ramapo Valley Rd	690 Ramapo Valley Rd	692 Ramapo Valley Rd	694 Ramapo Valley Rd	698 Ramapo Valley Rd	702 Ramapo Valley Rd
	Block/Lot	5401 20	5401 25	5401 26				5401 30	5401 31	5401 32				5401 37	5201 14	5201 15	5201 16	5201 17	5201 18	5201 19	5201 20	5201 21		5201 23	5201 24	5201 25	5201 27	5201 28		5201 30	5201 31	5201 32	5201 33	
	Neighborhood	10. Manito	10. Manito	10. Manito	10. Manito	10. Manito	10. Manito	10. Manito	10. Manito	10. Manito	10. Manito	10. Manito	10. Manito	10. Manito	10. Manito	10. Manito	10. Manito	10. Manito	10. Manito	10. Manito	10. Manito	10. Manito	10. Manito	10. Manito	10. Manito	10. Manito	10. Manito	10. Manito	10. Manito	10. Manito	10. Manito	10. Manito	10. Manito	10. Manito

EST. 1924

Boswell Engineering 330 Phillips Avenue South Hackensack, NJ 07606

Borough of Oakland Septic Problem Statement OK-1585

Neighborhood 10: Manito

Comments																											
Cesspool (Y/N)	У																										
System Failures	-																										
Year Repaired	1979 / 2005																										
Year Designed	1955																										
Street Address	6 Pawnee Ave																										
Lot	35	1	_	1	_	1	1	1	1	1	1	1	1	_	1	1	_	1	1	_			1	1			
Block/Lot	5201	 																			 	 		 	 	 	
Neighborhood	10. Manito																										



Borough of Oakland Septic Problem Statement OK-1585 Neighborhood 11: Mirror Lake

								1												ī				ī	ī	ī	ī						
Comments		Subdivision	Subdivision			Subdivision / (Scardo's Spring onsite)															2005 - Replace both tanks and outlet pipes		2003 - New Septic, Removed Cesspool	1998 - New system / 2006 - Disposal field moved	2001 - Entire new system	-	1998 - New disposal field	1998 - New Septic, Removed Cesspool	2001 - New system			1971 - Cesspool Removed	
Cesspool (Y/N)	Z	Z	N	N	N	Z	Z	N	Z	Z	N	Υ	У	Υ	Y	Υ	-	Υ	Υ	Y	N	N	Υ	N	N	N	N	Υ	N	N	N	Υ	N
System Failures			1987 - System Malfunction																		5/11/89 Storm drains picking up septic. 6/21/89 No			1998 - Septic system overflowing onto ground		•						2009 - Water intrusion into septic	-
Year Repaired	1969 / 2009	1986 / 2013	1985	2001 / 2014	•	2004 / 2006	•	2000	1991	2014	1988	1999	2004	1989	•	1972 / 1986	2000 / 2014	1975 / 1999 / 2007	2004	-	2005	•	2003	1998 / 2006	1977 / 2001	1978	1978 / 1998	1998	2001	1971 / 1994	1993	1971 / 2009 / 2013	1968 / 2002
Year Designed	1959	1983	1983	1973	1959	1974	1984	1963	1962	1973	1973	1961	1961	1961	1961	1961	-	1	1961	1961	1966	1959	-	-	1963	1960	1960	1960	1960	-	1957	1957	1955
Street Address	10 Purdue Ave	14 Purdue Ave	16 Purdue Ave	107 Franklin Ave	20 Purdue Ave	35 Franklin Ave	29 Franklin Ave	25 Franklin Ave	21 Franklin Ave	6 Hiawatha Blvd	8 Hiawatha Blvd	11 Pine Crest Dr	15 Pine Crest Dr	17 Pine Crest Dr	19 Pine Crest Dr	21 Pine Crest Dr	20 Pine Crest Dr	18 Pine Crest Dr	16 Pine Crest Dr	14 Pine Crest Dr	524 Ramapo Valley Rd	19 Tecumseh Trail	15 Tecumseh Trail	13 Tecumseh Trail	9 Tecumseh Trail	6 Tecumseh Trail	10 Tecumseh Trail	26 Tecumseh Trail	28 Tecumseh Trail	53 Hiawatha Blvd	51 Hiawatha Blvd	41 Hiawatha Blvd	39 Hiawatha Blvd
k/Lot	-	2	3	4	2	20	21	22	23	24	25	37	38	39	40	41	42	43	44	45	2	5	9	7	8	11	12	16	17	18	19	24	25
Block/Lot	4401	4401	4401	4401	4401	4401	4401	4401	4401	4401	4401	4401	4401	4401	4401	4401	4401	4401	4401	4401	4601	4601	4601	4601	4601	4601	4601	4601	4601	4601	4601	4601	4601
Neighborhood	11. Mirror Lake	11. Mirror Lake	11. Mirror Lake	11. Mirror Lake	11. Mirror Lake	11. Mirror Lake	11. Mirror Lake	11. Mirror Lake	11. Mirror Lake	11. Mirror Lake	11. Mirror Lake	11. Mirror Lake	11. Mirror Lake	11. Mirror Lake	11. Mirror Lake	11. Mirror Lake	11. Mirror Lake	11. Mirror Lake	11. Mirror Lake	11. Mirror Lake	11. Mirror Lake	11. Mirror Lake	11. Mirror Lake	11. Mirror Lake	11. Mirror Lake	11. Mirror Lake	11. Mirror Lake	11. Mirror Lake	11. Mirror Lake	11. Mirror Lake	11. Mirror Lake	11. Mirror Lake	11. Mirror Lake



Borough of Oakland Septic Problem Statement OK-1585 Neighborhood 11: Mirror Lake

Neighborhood	Block/Lot	<th>Street Address</th> <th>Year Designed</th> <th>Year Repaired</th> <th>System Failures</th> <th>Cesspool (Y/N)</th> <th>Comments</th>	Street Address	Year Designed	Year Repaired	System Failures	Cesspool (Y/N)	Comments
11. Mirror Lake	4601	26	37 Hiawatha Blvd	1957	1973 / 2000	2000 - Septic system overflowing onto ground	N	
11. Mirror Lake	4601	59	25 Hiawatha Blvd	1959	1978 / 2003	•	N	1978 - seepage pit relocated
11. Mirror Lake	4601	31		1968		,	Z	
11. Mirror Lake	4601	32	19 Hiawatha Blvd	1960	1974	•	N	
11. Mirror Lake	4601	33	15 Hiawatha Blvd	1956	1964 / 1998		N	1998 - New system
11. Mirror Lake	4601	34	13 Hiawatha Blvd	1972	-	•	N	
11. Mirror Lake	4601	35	11 Hiawatha Blvd	1971	2009	•	N	
11. Mirror Lake	4602	1	52 Hiawatha Blvd	1956		•	Ь	
11. Mirror Lake	4602	2	6 Oswego Ave	1956	1970 / 1986 / 2012	1970/1986/1992 - overflowing system	λ	1967 - Cesspool Removed
11. Mirror Lake	4602	3	8 Oswego Ave	1966	1974 / 1985 / 1992 / 2011	1985 / 2011 - Photos of rawr sewege on ground	-	1985 - Sewege flowing offsite, courts involved to fix
11. Mirror Lake	4602	4	10 Oswego Ave	1959	1998	•	У	1998 - New system
11. Mirror Lake	4602	2	12 Oswego Ave	1960	2014	,	Υ	
11. Mirror Lake	4602	9	14 Oswego Ave	1970	1981 / 1996	•	N	
11. Mirror Lake	4602	7	16 Oswego Ave	1957		,	Z	
11. Mirror Lake	4602	8	18 Oswego Ave	1959	1982 / 2000	,	>	
11. Mirror Lake	4602	6	20 Oswego Ave	-	1984 / 2014		Υ	2014 - Cesspool Removed
11. Mirror Lake	4602	10	22 Oswego Ave	-	1972 / 2003	1972 - Septic system overflow	N	
11. Mirror Lake	4602	11	24 Oswego Ave	1959	1985 / 1996	•	У	
11. Mirror Lake	4602	12	26 Oswego Ave	1954	1999	,	λ	
11. Mirror Lake	4602	14	31 Calumet Ave	1957	1984 / 2002	1984 - Overflowing system	Ν	
11. Mirror Lake	4602	15		-	1972 / 1996 / 2002	•	N	
11. Mirror Lake	4602	16	27 Calumet Ave	1964	1987	•	Ν	
11. Mirror Lake	4602	17	25 Calumet Ave	1953		•	N	
11. Mirror Lake	4602	18	23 Calumet Ave	1957	1966	•	Ν	
11. Mirror Lake	4602	16	21 Calumet Ave	1955		•	Ь	
11. Mirror Lake	4602	20	19 Calumet Ave	1958	2006	,	Z	
11. Mirror Lake	4602	21	15 Calumet Ave	1954	1962 / 1996	•	N	
11. Mirror Lake	4602	22	13 Calumet Ave	1957	1983	1983 - Overflowing system	У	
11. Mirror Lake	4602	23	11 Calumet Ave	1963	1989 / 2010	•	Ν	1989 - New Bed
11. Mirror Lake	4602	24	9 Calumet Ave	1962	1998		Ν	-
11. Mirror Lake	4602	25	7 Calumet Ave	1963	1984	1984 - Overflowing system	У	
11. Mirror Lake	4602	26	3 Calumet Ave	1959	1964 / 2011	•	Z	1964 - Moved bed, new drainage easement onsite
11. Mirror Lake	4602	27	33 Seminole Ave	1961	1973 / 2005	•	Х	

ISZ4

Boswell Engineering 330 Phillips Avenue South Hackensack, NJ 07606

Borough of Oakland Septic Problem Statement OK-1585 Neighborhood 11: Mirror Lake

Comments	2011 - Plan show an existing cesspool		Proposed subdivision	-			-			-													
Cesspool (Y/N)	У	У	-	Υ	Υ	У	N	У	N	Υ	N	У											
System Failures		•		-	-				1981 - Overflowing system	1959,1964 - Overflowing system	1970,1972 - Overflowing system	1975,1979 - Drainage complaints											
Year Repaired	1967 / 2011	2011	1995	1968 / 1985	1975	1981 / 2014	1990	1992	1965 / 1981 / 2005	1959 / 1964 / 2005	1970 / 2005	1975 / 1979 / 1994 / 2008											
Year Designed	1954	1955	1957	1954	1955	1953	1956	-	1957	-	1955	1959											
Street Address	31 Seminole Ave	27 Seminole Ave	Seminole Ave	20 Hiawatha Ave	24 Hiawatha Ave	28 Hiawatha Ave	34 Hiawatha Ave	38 Hiawatha Ave	42 Hiawatha Ave	44 Hiawatha Ave	46 Hiawatha Ave	48 Hiawatha Ave											
Block/Lot			2 31						5 40	2 41	2 42		 			 		 	 	 	 	 	
面	4602	4602	4602	4602	4602	4602	4602	4602	4602	4602	4602	4602											
Neighborhood	11. Mirror Lake	11. Mirror Lake	11. Mirror Lake	11. Mirror Lake	11. Mirror Lake	11. Mirror Lake	11. Mirror Lake	11. Mirror Lake	11. Mirror Lake	11. Mirror Lake	11. Mirror Lake	11. Mirror Lake											



Borough of Oakland Septic Problem Statement OK-1585 Neighborhood 12: Munic & Rec

() Comments	Senior Center	First Aid Building				•	1	1993 - Septic tank installed	•			•		•	•	•	•	-	•	1969 - Septic tank installed / 2007 - Pool replaced			•		•	•	•	•					
Cesspool (Y/N)	Z	>	Z	Z	Z	Z	Z	\	Z	У	У	Z	Ν	Z	Z	Z	Z	Ν	>	>	Z	Z	Z	Z	Z	Z	Z	Z	Z	У	Ν	Υ	
System Failures		Motor oil in septic tank										Open well between house and adjacent propoerty										-							-				
Year Repaired	1991	1995	1990	1990	1993	1989	1989 / 2011 / 2012	1993	2009	1980 / 1986	1964	2012	1986		1980		1990	2014	2007	1969 / 2007	1969	1986 / 2006	2006 / 2009	•	-	-	2009		1994 / 1995 / 2004	1971 / 1984	1986 / 2015	1989	
Year Designed	1966	1961	1988	1988	1988	1988	1988	1988	1988	1956	1953	1977	-	1967	1967	1968	1967	1967	1968	1968	1967	1967	1967	1968	1967	1967	1969	1962	1958	1960	1984	1948	<u> </u>
Street Address	20 Lawlor Dr	285 Ramapo Valley Road	39 Butternut Ct	35 Butternut Ct	31 Butternut Ct	27 Butternut Ct	23 Butternut Ct	19 Butternut Ct	15 Lawlor Dr	279 Ramapo Valley Road	281 Ramapo Valley Road	277 Ramapo Valley Road	267 Ramapo Valley Road	14 Aspen Way	18 Aspen Way	22 Aspen Way				38 Aspen Way	35 Aspen Way	31 Aspen Way	27 Aspen Way	23 Aspen Way		15 Aspen Way	11 Aspen Way	261 Ramapo Valley Road	259 Ramapo Valley Road	255 Ramapo Valley Road	4 Bailey Ave	10 Bailey Ave) (S)
Block/Lot	2	4	2	9	7	8	6	10	11	12	13	14	15	16	17	18	19	20	21	22	23	24	25	79	27	28	29	30	31	32	33	34	
Blo	1901	1901	1901	1901	1901	1901	1901	1901	1901	1901	1901	1901	1901	1901	1901	1901	1901	1901	1901	1901	1901	1901	1901	1901	1901	1901	1901	1901	1901	1901	1901	1901	
Neighborhood	12. Munic & Rec	12. Munic & Rec	12. Munic & Rec	12. Munic & Rec	12. Munic & Rec	12. Munic & Rec	12. Munic & Rec	12. Munic & Rec	12. Munic & Rec	12. Munic & Rec	12. Munic & Rec	12. Munic & Rec	12. Munic & Rec	12. Munic & Rec	12. Munic & Rec	12. Munic & Rec	12. Munic & Rec	12. Munic & Rec	12. Munic & Rec	12. Munic & Rec	12. Munic & Rec	12. Munic & Rec	12. Munic & Rec	12. Munic & Rec	12. Munic & Rec	12. Munic & Rec	12. Munic & Rec	12. Munic & Rec	12. Munic & Rec	12. Munic & Rec	12. Munic & Rec	12. Munic & Rec	_

LIBZ4

Boswell Engineering 330 Phillips Avenue South Hackensack, NJ 07606

Borough of Oakland Septic Problem Statement OK-1585 Neighborhood 12: Munic & Rec

	Cesspool (Y/N) Comments	γ.	N Oakland DPW	- N	- N	Y 1983 - Septic tank installed			· .				Y Teptic tank install / Also repaired in: 2014, 2015	· · · · · · · · · · · · · · · · · · ·	N American Legion Post # 369										
	Cesspi																								
Neighborhood 12: Maine & Nee	System Failures	-				Sewage leakage causing health hazards								Catch basin loaded with grease											
	Year Repaired	2000	1978 / 1995	2003	1972 / 1978	1983	1992	-	2000	2000	1995	•	1966 / 1971 / 2001 / 2003	1999 / 2010 / 2012 / 2013	•										
	Year Designed	1959	1966	1958	1961	1949	-	1968	1960	-	9961	1960	1955	1957	1956										
	Street Address	20 Bailey Ave	63 Oak St	41 Oak St	35 Oak St	31 Oak St	29 Oak St	23 Oak St	21 Oak St	17 Oak St	13 Oak St	9 Oak St	Municipal Plaza	315 Ramapo Valley Road	65 Oak St										
	Block/Lot	36	1	2	2	9	8	6	10	11	12	14	18	19	21										
	Bloc	1901	1803	1803	1803	1803	1803	1803	1803	1803	1803	1803	1803	1803	1803										
	Neighborhood	12. Munic & Rec	12. Munic & Rec	12. Munic & Rec	12. Munic & Rec	12. Munic & Rec	12. Munic & Rec	12. Munic & Rec	12. Munic & Rec	12. Munic & Rec	12. Munic & Rec														

EST.

Boswell Engineering 330 Phillips Avenue South Hackensack, NJ 07606

Borough of Oakland Septic Problem Statement OK-1585 Neighborhood 13: Potash Lake

	Comments		•	1988 - Replaced existing deck				1968 - Septic tank installed	1970 - Cesspool installed	•		2013 - Emergency Overflow trench added	2009 - New deck installed					•	•	•	•	-					1989 - New septic tank installed				
	Cesspool (Y/N)	Ν	Ν	Ν	Ν	Z	Ν	У	У	Ν	Ν	Ν	Z	У	Z	Z	Ν	Ν	Ν	Ν	Ν	Ν	Z	Ν	Ν	Ν	Ν	Ν			
:	System Failures	Septic overflow						Septic tank overflowing							Overflowing septic system				Overflowing septic system	Overflowing septic system on side yard				Septic tank overflowing , Water in basement				Spetic tank overflowing in front yard onto driveway			
	Year Repaired	1985	1982	-	1969 / 1990	2001	1992	1968 / 1981	1970 / 1983	2015	1970 / 1994	1982 / 2013	1973	-	1995	1661	1993	1975	1970	1973	1971 / 2007 / 2008	1981	1971	1992 / 2008	1979	1989	1989	1976			
	Year Designed	1959	1972	1973	1964	•	-	1964	1965	1964	-	1965	1956	1955	1972	•	-	1972	1965	1964	-	-	1963	1949	1	1	-	-			
	Street Address	49 Island Terr	45 Island Terr	41 Island Terr	33 Island Terr	3 Island Terr	76 Island Terr	60 Island Terr	58 Island Terr	54 Island Terr	46 Island Terr	42 Island Terr	36 Island Terr	24 Island Terr	137 Lakeview Terr	133 Lakeview Terr	123 Lakeview Terr	117 Lakeview Terr	113 Lakeview Terr	107 Lakeview Terr	105 Lakeview Terr	103 Lakeview Terr	99 Lakeview Terr	93 Lakeview Terr	89 Lakeview Terr	87 Lakeview Terr	85 Lakeview Terr	81 Lakeview Terr			
	Block/Lot				2205 5	2205 7		2203 3			2203 7			2203	2518 1	2518 2		2518 5			2518 9	2518 10	2518 11	2518 12	2518 13	2518 14	2518 15	2518 16	 	 	
	Neighborhood		13. Potash Lake		Potash Lake	13. Potash Lake	Potash Lake	Potash Lake	13. Potash Lake	Potash Lake	13. Potash Lake	Potash Lake	Potash Lake	13. Potash Lake	13. Potash Lake	13. Potash Lake		13. Potash Lake	13. Potash Lake	Potash Lake	13. Potash Lake	Potash Lake	13. Potash Lake	13. Potash Lake	13. Potash Lake	Potash Lake	Potash Lake	Potash Lake			

Boswell Engineering 330 Phillips Avenue South Hackensack, NJ 07606

	Comments	1971 - Septic tank installed		•	,		•	,	,	,	1983 - In ground pool installed	-		,	•		•		,		•	•	-	•	-					
	Cesspool (Y/N)	>-	>-	А	Z	N	N	\	>	\	А	У	Ν	Z	Т	Z	N	Z	Z	N	Ν	N	N	N	Ν					
Borough of Oakland Septic Problem Statement OK-1585	System Failures			•							•		•		•		•		1		•				•					
Borol Septic P	Year Repaired	1971 / 1992	1984	1996 / 2013	1970 / 1985	1980	2012	1984	2001 / 2004	1975 / 2000	1983	1977 / 1981 / 2014	-		-	2002 / 2009	1972 / 1997		1986	1985 / 2010	1986 / 1987	1978 / 1986 / 2015	1974	1988	1978					
	Year Designed	1954	1955	1958	-	-	1956	1954	1954	1954	1957	1956	1966	1966	1958	•	1969	6961	1984	1984	1985	1977	1972	1986	1977					
	Street Address	424 W Oakland Ave	422 W Oakland Ave	416 W Oakland Ave	412 W Oakland Ave	408 W Oakland Ave	404 W Oakland Ave	400 W Oakland Ave	396 W Oakland Ave	392 W Oakland Ave	388 W Oakland Ave	384 W Oakland Ave	7 Pool Hollow Ave	5 Pool Hollow Ave	380 W Oakland Ave	Edison Ave	50 Edison Ave	28 Edison Ave	38 Edison Ave	40 Edison Ave	65 Edison Ave	45 Edison Ave	37 Edison Ave	29 Edison Ave	19 Edison Ave					
	Block/Lot	1 1		102 3	102 4	102 5	102 6	7 7)2 8		10)2 11	12)2 13	14)1 1)1 3)1 4)1 5	9 1()1 9)1 10)1 11)1 12	 	 	***************************************	 	
EST. 1924	Neighborhood	15. Industrial 102	15. Industrial 102	15. Industrial	15. Industrial 10	15. Industrial	15. Industrial 10	15. Industrial 102	15. Industrial 102	15. Industrial 102	15. Industrial 102	15. Industrial 102	15. Industrial 102	15. Industrial 102	15. Industrial 102	15. Industrial 201														



Borough of Oakland Septic Problem Statement OK-1585 Neighborhood 17: Ramapo River

	599 Ramapo Valley Rd	1959	1997		>- -	
	2 Thunderbird Dr	1962	1990 / 2004	-	·	
)1 10	6 Thunderbird Dr	1961	1969 / 1982	-	Y	2015 - Still using greywater cesspool with the septic
1301 11	14 Thunderbird Dr	1961	2005	-	Х	
1301 12	20 Thunderbird Dr	1962	1994	-	Υ	
1301 13	26 Thunderbird Dr	1962	•	-	Y	•
1301	32 Thunderbird Dr	1962	1982	-	γ	-
1301 15	44 Thunderbird Dr	1962	1980	-	Υ	•
1301	7 Arapaho Ct	1962	1970	-	Υ	•
1301 17	11 Arapaho Ct	1963	2013	-	Υ	•
1301 18	12 Arapaho Ct	1962	2007 / 2014	-	Υ	
1301 19	10 Arapaho Ct	1962	ı	-	Υ	
1301 20	6 Arapaho Ct	1962	2009	-	У	•
1301 21		1963	1971	-	Y	•
1301 22	56 Thunderbird Dr	1963	1988 / 2012	-	Υ	•
1301 23	2	1956	1996	-	Υ	
1301 24	. 19	1992	1993		N	1992 - New construction
	22	1963	1978 / 1987	-	Υ	•
	51 Thunderbird Dr	1963	2013		У	-
1301 27	45	1962	2006		N	•
	36	1962		-	Ь	•
	33 Thunderbird Dr	1962	1985		У	-
1301 30	27	1962	2003		У	•
	59	1963	1999	-	N	-
901 12	65 Glen Gray Rd	1963	1	-	Z	•
901 13	59 Glen Gray Rd	1962		-	N	•
901 14	51 Glen Gray Rd	1962	-		N	-
106	45 Glen Gray Rd	1961		-	Z	•
901 16		1962	1980	-	N	•
17	25 Glen Gray Rd	1973	1976 / 1982 / 2001	1982 - Septic overflow	Υ	
901 18	17 Glen Gray Rd	1973	1976	-	γ	•
901 19	9 Glen Gray Rd	1969	1979 / 2001	-	N	•
901 20	855 Ramapo Valley Rd	1949	1956 / 1967 / 2001	-	γ	



Borough of Oakland Septic Problem Statement OK-1585 Neighborhood 17: Ramapo River

Comments							-			-				1996 - Subdivision	2000 - Subdivision		-							2014 - New System			-				-		
Cesspool (Y/N)	z	Z	Ν	Ν	N	N	N	Ν	N	N	Ν	Ν	Ν	Z	Z	Х	Ν	N	N	Ν	N	N	N	N	N	Ν	N	N	N	N	N	N	Ν
System Failures			•	•	,	•	•	•	•	•	•	•	•								•	•	•		•	•	•				-		
Year Repaired	2002 /	1980 / 2015	1982	-	1968 / 1972	1998	1970 / 1972 / 1997 / 2005	1982	-	1968 / 1972	1998	1970 / 1972 / 1997 / 2005	1996	1997	1999 / 2001	1988 / 1997	-	-	-	-	1999	1980 / 2008	-	2014	-	-	-	-	-	-	2008	1984	-
Year Designed	1974	1974	1979	1979	1961	1960	1959	1979	1979	1961	1960	1959	1961	1	1997	1978	1998	1998	1998	1998	1965	1966	1967	1971	1970	1972	1968	1969	1965	1965	1967	1964	1964
Street Address	845 Ramapo Valley Rd	837 Ramapo Valley Rd	833 Ramapo Valley Rd	829 Ramapo Valley Rd	819 Ramapo Valley Rd	815 Ramapo Valley Rd	807 Ramapo Valley Rd	833 Ramapo Valley Rd	829 Ramapo Valley Rd	819 Ramapo Valley Rd	815 Ramapo Valley Rd	807 Ramapo Valley Rd	799 Ramapo Valley Rd	791 Ramapo Valley Rd	781 Ramapo Valley Rd	773 Ramapo Valley Rd	2 Valley Forge Rd	4 Valley Forge Rd	6 Valley Forge Rd	8 Valley Forge Rd	28 Saratoga Dr	12 Heath Rd	18 Heath Rd	23 Brandywine Pl	17 Brandywine Pl	15 Brandywine Pl	9 Brandywine Pl	5 Brandywine Pl	14 Gates End	10 Gates End	4 Gates End	13 Gates End	9 Gates End
Block/Lot	901 21	901 22	901 23		901 25	901 26	901 27	901 23			901 26		901 28	901 29	901 30						1002 1	1002 2	1002 3	1002 4	1002 5	1002 6		1002 8	1002 9	1002 10	1002		1002
Neighborhood	17. Ramapo River	17. Ramapo River		17. Ramapo River				17. Ramapo River	17. Ramapo River	17. Ramapo River	17. Ramapo River	,	17. Ramapo River		17. Ramapo River	17. Ramapo River	17. Ramapo River	17. Ramapo River	17. Ramapo River	17. Ramapo River			17. Ramapo River	17. Ramapo River	17. Ramapo River	17. Ramapo River	17. Ramapo River	17. Ramapo River	17. Ramapo River	17. Ramapo River	17. Ramapo River		17. Ramapo River



Borough of Oakland Septic Problem Statement OK-1585 Neighborhood 18: Skyline

	Comments			•	•	•	•	•		2008 - New system	,	•	,	•	•	•	-	1984 - Subdivision into 3 lots	•		•	•			•		1978 - New System	•	2011 - New System	•	•	•	•	
	Cesspool (Y/N)	Z	N	N	N	Т	N	\	N	Ν	N	N	Z	N	N	N	N	N	N	N	λ	Ν	У	λ	У	N	Z	λ	У	У	Х	У	У	N
IIOOU IO. SKYIIIE	System Failures	-			-	-				-						-	-		1975,1977 - System Malfunction			-			-			-		-	-	_		_
Neigilbulloud 16.	Year Repaired	1988	-	-	1972 / 1982	•	2001			1988 / 2008	1	1989 / 2000	1973 / 2004	1977 / 2013	-	1986	-	-	1980 / 2002	2013	-	1991	2003	2004	2015	-		2000	2011	1996	-	1990	1967 / 2003	1985 / 1987 / 2000 / 2003
	Year Designed	1977	1977	1958	1966	1956	1967	1959	1956	1962	1972	1963	1961	1968	1967	1984	1984	1984	1966	1968	1960	1989	1955	1956	1957	1958	1978	1960	1958	1962	1958	1959	1959	1978
	Street Address	175 Skyline Dr	155 Skyline Dr	149 Skyline Dr	137 Skyline Dr	125 Skyline Dr	115 Skyline Dr	119 Truman Blvd	115 Truman Blvd	109 Truman Blvd	101 Truman Blvd	99 Truman Blvd	97 Truman Blvd	95 Truman Blvd	93 Truman Blvd	91 Truman Blvd	87 Truman Blvd	83 Truman Blvd	81 Truman Blvd	79 Truman Blvd	65 Truman Blvd	61 Truman Blvd	66 Skyline Dr	70 Skyline Dr	76 Skyline Dr	90 Skyline Dr	106 Skyline Dr	118 Skyline Dr	124 Skyline Dr	130 Skyline Dr	140 Skyline Dr	146 Skyline Dr	152 Skyline Dr	158 Skyline Dr
	Block/Lot	401 8,9	401 10	401 11	401 12	401 14				402 5	402 7	402 8	402 9	402 10	402 11	02 12	02 13		402 15		402 19	402 20				402 47	402 48						402 55	402 56
	Neighborhood	18. Skyline 40	18. Skyline 4(18. Skyline 4(18. Skyline 40	18. Skyline 4(18. Skyline 40	18. Skyline 40	18. Skyline 40	18. Skyline 4(18. Skyline 4(18. Skyline 4(18. Skyline 40	18. Skyline 40	18. Skyline 40	18. Skyline 4(18. Skyline 4(18. Skyline 40	18. Skyline 40	18. Skyline 40	18. Skyline 4(18. Skyline 40	18. Skyline 4(18. Skyline 4(18. Skyline 4(18. Skyline 40	18. Skyline 4(18. Skyline 4(18. Skyline 40			18. Skyline 40



Borough of Oakland Septic Problem Statement OK-1585 Neighborhood 19: West Oakland

Street Address Year Designed Year R. 48 A-B Park Dr 1976		Year Repaired	System Failures	Cesspool (Y/N)	
d Ave	1964	1964 / 1996	-	\forall	1964 - Spetic tank installed
4 Park Dr	1980 -	-	System Overflow onto ground	Z	
6 Park Dr 1965			-	Z	,
8 Park Dr - 2004 /		2004 / 2005 / 2013	-	Z	
10 10 Park Dr 1982 1991		1991	Sewage leakage in rear yard	Z	
1971		1988		N	1988 - New septic tank installed
12 14 Park Dr 1966 1975 / 1987		1975 / 1987	-	Ν	
2003	- 2002 / 2003 / 2004	2002 / 2003 / 2004	-	Ν	
18 Park Dr 1970 197		1976 / 2000	Spetic tank leaking and causing odors in dwelling	Ν	
15 20 Park Dr 1973 1997		1997		Ν	
16 22 Park Dr 1973 2000		2000	Septic tank / pipes exposed causing health hazard	Ν	
17 24 Park Dr 1961 -	- 1961	-	-	Ν	
18 26 Park Dr 1981 2008		2008	_	Ν	
19 28 Park Dr - 2008	- 2008	2008		Z	•
20 30 Park Dr 1973 2013		2013	_	Ν	-
32 Park Dr		1995 / 1997	-	N	1007 - Spetic tank replaced
	1973 -	•	-	Ν	-
23 36 Park Dr 1970 1977 / 1994	,	1977 / 1994	-	Ν	
	1970 -	-	-	Ν	
4 197 West Oakland Ave 1955 1963		1963	-	У	1963 - Septic Installed
5 193 West Oakland Ave - 2009	- 5009	2009	1979/1988 - Inspected, no issues, no record of tanks	У	2009 - Remove cesspool
6 189 West Oakland Ave 1957 1969		1969		У	
		1964			1964 - New tank
		1996	_	Ν	1986 - Subdivision (OKES-210-10)
9 179 West Oakland Ave 1970 -	- 1970	-	-	Ν	1986 - Subdivision
10 173 West Oakland Ave 1960 1993		1993	-	У	1960 - Septic installed, abandoned cesspool till 1993
11 171 West Oakland Ave 1973 -	- 1973	•		Υ	1973 - Septic Installed
12 167 West Oakland Ave - 2004	- 2004	2004		Υ	2004 - Septic plans rejected
13 163 West Oakland Ave 1954 1980 / 2004		1980 / 2004	-	>-	
14 159 West Oakland Ave 1975 1985		1985	-	Υ	1985 - Septic Installed
	- 1960	-	-	У	•
1.2 8A Riverside Dr 1960 -	- 1960			Υ	



Borough of Oakland


Comments				•				,					,	1971 - New septic tank installed	1983 - Septic tank installed	,				1966 - Septic tank installed	1982 - Septic tank installed			1987 - Subdivide into 4 lots						NJDEP 0242-14-0001.1 FHA 140001	NJDEP 0242-14-0002.1 FHA 140001		
Cesspool (Y/N)	N	>	Z	Z	\	\	>	>	Z	Z	Х	Z	Z	Z	Z	>	Z	Z	Ν	>	>-		Ν	\	N	Ν	\	X	У	Ν	Ν	Υ	Z
System Failures																	Septic is being pumped out into the street													1991 - Overflowing septic		2012 - Bamboo onsite, Oakland told them to remove	
Year Repaired	-	-	2015	1967 / 1983 / 1988 / 2012	-		-	-	-	-	1983		1977 / 1987	1971		1956 / 1986	-	-	-	1966	1983	1980 / 1998	1965 / 1979 / 1995	1993 / 2005	-	1986	1968 / 2009	2011	1952 / 1960	1962 / 1990 / 1993	1969 / 1972 / 1980 / 2010	1986 / 2000 / 2003	1985
Year Designed	1963	1960	6961	1961	1961	1960	1960	1960	161	161	1980	1980	1969		1983	1948	1960	1983	1959	1950	1963		1960	1958	1992	1963	1954	1962	1949	1956	1961	1954	1966
Street Address	10A Riverside Dr	12A Riverside Dr	4 Riverside Dr	55 Park Dr	6 Riverside Dr		10 Riverside Dr	12 Riverside Dr	18 Riverside Dr	22 Riverside Dr	26 Riverside Dr	30 Riverside Dr	32 Riverside Dr	34 Riverside Dr		40 Riverside Dr	42 Riverside Dr	44 Riverside Dr	46 Riverside Dr	48 Riverside Dr	52 Riverside Dr	115 West Oakland Ave	33 Hillside Ave	31 Hillsode Ave	29 Hillside Ave	23 Hillside Ave	19 Hillside Ave	15 Hillside Ave	11 Hillside Ave	22 River Rd	24 River Rd	26 River Rd	30 River Rd
Block/Lot	2004 1.3	2004 1.4	2004 2.1	2004 2.2	2004 4.1	2004 4.2	2004 5.1	2004 5.2	2004 7	2004 8	2004 9	2004 10	2004 11	2004 12	2004 13	2004 14,15	2004 16	2004 17	2004 18	2004 19	2004 20	1805 1	1805 2	1805 3	1805 4	1805 5	1805 6	1805 7	1805 8	1805 10	1805 11	1805 12	1805 13
Neighborhood	19. West Oakland	19. West Oakland	19. West Oakland	19. West Oakland	19. West Oakland	19. West Oakland	19. West Oakland	19. West Oakland	19. West Oakland	19. West Oakland	19. West Oakland	19. West Oakland	19. West Oakland	19. West Oakland	19. West Oakland	19. West Oakland	19. West Oakland	19. West Oakland	19. West Oakland	19. West Oakland	19. West Oakland	19. West Oakland	19. West Oakland	19. West Oakland	19. West Oakland	19. West Oakland	19. West Oakland	19. West Oakland	19. West Oakland	19. West Oakland	19. West Oakland	19. West Oakland	19. West Oakland

LISZA 1924

Boswell Engineering 330 Phillips Avenue South Hackensack, NJ 07606

Borough of Oakland Septic Problem Statement OK-1585 Neighborhood 19: West Oakland

	Comments			1964 - Fire destroyed the existing home				1990 - Subdivsion / 2011 - New System								2014 - New System											
	Cesspool (Y/N)	У	Ν	Ν	N	N	Ν	Ν	N	Ν	Ь	N	λ	N	У	ı	N	Ь	Т								
Meighborhood 17: Mest Calvialia	System Failures			1978 - Well water onsite contaminated													-		Old oil pit not properly abandoned								
	Year Repaired	1972 / 1992	1972 / 1990	1983 / 2009	1981	2001	-	2003 / 2011	1997	1982 /	-	-	1998	1995	2009	2014	1988	1963 / 1977 / 2001	2005								
	Year Designed	1958	1963	1954	1956	1960	1960	-	1953	1958	1959	1968	1959	1979	1959	ı	-	1952	1953								
	Street Address	36 River Rd	38 River Rd	62 River Rd	24 Poplar St	53 Silver Birch Ave	43 Silver Birch Ave	35 Silver Birch Ave	29 Silver Birch Ave	17 Silver Birch Ave	11 Silver Birch Ave	78 West Oakland Ave	10 Valley View Ave	21 Valley View Ave	19 Valley View Ave	15 Valley View Ave	9 Valley View Ave	90 & 94 W Oakland Ave	104 W Oakland Ave								
	Block/Lot	5 15	5 16		2 8		2 11	2 12	2 13				2 17				2 25				 	 	 	 	 	 	
	Neighborhood	19. West Oakland 1805	19. West Oakland 1805	19. West Oakland 1702	19. West Oakland 1702	19. West Oakland 1702	19. West Oakland 1702		19. West Oakland 1702			19. West Oakland 1702		19. West Oakland 1702	19. West Oakland 1702												



FILED

SEP 2 6 2001

JONATHAN N. HARRIS

SUPERIOR COURT OF NEW JERSEY
LAW DIVISION

BERGEN COUNTY

JEFFER, HOPKINSON & VOGEL 1600 Route 208 North P.O. Box 507 Hawthorne, New Jersey 07507 Tcl. (973) 428-0100 Attorneys for Plaintiff, PINNACLE COMMUNITIES LTD.

PINNACLE COMMUNITIES LTD. and BI-COUNTY DEVELOPMENT CORPORATION.

Plaintiffs,) (Consolid

DOCKET NO.: BER-L-8848-99 (Consolidated With BER-L-2444-00) Civil Action

VS.

BOROUGH OF OAKLAND and TOWNSHIP OF WAYNE, Defendants.

BAKER RESIDENTIAL, L.P., and THOMJAC, INC.,

Plaintiffs,

VS.

BOROUGH OF OAKLAND and TOWNSHIP OF WAYNE,

Defendants.

ORDER OF FINAL JUDGMENT

(Mount Laurel)

THIS MATTER having come before the Court on the date designated for triand the parties having filed cross-motions for summary judgment, Jerome A. Voge Esq., of Jeffer, Hopkinson & Vogel, appearing on behalf of Pinnacle Communitie Ltd.; David R. Oberlander, Esq., of Flaster Greenberg, appearing on behalf of E County Development Corp., Michael B. Kates, Esq., of Nashel Kates, Nussmar Rapone, Ellis & Traum, appearing on behalf of Baker Residential; Joseph V MacMahon, Esq., of Struble, Ragno, Petrie, Spinato, Bonanno, MacMahon, & Conta appearing on behalf of the Borough of Oakland; Joseph J. Maraziti, Jr., Esq., of Maraziti, Falcon & Healey, appearing on behalf of the Township of Wayne; an Laurence R. Maddock, Esq., of Waters, McPherson & McNeill, appearing on behalf of Pines Lake Association; and it appearing that no genuine issue of material face exists, the Court having considered the pleadings, briefs, documents and argument submitted by respective counsel; and for good cause as enunciated in the Court oral opinion on the record on September 5, 2001;

IT IS, on this 26 day of SEMEMBLA, 2001,

ORDERED, that judgment be and hereby is entered as follows:

ORDERED, that the Township of Wayne has a constitutional obligation is accept all waste water effluent from plaintiffs' qualifying inclusional developments, or either of them, by means of the alternate Pinnacle service optic described in a December 2000 report of Daniel D. Kelly as modified by deposition of May 8, 2001, and as reasonably modified in the future based upon engineering requirements, if any; and it is further

ORDERED, that the Township of Wayne take all necessary municipal action to permit its acceptance of all waste water effluent from plaintiffs' qualifyir inclusionary developments by means of the alternate Pinnacle service optic described in a December 2000, report of Daniel D. Kelly as modified by deposition

on May 8, 2001, and as reasonably modified in the future based upon engineerin requirements.

That the foregoing mandatory injunction, (mandamus), is conditioned on the following:

- (A) Final unappealed COAH substantive certification of a housing element and fair share plan for the Borough of Oakland that includes either or both of plaintiffs' inclusionary developments.
- (B) Final unappealed approval by all Federal and State regulator agencies having jurisdiction over the Township of Wayne's waste wate infrastructure, including, but not necessarily limited to, the New Jerse Department of Environmental Protection, and any funding agencies, if any.
- (C) Receipt of final and unappealed land use development approvals under the Municipal Land Use Law.
- (D) This judgment shall not preclude any party from appearing i opposition to the plaintiffs' projects in any forum lawfully available, including but not limited to the Council On Affordable Housing, the New Jersey Department of Environmental Protection, and the Borough of Oakland Planning Board.

ORDERED, that an interlocal service agreement shall be executed an delivered between the Borough of Oakland and the Township of Wayne to provid for reasonable non-discriminatory fees and charges in relation to the plaintiff connection to the Township of Wayne's waste water infrastructure; and it is furthe:

ORDERED, that the governing bodies of the Township of Wayne and the Borough of Oakland shall work with all deliberate speed to negotiate, execute an

to deliver said interlocal service agreement no later than December 31, 2001, and shall permit input from and cooperate with plaintiffs during the municipa negotiation; and it is further

ORDERED, that the interlocal service agreement, (or if the parties agree in ; separate agreement or agreements) include by way of illustration but not limitation the following:

- (A) the ownership of the 1 to 2 mile pipeline described in the alternation Pinnacle service option, the expense of construction and the expense of construction oversight (inspection by Wayne's construction experts), repair and replacement issues and the costs thereof, the allowance if any for other connections to this pipeline (the Court neither requiring nor prohibiting other connectivity); and
- (B) References and issues concerning connection fees and user fees with deference to debt service and other fiscal matters relating to the sanitary sewe system of the Township of Wayne.

ORDERED, that the Court does not retain jurisdiction but remains available pursuant to the Rules of Court for applications in aid of litigants' rights.

ORDERED, that there shall be no reallocation of costs for attorney's fees t any party; and it is further

ORDERED, that a copy of this Order shall be served upon all attorneys c record in the within matter within seven (7) days of the date hereof.

This movion was:

__Unoppoked

J.S.O

APPENDIX E - Calculated Flow

As Per N.J.A.C. 7:14A-23

Total Flow for Area by Zoning

LOCAL	BUSINESS		
<u>BLOCK</u>	<u>LOT</u>	PROP LOC	<u>GPD</u>
1706	2		781.60
1706	7		0.00
1708	4	379 RAMAPO VALLEY RD	302.70
1708	2	RAMAPO VALLEY ROAD	0.00
1708	1	391 RAMAPO VALLEY RD	620.80
1708	5	12 TERHUNE ST	750.00
1708	3	383 RAMAPO VALLEY RD	270.10
1709	1	399 RAMAPO VALLEY RD	0.00
1706	4		0.00
1706	6	20 W OAKLAND AVE	157.00
1707	2	W OAKLAND AVE	0.00
1706	5		0.00
1706	3		1,350.40
1706	8		0.00
1706	1	413 RAMAPO VALLEY RD	416.50
1802	5	357 RAMAPO VALLEY RD	200.00
1802	6	6-8-10-12&14 ELM ST	541.00
1802	4	373 RAMAPO VALLEY RD	750.40
2302	29	191 RAMAPO VALLEY RD	827.20
2302	28	195 RAMAPO VALLEY RD	542.20
2302	27	7 SPRUCE ST	113.40
2302	26	11 SPRUCE STREET	144.00
2401	7	155 RAMAPO VALLEY RD	10,400.00
2401	5	175 RAMAPO VALLEY RD	5,040.00
2401	4	FRONT-RAM VAL RD	0.00
3401	54	11 LONGHILL ROAD	431.60
3401	55	160 RAMAPO VALLEY RD	424.80
3401	60	176 RAMAPO VALLEY RD	4,200.00
3907	1	394 RAMAPO VALLEY RD	200.20
3901	1	400 RAMAPO VALLEY RD	1,375.50
3906	2	332/340 RAMAPO VALLEY RD	3,879.60
4504	34	461/465 RAM VAL RD	3,000.00
3902	4	43 YAWPO AVENUE	2,489.20
3907	7	378 RAMAPO VALLEY RD	750.00
3902	2	19 YAWPO AVENUE	749.00
3906	1	350 RAMAPO VALLEY ROAD	13,670.20
3907	6	382 R.V.R.&5 MAPLE AVE	377.60
3907	5	384 RAMAPO VALLEY RD	236.50
3907	4	388 RAMAPO VALLEY RD	379.80
3907	3	390 RAMAPO VALLEY RD	150.00
3907	2	392 RAMAPO VALLEY RD	561.00

4001	1	410 RAMAPO VALLEY RD	546.60
4002	2	3 ALLERMAN RD.	300.90
4002	1	422 RAMAPO VALLEY RD	0.00
4404	2	20 FRANKLIN AVE	735.00
4404	1	6&12 FRANKLIN AVE	2,117.70
1707	1		87.00
2401	6	169 RAMAPO VALLEY RD	3,059.20
3401	56	170 RAMAPO VALLEY RD	545.40
3401	61	186 RAMAPO VALLEY RD	600.00
4504	33	469 RAMAPO VALLEY RD	625.00
4504	35	451-3-5-7 RAMAPO VALLEY RD	658.60
4504	36	4 COURT HOUSE PL	371.80
4508	2	445 RAMAPO VALLEY RD	326.00
1705	4	4 BARBARA LA	4,200.00
3902	1	15 YAWPO AVE	451.40
3902	3	25 YAWPO AVE	691.80
3903	86	330 RAMAPO VALLEY RD	1,190.30
3903	87	11 EAST OAK STREET	754.00
1802	9	2 OAK ST	900.00
1802	8	345-349 RAMAPO VALLEY RD	3,431.50
1802	7	20 ELM ST	763.00
1802	2	15 TERHUNE ST	246.90
		TOTAL	78,684.40

CORPORATE OFFICE

<u> </u>	<u> </u>		
<u>BLOCK</u>	<u>LOT</u>	PROP LOC	<u>GPD</u>
4003	6	95 ROUTE 208	0.00
4003	5	ROUTE 208	0.00
4202	3		
4202	1	127B MCCOY ROAD	
4201	1	ROUTE 208	0.00
4101	1	97 YAWPO AVE	27,725.00
		TOTAL	27,725.00

INDUSTRIAL OFFICE

11400311	MAL OTTICE		
<u>BLOCK</u>	<u>LOT</u>	PROP LOC	<u>GPD</u>
2302	19	7 FIR COURT	7,058.60
2302	20	32 SPRUCE ST	6,524.60
2302	8	5 FIR COURT	7,095.20
2302	6	48 SPRUCE ST	7,185.80
4004	11		0.00
4005	4	5 RARITAN ROAD	9,695.20
4004	1	14 RARITAN RD	50.00
4005	3	1 RARITAN RD	19,308.80
4005	2	SHELTER LANE	0.00
4004	2	18 RARITAN ROAD	2,488.20

4005	1	SHELTER LANE	0.00
4003	3	155 ROUTE 208	230.10
4003	2	2 SHELTER LANE	767.00
4003	1	8 ALLERMAN RD.	7,060.60
4404	8	ROUTE 208	0.00
		TOTAL	67,464.10

RESIDENTIAL		
<u>TYPE</u>	NUMBER OF PARCELS	<u>GPD</u>
AFFORDABLE HOUSING	20	4,500
SINGLE FAMILY	1836	550,800
MULTI-FAMILY	88	39,600
RESIDENTIAL CLUSTER	3	900
TOWNHOUSE	2	450
	TOTAL	596,250

TOTAL 770,123.50